



June 17, 2004

Ms. Kathleen DeMeter, Esq.
Director, Office of Defects Investigation
National Highway Traffic Safety Administration
400 Seventh Street, S.W.
Washington, D.C. 20590

5433 KATELA AVENUE
CYPRUS, CALIFORNIA 94003-6206
(714) 379-6000
TELEFAX (714) 378-1000
mitsubishi.com

MAILING ADDRESS:
P.O. BOX 6400
CYPRUS, CALIFORNIA 94003-6204

Re: Defect Information Report Supplement and Amendment

04V-279

Ms. DeMeter:

Mitsubishi Motor North America, Inc. (MMNA) hereby supplements and amends our Part 573.5 Defect Information Report, provided on June 4, 2004, which contained details of a potential defect in certain 2004 model year Endeavor vehicles manufactured by Mitsubishi Motors North America, Inc. - Manufacturing division. The defect involves a potential crack on the seat riser bracket that attaches to the bottom of the drivers side seat. A crack in the bracket may allow the seat to become detached from the floorboard in the event of a vehicle collision.

The vehicle counts in the first Part 573.5 report included 143 vehicles that have been exported to Mexico and Canada. The distributors in those locations will conduct a recall for those vehicles, therefore, the number of vehicles in the US and Puerto Rico should be reduced by that number. The new count for the US and Puerto Rico is 1,211 vehicles.

This report covers vehicles distributed by Mitsubishi Motor North America, Inc. and Mitsubishi Motor Sales of the Caribbean (MMSC).

1. The manufacturer's name:

Mitsubishi Motor Manufacturing of America, Inc.

2. Identification of the vehicles and defect item:

Make	Line	Model Year	Date of Manufacture
Mitsubishi	Endeavor	2004	2004-3-11 through 2004-4-15 (VIN 4E111524-4E123728)

3. Total number of vehicles:

1,211 Mitsubishi 2004 Endeavor Vehicles
(1151 In the USA)
(60 In Puerto Rico)

4. Percentage of vehicles estimated to contain the potential defect:

It is impossible to estimate the actual number of vehicles that contain the defect, however, owners of all potentially affected vehicles will be notified, and those vehicles will be included in this campaign.



5. Description of the defect including summary:

The driver side rear foot bracket may develop a crack after use in the field. A crack in the seat bracket may result in the reduction in strength of the seat anchorages, which could result in separation of the seat from the floorboard in the event of a collision.

6. Chronological summary of events leading to this determination:

During the assembly process a small crack was found in one of the seat foot brackets at the manufacturing plant. Investigation revealed that the vendor had used metal different from that specified by the drawing. The metal was harder than was appropriate for that application, resulting in a stress riser that may lead to cracking of the bracket over time. As a result it was decided to conduct a recall to replace the seat riser on those vehicles involved.

7. Test results for a noncompliance:

Not applicable.

8. Description of the proposed remedy:

Owners of all affected vehicles will be notified and encouraged to bring their vehicles in for inspection of the seat bracket. Those vehicles, which have suspect brackets, will receive a new seat riser assembly, which contains new brackets.

The estimated launch date for the owner notification is planned to be on or about July 19, 2004, when a appropriate supply of parts becomes available. The Mitsubishi Recall number for this campaign will be SR-04-006.

10. Notices, bulletins and communication:

The draft of the customer notification letter and the Recall Bulletin are attached for your review and approval.

If you have any questions, please feel free to contact me at one of the contact points listed below.

Sincerely,



Kent Reeves,
Manager, Technical Compliance
and Quality Engineering
Phone 714-372-6362
Fax 714-934-4858
Email kreeves@mmsa.com



SUBJECT:		No: 8R-04-006	
DRIVER'S SEAT RISER — SAFETY RECALL CAMPAIGN		DATE: July, 2004	
		MODEL: 2004 Endeavor	
CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input type="checkbox"/> PARTS MANAGER	<input type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> CLAIMS MANAGER	<input checked="" type="checkbox"/> SALES MANAGER

DRAFT

PURPOSE

The foot of the driver's seat riser may develop a crack, resulting in reduced strength of the seat anchorage. Dealers must inspect the driver's seat riser bar code number to determine whether it is included in this campaign. Check for the bar code on the list included in Attachment A of this bulletin. For vehicles within the affected production date range, if the bar code is on the list, or if there is no bar code, replace the driver's seat riser with the new, improved part listed in the PARTS INFORMATION section of this bulletin.

AFFECTED VEHICLES

2004 Endeavor vehicles produced between 3/11/04 and 4/18/04

IMPORTANT

Affected new or used inventory vehicles must be inspected/repaired before the vehicle is sold. Dealers must check their inventory vehicles' VINs on the Warranty Super Screen to verify whether the vehicle is an affected VIN for this recall campaign.


CUSTOMER NOTIFICATION

A letter will be sent to all owners of affected vehicles asking them to bring their vehicle to their Mitsubishi dealer to have the driver's seat inspected for possible driver's seat riser replacement. A copy of the customer notification letter is included in this bulletin.

REQUIRED OPERATIONS

Before starting this campaign procedure, **CHECK ON THE WARRANTY SUPER SCREEN** to verify that the vehicle is an affected VIN for this campaign and that this campaign procedure has not already been completed.

- Under the driver's seat, note the bar code number. On power seat models, the bar code is located on the front of the motor housing. On manual seat models, the bar code is located on the inside of the anchor bracket. Check for the bar code number on the list in Attachment A (two pages).

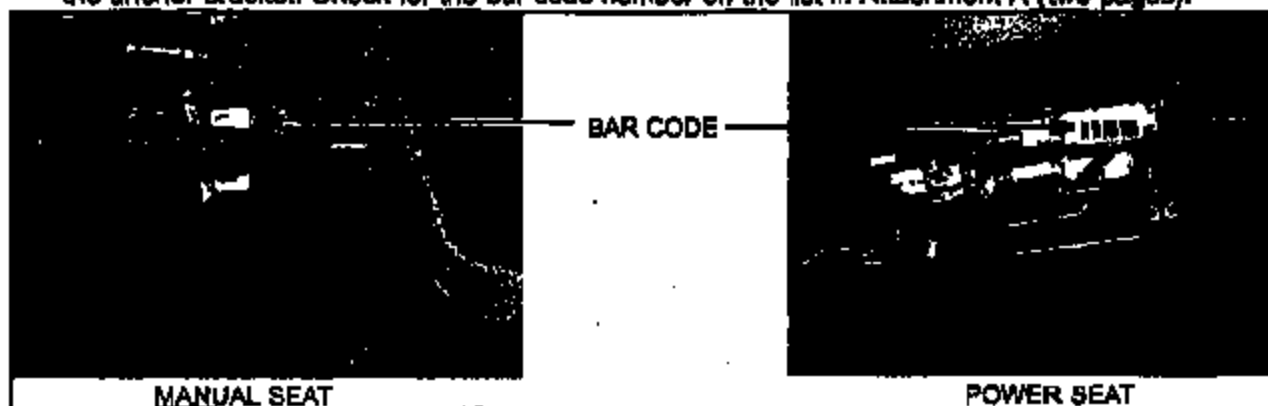


FILE UNDER:	Safety Recall Bulletin in the Dealer Service Information Binder	(2743)
-------------	---	--------

- a. If the bar code number does NOT appear on the list in Attachment A, STOP. This campaign procedure is complete.
- b. If the bar code number is on the list in Attachment A, or if there is no bar code label on the bracket, continue with Step 2 for driver's seat riser replacement procedures. Note the bar code number on the repair order. It must be entered on the related recall claim. If the bar code label is missing, enter "no bar code number" on the repair order and on the recall claim.

⚠ CAUTION

ON MANUAL SEATS, BOTH TRACKS MUST REMAIN LOCKED WHEN REMOVING THE SEAT FROM THE VEHICLE. DO NOT UNLOCK THE TRACKS DURING THIS PROCEDURE. IF THE TRACKS ARE ACCIDENTALLY UNLOCKED, MOVE THE TRACKS TO THE EXTREME FORWARD OR REARWARD POSITION, AND BE SURE BOTH TRACKS LOCK.


2. Remove the driver's seat from the vehicle. Refer to Group 52A in the service manual.

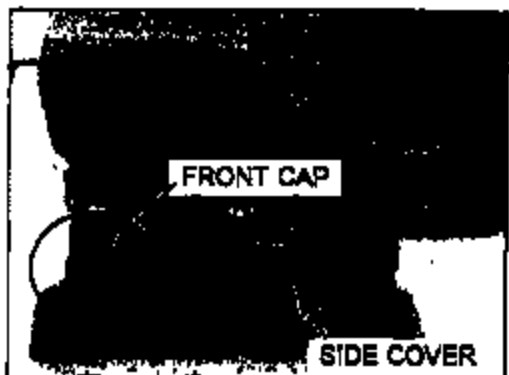

3. Remove the front cap from the seat.
4. Remove the side cover from the seat as follows:
 - a. Pull forward and down on the front portion of the side cover.



- b. Remove the two white side clips securing the side cover to the anchor bracket. Then remove the side cover by pushing it rearward.

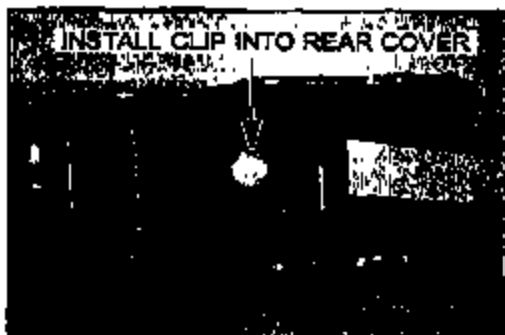

5. Remove the rear cover from the seat as follows:
 - a. Push the cover down and pull it from the seat.
 - b. Remove the white clip from the adjuster.
 - c. Reinstall the white clip into the rear cover.

6. Remove the wiring connector clips from the harness bracket. Note the location of each clip for ease of reassembly. On power seat models, use care to avoid bending the drive cable.
7. Remove the eight nuts securing the riser to the adjuster.



8. Replace the riser with the new, improved riser listed in the PARTS INFORMATION section of this bulletin.
 - a. Secure the new riser to the seat adjuster, using the new nuts provided in the repair kit.
Torque Specification: 7 Nm (5.2 ft/lbs)



9. Reinstall the wiring connector clips. On power seat models, be sure the harness is routed and re-connected in its original position.
10. Reinstall the seat rear cover, side cover, and front cap.
11. Reinstall the seat into the vehicle.

12. Verify proper seat operation by moving the seat forward and rearward several times.
 - a. On power seat models, be sure the seat moves smoothly in both directions without any unusual noise.
 - b. On manual seat models, be sure the inboard and outboard tracks lock simultaneously. If the tracks do not lock simultaneously, loosen the nuts, lock both tracks in the extreme forward or rearward position, then retighten the nuts to 7 Nm (5.2 ft/lbs).

PARTS INFORMATION

Use the Genuine Mitsubishi Parts listed below.

Description	Part Number
Driver's Seat Riser Repair Kit Includes riser, 8 nuts	FBPSU004

WARRANTY INFORMATION

Use campaign labor operation C0405MXX

Labor time for inspection only = 0.3 hrs.

Labor time for inspect and install repair kit = 0.6 hrs.

Claims for this campaign must be entered as Recall type "C" claims. Sample claim screens are shown on the following pages.

WEB BASED CLAIM SYSTEM - RECALL CLAIM SCREENS

Header Section

Enter in the first 6 characters of the campaign labor operation

Campaign Information

Campaign Operation No: C0405M

ONLY 2004 ENDEAVORS BUILT BETWEEN 3/11/04 AND 4/15/04.

Repair Order No: C1234

VIN: 4A.....

Repair Date In: [] Repair Date Out: []

Service Technician: [] Emp No: [] Service Advisor: [] Emp No: []

Spec Value: [] Duplicate Recall:

Dealer: 99328 [] Est No: []

Claim No: []

IF YOU ARE REPLACING THE SEAT RISER YOU MUST ENTER THE BAR CODE NUMBER FROM THE SEAT THAT IS BEING REPLACED...OR THE WORDS... "NO BAR CODE NUMBER" ON SEAT.

Parts Section

Recall Claim

Add Page - Parts Information

Delete	Part No	Part Description	Qty	Unit Price	Part Amount	Part Category
	FBPSU004		Qty = 1			


Kit Part Number = FBPSU004

Enter the applicable kit part ONLY if it was necessary to replace the seat riser. The bar code on the seat must be on attached list unless there was no bar code on the seat at all. Otherwise, only claim the labor to inspect the seat per the instructions.

No other part numbers may be claimed.

Or leave blank if no part was replaced

The dealer net price will be filled in automatically

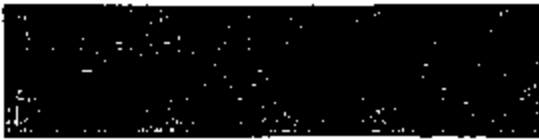

Date: July, 2004

RE: IMPORTANT SAFETY RECALL NOTIFICATION: SR-04-006

Dear Mitsubishi Owner,

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Reason For Notice: Mitsubishi Motors North America, Inc. has determined that the driver's seat mounting bracket may develop a crack at the base of the seat. If the crack grows, it mounts to the seat. A crack in that bracket may result in reduced strength of the seat and, in the event of a collision, the seat could become detached, increasing the risk of occupant injury.

What you should do: Please contact your Authorized Mitsubishi Dealer to schedule a repair date. When you bring your vehicle in, and the dealer informs you of this issue, they will still make the repair, free of charge.)

What your dealer will do: The dealer will work on your driver's seat bracket to determine whether it requires replacement. If so, the dealer will replace it with a new, improved part, free of charge.

How long will it take? The time needed for the actual repair is approximately 30 minutes. The dealer may need your vehicle for a longer period of time due to service scheduling issues, but every effort will be made to minimize your inconvenience.

If you have any trouble getting your vehicle repaired promptly and at no charge, please inform us by calling:
Mitsubishi Customer Relations Department 888-MITSU-8884 (888-648-7887)
Hours: Monday - Saturday 7 a.m. to 10 p.m. (Central Standard Time)

If after contacting Mitsubishi Customer Relations, you still have a problem having this repair made promptly and without charge, write to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street SW, Washington, D.C. 20590, or call the Auto Safety Hotline toll-free (888) 327-4236.

If you have already encountered a problem regarding the above and have paid for the repair, you may send your original receipts and/or other adequate proof of payment to the following address for reimbursement:
Mitsubishi Customer Relations Department, P.O. Box 6400, Cypress, CA 90630-0664

Notice to Lessors: If you are a lessor of five or more leased vehicles as of the date of this letter, you have an obligation under Federal law, (49 CFR Part 577), to provide the lessee of the above referenced vehicle with a copy of this letter by first class mail within ten days of receipt. Further, you must maintain a record, which identifies the lessee to whom you sent a copy of this letter, the date you sent it, and the vehicle identification number (VIN) of the subject vehicle.

We appreciate your prompt attention to this matter. If you have any questions, please contact your Mitsubishi Dealer.

Sincerely,

Chuck Halper
Director of Service

ATTACHMENT A FRONT SEAT ANCHOR BRACKET BAR CODES

80Q038020UP	80Q038052UP	80Q038084UP	80Q038096UP	80Q038128UP	80Q038154UP
80Q038061UP	80Q03A001UP	80Q038092UP	80Q03H08AUP	80Q038237UP	80Q038255UP
80Q038082UP	80Q03A002UP	80Q038104UP	80Q03H098UP	80Q038244UP	80Q038266UP
80Q038083UP	80Q03A003UP	80Q038116UP	80Q03H09CUP	80Q038251UP	80Q038287UP
80Q038084UP	80Q03A004UP	80Q038128UP	80Q03H09DUP	80Q038258UP	80Q038309UP
80Q038085UP	80Q03A005UP	80Q038140UP	80Q03H09EUP	80Q038265UP	80Q038331UP
80Q038086UP	80Q03A006UP	80Q038152UP	80Q03H09FUP	80Q038272UP	80Q038353UP
80Q038087UP	80Q03A007UP	80Q038164UP	80Q03H09GUP	80Q038279UP	80Q038375UP
80Q038088UP	80Q03A008UP	80Q038176UP	80Q03H09HUP	80Q038286UP	80Q038397UP
80Q038089UP	80Q03A009UP	80Q038188UP	80Q03H09IUP	80Q038293UP	80Q038419UP
80Q038090UP	80Q03A010UP	80Q038200UP	80Q03H09JUP	80Q038300UP	80Q038441UP
80Q038091UP	80Q03A011UP	80Q038212UP	80Q03H09KUP	80Q038307UP	80Q038463UP
80Q038092UP	80Q03A012UP	80Q038224UP	80Q03H09LUP	80Q038314UP	80Q038485UP
80Q038093UP	80Q03A013UP	80Q038236UP	80Q03H09MUP	80Q038321UP	80Q038507UP
80Q038094UP	80Q03A014UP	80Q038248UP	80Q03H09NUP	80Q038328UP	80Q038529UP
80Q038095UP	80Q03A015UP	80Q038260UP	80Q03H09OUP	80Q038335UP	80Q038551UP
80Q038096UP	80Q03A016UP	80Q038272UP	80Q03H09PUP	80Q038342UP	80Q038573UP
80Q038097UP	80Q03A017UP	80Q038284UP	80Q03H09QUP	80Q038349UP	80Q038595UP
80Q038098UP	80Q03A018UP	80Q038296UP	80Q03H09RUP	80Q038356UP	80Q038617UP
80Q038099UP	80Q03A019UP	80Q038308UP	80Q03H09SUP	80Q038363UP	80Q038639UP
80Q038100UP	80Q03A020UP	80Q038320UP	80Q03H09TUP	80Q038370UP	80Q038661UP
80Q038101UP	80Q03A021UP	80Q038332UP	80Q03H09UP	80Q038377UP	80Q038683UP
80Q038102UP	80Q03A022UP	80Q038344UP	80Q03H09VUP	80Q038384UP	80Q038705UP
80Q038103UP	80Q03A023UP	80Q038356UP	80Q03H09WUP	80Q038391UP	80Q038727UP
80Q038104UP	80Q03A024UP	80Q038368UP	80Q03H09XUP	80Q038398UP	80Q038749UP
80Q038105UP	80Q03A025UP	80Q038380UP	80Q03H09YUP	80Q038405UP	80Q038771UP
80Q038106UP	80Q03A026UP	80Q038392UP	80Q03H09ZUP	80Q038412UP	80Q038793UP
80Q038107UP	80Q03A027UP	80Q038404UP	80Q03H09AUP	80Q038419UP	80Q038815UP
80Q038108UP	80Q03A028UP	80Q038416UP	80Q03H09BUP	80Q038426UP	80Q038837UP
80Q038109UP	80Q03A029UP	80Q038428UP	80Q03H09CUP	80Q038433UP	80Q038859UP
80Q038110UP	80Q03A030UP	80Q038440UP	80Q03H09DUP	80Q038440UP	80Q038881UP
80Q038111UP	80Q03A031UP	80Q038452UP	80Q03H09EUP	80Q038447UP	80Q038903UP
80Q038112UP	80Q03A032UP	80Q038464UP	80Q03H09FUP	80Q038454UP	80Q038925UP
80Q038113UP	80Q03A033UP	80Q038476UP	80Q03H09GUP	80Q038461UP	80Q038947UP
80Q038114UP	80Q03A034UP	80Q038488UP	80Q03H09HUP	80Q038468UP	80Q038969UP
80Q038115UP	80Q03A035UP	80Q038500UP	80Q03H09IUP	80Q038475UP	80Q038991UP
80Q038116UP	80Q03A036UP	80Q038512UP	80Q03H09JUP	80Q038482UP	80Q039013UP
80Q038117UP	80Q03A037UP	80Q038524UP	80Q03H09KUP	80Q038489UP	80Q039035UP
80Q038118UP	80Q03A038UP	80Q038536UP	80Q03H09LUP	80Q038496UP	80Q039057UP
80Q038119UP	80Q03A039UP	80Q038548UP	80Q03H09MUP	80Q038503UP	80Q039079UP
80Q038120UP	80Q03A040UP	80Q038560UP	80Q03H09NUP	80Q038510UP	80Q039101UP
80Q038121UP	80Q03A041UP	80Q038572UP	80Q03H09OUP	80Q038517UP	80Q039123UP
80Q038122UP	80Q03A042UP	80Q038584UP	80Q03H09PUP	80Q038524UP	80Q039145UP
80Q038123UP	80Q03A043UP	80Q038596UP	80Q03H09QUP	80Q038531UP	80Q039167UP
80Q038124UP	80Q03A044UP	80Q038608UP	80Q03H09RUP	80Q038538UP	80Q039189UP
80Q038125UP	80Q03A045UP	80Q038620UP	80Q03H09SUP	80Q038545UP	80Q039211UP
80Q038126UP	80Q03A046UP	80Q038632UP	80Q03H09TUP	80Q038552UP	80Q039233UP
80Q038127UP	80Q03A047UP	80Q038644UP	80Q03H09UP	80Q038559UP	80Q039255UP
80Q038128UP	80Q03A048UP	80Q038656UP	80Q03H09VUP	80Q038566UP	80Q039277UP
80Q038129UP	80Q03A049UP	80Q038668UP	80Q03H09WUP	80Q038573UP	80Q039299UP
80Q038130UP	80Q03A050UP	80Q038680UP	80Q03H09XUP	80Q038580UP	80Q039321UP
80Q038131UP	80Q03A051UP	80Q038692UP	80Q03H09YUP	80Q038587UP	80Q039343UP
80Q038132UP	80Q03A052UP	80Q038704UP	80Q03H09ZUP	80Q038594UP	80Q039365UP
80Q038133UP	80Q03A053UP	80Q038716UP	80Q03H09AUP	80Q038601UP	80Q039387UP
80Q038134UP	80Q03A054UP	80Q038728UP	80Q03H09BUP	80Q038608UP	80Q039409UP
80Q038135UP	80Q03A055UP	80Q038740UP	80Q03H09CUP	80Q038615UP	80Q039431UP
80Q038136UP	80Q03A056UP	80Q038752UP	80Q03H09DUP	80Q038622UP	80Q039453UP
80Q038137UP	80Q03A057UP	80Q038764UP	80Q03H09EUP	80Q038629UP	80Q039475UP
80Q038138UP	80Q03A058UP	80Q038776UP	80Q03H09FUP	80Q038636UP	80Q039497UP
80Q038139UP	80Q03A059UP	80Q038788UP	80Q03H09GUP	80Q038643UP	80Q039519UP
80Q038140UP	80Q03A060UP	80Q038800UP	80Q03H09HUP	80Q038650UP	80Q039541UP
80Q038141UP	80Q03A061UP	80Q038812UP	80Q03H09IUP	80Q038657UP	80Q039563UP
80Q038142UP	80Q03A062UP	80Q038824UP	80Q03H09JUP	80Q038664UP	80Q039585UP
80Q038143UP	80Q03A063UP	80Q038836UP	80Q03H09KUP	80Q038671UP	80Q039607UP
80Q038144UP	80Q03A064UP	80Q038848UP	80Q03H09LUP	80Q038678UP	80Q039629UP
80Q038145UP	80Q03A065UP	80Q038860UP	80Q03H09MUP	80Q038685UP	80Q039651UP
80Q038146UP	80Q03A066UP	80Q038872UP	80Q03H09NUP	80Q038692UP	80Q039673UP
80Q038147UP	80Q03A067UP	80Q038884UP	80Q03H09OUP	80Q038699UP	80Q039695UP
80Q038148UP	80Q03A068UP	80Q038896UP	80Q03H09PUP	80Q038706UP	80Q039717UP
80Q038149UP	80Q03A069UP	80Q038908UP	80Q03H09QUP	80Q038713UP	80Q039739UP
80Q038150UP	80Q03A070UP	80Q038920UP	80Q03H09RUP	80Q038720UP	80Q039761UP
80Q038151UP	80Q03A071UP	80Q038932UP	80Q03H09SUP	80Q038727UP	80Q039783UP
80Q038152UP	80Q03A072UP	80Q038944UP	80Q03H09TUP	80Q038734UP	80Q039805UP
80Q038153UP	80Q03A073UP	80Q038956UP	80Q03H09UP	80Q038741UP	80Q039827UP
80Q038154UP	80Q03A074UP	80Q038968UP	80Q03H09VUP	80Q038748UP	80Q039849UP
80Q038155UP	80Q03A075UP	80Q038980UP	80Q03H09WUP	80Q038755UP	80Q039871UP
80Q038156UP	80Q03A076UP	80Q038992UP	80Q03H09XUP	80Q038762UP	80Q039893UP
80Q038157UP	80Q03A077UP	80Q038904UP	80Q03H09YUP	80Q038769UP	80Q039915UP
80Q038158UP	80Q03A078UP	80Q038916UP	80Q03H09ZUP	80Q038776UP	80Q039937UP
80Q038159UP	80Q03A079UP	80Q038928UP	80Q03H09AUP	80Q038783UP	80Q039959UP
80Q038160UP	80Q03A080UP	80Q038940UP	80Q03H09BUP	80Q038790UP	80Q039981UP
80Q038161UP	80Q03A081UP	80Q038952UP	80Q03H09CUP	80Q038797UP	80Q040003UP
80Q038162UP	80Q03A082UP	80Q038964UP	80Q03H09DUP	80Q038804UP	80Q040025UP
80Q038163UP	80Q03A083UP	80Q038976UP	80Q03H09EUP	80Q038811UP	80Q040047UP
80Q038164UP	80Q03A084UP	80Q038988UP	80Q03H09FUP	80Q038818UP	80Q040069UP
80Q038165UP	80Q03A085UP	80Q038900UP	80Q03H09GUP	80Q038825UP	80Q040091UP
80Q038166UP	80Q03A086UP	80Q038912UP	80Q03H09HUP	80Q038832UP	80Q040113UP
80Q038167UP	80Q03A087UP	80Q038924UP	80Q03H09IUP	80Q038839UP	80Q040135UP
80Q038168UP	80Q03A088UP	80Q038936UP	80Q03H09JUP	80Q038846UP	80Q040157UP
80Q038169UP	80Q03A089UP	80Q038948UP	80Q03H09KUP	80Q038853UP	80Q040179UP
80Q038170UP	80Q03A090UP	80Q038960UP	80Q03H09LUP	80Q038860UP	80Q040201UP
80Q038171UP	80Q03A091UP	80Q038972UP	80Q03H09MUP	80Q038867UP	80Q040223UP
80Q038172UP	80Q03A092UP	80Q038984UP	80Q03H09NUP	80Q038874UP	80Q040245UP
80Q038173UP	80Q03A093UP	80Q038996UP	80Q03H09OUP	80Q038881UP	80Q040267UP
80Q038174UP	80Q03A094UP	80Q039008UP	80Q03H09PUP	80Q038888UP	80Q040289UP
80Q038175UP	80Q03A095UP	80Q039020UP	80Q03H09QUP	80Q038895UP	80Q040311UP
80Q038176UP	80Q03A096UP	80Q039032UP	80Q03H09RUP	80Q038902UP	80Q040333UP
80Q038177UP	80Q03A097UP	80Q039044UP	80Q03H09SUP	80Q038909UP	80Q040355UP
80Q038178UP	80Q03A098UP	80Q039056UP	80Q03H09TUP	80Q038916UP	80Q040377UP
80Q038179UP	80Q03A099UP	80Q039068UP	80Q03H09UP	80Q038923UP	80Q040399UP
80Q038180UP	80Q03A100UP	80Q039080UP	80Q03H09VUP	80Q038930UP	80Q040421UP
80Q038181UP	80Q03A101UP	80Q039092UP	80Q03H09WUP	80Q038937UP	80Q040443UP
80Q038182UP	80Q03A102UP	80Q039104UP	80Q03H09XUP	80Q038944UP	80Q040465UP
80Q038183UP	80Q03A103UP	80Q039116UP	80Q03H09YUP	80Q038951UP	80Q040487UP
80Q038184UP	80Q03A104UP	80Q039128UP	80Q03H09ZUP	80Q038958UP	80Q040509UP
80Q038185UP	80Q03A105UP	80Q039140UP	80Q03H09AUP	80Q038965UP	80Q040531UP
80Q038186UP	80Q03A106UP	80Q039152UP	80Q03H09BUP	80Q038972UP	80Q040553UP
80Q038187UP	80Q03A107UP	80Q039164UP	80Q03H09CUP	80Q038979UP	80Q040575UP
80Q038188UP	80Q03A108UP	80Q039176UP	80Q03H09DUP	80Q038986UP	80Q040597UP
80Q038189UP	80Q03A109UP	80Q039188UP	80Q03H09EUP	80Q038993UP	80Q040619UP
80Q038190UP	80Q03A110UP	80Q039200UP	80Q03H09FUP	80Q038900UP	80Q040641UP
80Q038191UP	80Q03A111UP	80Q039212UP	80Q03H09GUP	80Q038907UP	80Q040663UP
80Q038192UP	80Q03A112UP	80Q039224UP	80Q03H09HUP	80Q038914UP	80Q040685UP
80Q038193UP	80Q03A113UP	80Q039236UP	80Q03H09IUP	80Q038921UP	80Q040707UP
80Q038194UP	80Q03A114UP	80Q039248UP	80Q03H09JUP	80Q038928UP	80Q040729UP
80Q038195UP	80Q03A115UP	80Q039260UP	80Q03H09KUP	80Q038935UP	80Q040751UP
80Q038196UP	80Q03A116UP	80Q039272UP	80Q03H09LUP	80Q038942UP	80Q040773UP
80Q038197UP	80Q03A117UP	80Q039284UP	80Q03H09MUP	80Q038949UP	80Q040795UP
80Q038198UP	80Q03A118UP	80Q039296UP	80Q03H09NUP	80Q038956UP	80Q040817UP
80Q038199UP	80Q03A119UP	80Q039308UP	80Q03H09OUP	80Q038963UP	80Q040839UP
80Q038200UP	80Q03A120UP	80Q039320UP	80Q03H09PUP	80Q038970UP	80Q040861UP
80Q038201UP	80Q03A121UP	80Q039332UP	80Q03H09QUP	80Q038977UP	80Q040883UP
80Q038202UP	80Q03A122UP	80Q039344UP	80Q03H09RUP	80Q038984UP	80Q040905UP
80Q038203UP	80Q03A123UP	80Q039356UP	80Q03H09SUP	80Q038991UP	80Q040927UP
80Q038204UP	80Q03A124UP	80Q039368UP	80Q03H09TUP	80Q038998UP	80Q040949UP
80Q038205UP	80Q03A125UP	80Q039380UP	80Q03H09UP	80Q039005UP	80Q040971UP
80Q038206UP	80Q03A126UP	80Q039392UP	80Q03H09VUP	80Q039012UP	80Q040993UP
80Q038207UP	80Q03A127UP	80Q039404UP	80Q03H09WUP	80Q039019UP	80Q041015UP
80Q038208UP	80Q03A128UP	80Q039416UP	80Q03H09XUP	80Q039026UP	80Q041037UP
80Q038209UP	80Q03A129UP	80Q039428UP	80Q03H09YUP	80Q039033UP	80Q041059UP
80Q038210UP	80Q03A130UP	80Q			

ATTACHMENT A, continued
FRONT SEAT ANCHOR BRACKET BAR CODES

80Q03R015UP	80Q03X0091UP	80Q041028UP	80Q048018UP	80Q04800FUP
80Q03R018UP	80Q03X0092UP	80Q041030UP	80Q042019UP	80Q048010UP
80Q03R017UP	80Q03X0093UP	80Q041029AUP	80Q04201AUP	80Q048011UP
80Q03R018UP	80Q03X0094UP	80Q041029BUP	80Q04201BUP	80Q048012UP
80Q03V065UP	80Q03X0095UP	80Q041030CUP	80Q04201CUP	80Q048013UP
80Q03V066UP	80Q03X0096UP	80Q041030DUP	80Q04201DUP	80Q048014UP
80Q03V067UP	80Q03X0097UP	80Q041030EUP	80Q04201EUP	80Q048015UP
80Q03V068UP	80Q03X0098UP	80Q041030FUP	80Q04201FUP	80Q048016UP
80Q03V069UP	80Q03X0099UP	80Q041030GUP	80Q042020UP	80Q048017UP
80Q03V069AUP	80Q03X0099AUP	80Q041031LUP	80Q042021UP	80Q048018UP
80Q03V069BUP	80Q03X0099BUP	80Q041032LUP	80Q042022UP	80Q048019UP
80Q03V069CUP	80Q041001UP	80Q041033UP	80Q042023UP	80Q04801AUP
80Q03V069DUP	80Q041002UP	80Q041034UP	80Q042024UP	80Q04801BUP
80Q03V069EUP	80Q041003UP	80Q041035UP	80Q042025UP	80Q04801CUP
80Q03V069FUP	80Q041004UP	80Q041036UP	80Q042026UP	80Q04801DUP
80Q03W031UP	80Q041005UP	80Q041037UP	80Q042027UP	80Q04801EUP
80Q03W032UP	80Q041006UP	80Q041038UP	80Q042028UP	80Q04801FUP
80Q03W033UP	80Q041007UP	80Q041039UP	80Q042029UP	80Q048020UP
80Q03W034UP	80Q041008UP	80Q04103AUP	80Q04202AUP	80Q048021UP
80Q03W036UP	80Q041009UP	80Q04103BUP	80Q04202BUP	80Q048022UP
80Q03W036UP	80Q04100AUP	80Q04103CUP	80Q04202CUP	80Q048023UP
80Q03W037UP	80Q04100BUP	80Q04103DUP	80Q04202DUP	80Q048024UP
80Q03W038UP	80Q04100CUP	80Q04103EUP	80Q04202EUP	80Q048025UP
80Q03W039UP	80Q04100DUP	80Q04103FUP	80Q04202FUP	80Q048026UP
80Q03W039AUP	80Q04100EUP	80Q041040UP	80Q042030UP	80Q048027UP
80Q03W039BUP	80Q04100FUP	80Q041041UP	80Q042031UP	80Q048028UP
80Q03W039CUP	80Q041010UP	80Q041042UP	80Q042032UP	80Q048029UP
80Q03W039DUP	80Q041011UP	80Q042001UP	80Q042033UP	80Q04802AUP
80Q03W039EUP	80Q041012UP	80Q042002UP	80Q042034UP	80Q04802BUP
80Q03W039FUP	80Q041013UP	80Q042003UP	80Q042035UP	80Q04802CUP
80Q03W040UP	80Q041014UP	80Q042004UP	80Q042036UP	80Q04802DUP
80Q03X008EUP	80Q041015UP	80Q042005UP	80Q042037UP	80Q04802EUP
80Q03X008FUP	80Q041016UP	80Q042006UP	80Q042038UP	80Q04802FUP
80Q03X070UP	80Q041017UP	80Q042007UP	80Q042039UP	80Q048030UP
80Q03X071UP	80Q041018UP	80Q042008UP	80Q04203AUP	80Q048031UP
80Q03X072UP	80Q041019UP	80Q042009UP	80Q04203BUP	80Q048032UP
80Q03X073UP	80Q04101AUP	80Q04200AUP	80Q04203CUP	80Q048033UP
80Q03X074UP	80Q04101BUP	80Q04200BUP	80Q04203DUP	80Q048034UP
80Q03X075UP	80Q04101CUP	80Q04200CUP	80Q04203EUP	80Q048035UP
80Q03X076UP	80Q04101DUP	80Q04200DUP	80Q04203FUP	80Q048036UP
80Q03X077UP	80Q04101EUP	80Q04200EUP	80Q04203GUP	80Q048037UP
80Q03X078UP	80Q04101FUP	80Q04200FUP	80Q04203HUP	80Q048038UP
80Q03X079UP	80Q041020UP	80Q042010UP	80Q04203IUP	80Q048039UP
80Q03X07AUP	80Q041021UP	80Q042011UP	80Q04203JUP	80Q04803AUP
80Q03X07BUP	80Q041022UP	80Q042012UP	80Q04203KUP	80Q04803BUP
80Q03X07CUP	80Q041023UP	80Q042013UP	80Q04203LUP	80Q04803CUP
80Q03X07DUP	80Q041024UP	80Q042014UP	80Q04203MUP	80Q04803DUP
80Q03X07EUP	80Q041025UP	80Q042015UP	80Q04203NUP	80Q04803EUP
80Q03X07FUP	80Q041026UP	80Q042016UP	80Q04203OUP	
80Q03X080UP	80Q041027UP	80Q042017UP	80Q04203PUP	