

S-TYPE

DATE 12/04 Amended 01/05

7-26USA

SERVICE

ADMINISTRATION BULLETIN

Unintended Rear Wheel Braking – No Park Brake Warning Lights Displayed – RECALL R166 MODEL 2003 MY S-TYPE VIN M44998-M725**8**4

Remove and destroy Bulletin 7-26 dated 12/04.

Replace with this Bulletin.

Revisions are marked with a bar and in **bold text**.

Issue:

A concern has been identified on a number of 2003 MY S-TYPE whicles within the above VIN range. It is possible that the electronic parking brake can be unit entionally applied resulting in the vehicle decelerating or, in extreme cases, the recowheels locking up, which may result in a vehicle crash. This condition can occur at any speed without warning lights displayed on the instrument cluster.

Jaguar Cars has made the decision to recall all effect sphicles within the above VIN range for the electronic parking brake module to be enewed.

Recall Action R167 - Unintended rear wheel braking with warning lights, is being released at the same time as Recal Action R166. All of the vehicles in this Recall Action require both R166 and R167. You must ensure that all repairs are completed at one visit. Refer to S206-R167 for repair information.

A copy of the custome etter is attached.

Action:

At the time of confirming a booking for vehicle repair, ensure that all outstanding Field Service Actions are likely and to ensure the correct parts are available and adequate workshop time callocated for repairs to be completed at one visit.

To replace the Electronic Parking Brake module, refer to Workshop Manual Section 206-05, SRO 70.35.47.

Note: Use WDS to configure the new EPB module after installation.

Warning: After replacing the EPB module, destroy the old module by striking it with a hammer to prevent its unintentional reuse.



Warranty Information:

Warranty claims should be submitted quoting program code R166 together with option code B as listed in the table below.

No allowance has been made for drive in/drive out, as this repair must be completed at the same time as Recall Action R167.

Recall Action R166 Year Model VIN range

2003 MY S-TYPE 3.0 L

3F M44998 - 3F M72584

2003 MY S-TYPE 4.2 L

3H M44998 - 3H M72584

2003 MY S-TYPE R 4.2 L S/C

31 M44998 - 31 M72584

Please visit the Service Support Web site at https://web.jagtech.dealerconnection.com to access VIN list spreadsheets which identify the number of vehicles sold by your dealership that are affected by recall R166. These spreadsheets are accessible by clicking the document link in the VIN column based on your dealer code. These spreadsheets can be manipulated to suit you own needs.

Program Code	Option	Description	SRO	Time	Part Number	Part Description	Qty
R166	В	Replace electronic parking brake module	70.35.47	0.6 hrs.	C2C 25392 K	Electronic parking brake module	1

Note: Always review a Vehicle's Claim History within DDW first to determine whether this recall has been previously performed on a specific vehicle. The "Review Claim History" function will display a list of claims against the vehicle. If this recall appears in the program code field, do not perform this recall.





December 2004

JAGUAR CARS
555 MacARTHUR BOULEVARD

MAHWAH NJ 07430

T 800 4 JAGUAR

www.jaguar.com

December 2004

RE:

R-166/167 Recall - Electronic Park Brake

R-171 Recall - Brake Fluid Reservoir Warning Label

Vehicles Affected: 2003-2004 MY S-TYPE

Dear Jaguar Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Jaguar Cars has decided that a defect relating to motor vehicle safety exists on 2003-2004 MY S-TYPE models. If you are a recipient of this notice, and an owner of one of the vehicles within the VIN range listed below, this letter is to inform you that your vehicle is included in this recall.

Vehicles within this Vehicle Identification Number (VIN) range may experience unintentional Electronic Park Brake (EPB) application.

Following is a breakdown of the affected vehicles by recall action and VIN range.

➤ R166 EBP Module 2003 S-TYPE M44998-M72584

➤ R167 Suppressor Module 2003-2004 S-TYPE M44998-N13088

In addition, Jaguar Cars has decided that the brake fluid reservoir warning statement on certain vehicles fails to conform to Federal Motor Vehicle Safety Standard No.135, "Passenger Car Brake Systems." Vehicles produced in the VIN range below are included in this recall.

> R171 Reservoir Label 2003-2004 S-TYPE M44998-N13088

What is the Concern?

Recall - R167/166

Investigations have determined that the electronic park brake module, which controls the application of the parking brake, may unintentionally apply the parking brake without any indication or warning to the driver. In some cases warning lights displayed on the instrument cluster may accompany this.

This condition can cause the vehicle to decelerate and, in extreme conditions, may cause rear wheel "lockup" at any road speed, which could result in a vehicle crash without prior warning.

It is important to schedule an appointment with your dealer to have this repair performed.

Recall - R171

The leaf screen finisher located at the base of the windshield obscures the existing embossed warning on the brake fluid reservoir. Therefore your vehicle is not in compliance with the Federal Motor Vehicle Safety Standard "FMVSS" 135 requirement. Additionally, there is a potential risk of using the incorrect specification brake fluid as a result of the warning statement being obscured. Using the incorrect brake fluid could affect the performance of your vehicles braking system. A listing of all recommended fluids can be found in your owner's handbook.

What will Jaguar and your Dealer do?

R166 or R167

Jaguar Cars will fit a suppressor module and link lead to the electrical wiring harness to all vehicles included in both recall actions, while only some vehicles will receive a replacement Electronic Park Brake Module.

R171

Jaguar Cars will also fit a new brake fluid-warning label to your vehicle.

What should you do?

At your earliest convenience you should contact your authorized Jaguar Dealer who will be able to make an appointment to undertake the necessary actions. These recalls will be performed on a **free of charge** basis. To assist your dealer, please ensure that at the time of contact you have at hand your applicable Vehicle Identification Number.

How long will it take?

The time to complete the repair on your vehicle is approximately 2 hours. However, due to vehicle scheduling, your dealer may need to keep your vehicle longer to complete the repair.

Moved or no longer own a Jaguar?

Please fill out the enclosed card and return it to Jaguar by simply putting it in the mail.

What you should do if you have already paid to have this work completed?

If you meet all the following requirements, you are eligible to receive reimbursement

- 1. You own or have owned a 2003 MY Jaguar S-TYPE within the VIN range listed above.
- You have paid for an Electronic Brake Module due to the defect outlined previously in this letter.
- 3. The repair was performed before December 2004.
- 4. You have an original or legible copy of the paid repair order or invoice showing:
 - A description of the concern reported
 - Itemized parts and labor charges
 - The vehicle model and year and the vehicle identification number
 - The repair date
 - Repair mileage
 - Name and address of the authorized Jaguar Dealer or licensed repair shop
 - Your name and address at the time of the repair

If you have all of the above information, present it to the Dealership Service Manager and they will arrange reimbursement of your claim.

Please ensure that you retain copies of all of the paperwork supporting this claim.

If an authorized Jaguar Dealer fails or is unable to satisfactorily answer your concerns about this notice, without charge within 60 days, pursuant to law 49 U.S.C. Chapter 301, you may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, S.W., Washington, D.C. 20590 or call the toll-free Auto Safety Hotline at 888-327-4236.

Attention Leasing Agencies:

Federal regulation requires that you forward this recall notice to the lessee within 10 days.

What should you do if you have further questions?

Please contact your authorized Jaguar Dealer or the Jaguar Customer Relationship Center at 1 800 4JAGUAR (1-800-452-4827), option 9, by e-mail at jaguar.com, or by mail using the return address listed above.

Sincerely,

Benjamin I. Weiner

Customer Satisfaction Manager



S-TYPE

DATE 12/04

7-27USA

SERVICE

ADMINISTRATION BULLETIN

Unintended Rear Wheel Braking –
Park Brake Warning Lights Displayed –
RECALL R167

MODEL 2003-04 MY S-TYPE VIN M44998-N13088

Issue:

A concern has been identified on a number of 2003-04 MY S-TYPE vehicles within the above VIN range. It is possible that the electronic parking brake can be unintentionally applied resulting in the vehicle decelerating and in extreme cases, the rear wheels locking up, which may result in a vehicle crash. This condition can occur at any speed and may be accompanied by warning lights or messages being displayed.

Jaguar Cars has made the decision to recall all left-hard drive 2003-04 X S-TYPE vehicles within the above VIN range to install a windshield viper motor suppression module and link lead. The workshop procedure is attached.

Note: Additional recall actions listed below honeed to be performed in conjunction with R167.

Recall Action R166 - Unintended read and el brakin, without warning lights, is being released at the same time as Recall Action R167. For those vehicles that require both R166 and R167, You must ensure that all repairs for both actions are completed at one visit. Refer to S206-R166 for repair is formation.

Recall Action R171 - Backe fly a warning label - The plenum chamber finisher obscures the existing embossed warning on the brake fluid reservoir. Therefore, Jaguar Cars is not in compliance with the later. Motor Vehicle Safety Standard (FMVSS) 135 requirement. As a result, a new brake fluid warning label must be applied to the plenum chamber finisher as part of R167. Refer to Warranty section for more information.

No.	VIN range	Action
R166	M44998 - 772584 -	Replace Electronic Parking Brake Module
R167	M44998 - N13088 -	Install wiper motor suppression module and link lead
R171	M44998 - N13088 -	Apply new brake fluid warning label

Refer to Technical Bulletin S206-R167 for the repair procedure. A copy of the customer letter is attached.



Warranty Information:

Warranty claims should be submitted quoting program code R167 together with the relevant option code from the table below. The options that allow for drive in/drive out can only be claimed when the vehicle has been brought into the workshop for this action alone to be undertaken.

Note: There is no dedicated warranty claiming information for the installation of the brake fluid warning label for R171, since this is performed as part of R167.

Recall Action R167

Year	Model	VIN range
2003 MY	S-TYPE 3.0 L	3F M44998 - 3F M94764
2003 MY	S-TYPE 4.2 L	3H M44998 - 3H M94764
2003 MY	S-TYPE R 4.2 L S/C	31 M44998 - 31 M94764
2004 MY	S-TYPE 3.0 L	4F M94765 - 4F N13088
2004 MY	S-TYPE 4.2 L	4H M94765 - 4H N13088
2004 MY	S-TYPE R 4.2 L S/C	41 M94765 - 41 N13088

Please visit the Service Support Web site at https://web.jagtech.dealerconnection.com to access VIN list spreadsheets which identify the number of vehicles sold by your dealership that are affected by recall R167. These spreadsheets are accessible by clicking the document link in the VIN column based on your dealer code. These spreadsheets can be manipulated to suit you own needs.

Program Code	Option	Description	SRO	Time	Part Description	Part Number	Qty
R167	В	Install wiper motor suppression module and link lead; apply label	86.93.43	0.8 hrs.	Wiper motor suppression module Link lead Tie strap Brake fluid warning label	XR8 51749 K XR8 51891 K ADU 9028 XR8 53644	1 1 1
R167	С	Install wiper motor suppression module and link lead; apply label	86.93.43	0.8 hrs.	Wiper motor suppression module Link lead Tie strap Brake fluid warning label	XR8 51749 K XR8 51891 K ADU 9028 XR8 53644	1 1 1
		Drive in/drive out	10.10.10	0.1 hrs.			

Note: Always review a Vehicle's Claim History within DDW first to determine whether this recall has been previously performed on a specific vehicle. The "Review Claim History" function will display a list of claims against the vehicle. If this recall appears in the program code field, do not perform this recall.



December 2004

JAGUAR CARS

555 MacARTHUR BOULEVARD
MAHWAH NJ 07430

T 800 4 JAGUAR

www.jaguar.com

RE:

R-166/167 Recall - Electronic Park Brake

R-171 Recall - Brake Fluid Reservoir Warning Label

Vehicles Affected: 2003-2004 MY S-TYPE

Dear Jaguar Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Jaguar Cars has decided that a defect relating to motor vehicle safety exists on 2003-2004 MY S-TYPE models. If you are a recipient of this notice, and an owner of one of the vehicles within the VIN range listed below, this letter is to inform you that your vehicle is included in this recall.

Vehicles within this Vehicle Identification Number (VIN) range may experience unintentional Electronic Park Brake (EPB) application.

Following is a breakdown of the affected vehicles by recall action and VIN range.

> R166 EBP Module

2003

S-TYPE

M44998-M72584

> R167

Suppressor Module

2003-2004

S-TYPE

M44998-N13088

In addition, Jaguar Cars has decided that the brake fluid reservoir warning statement on certain vehicles fails to conform to Federal Motor Vehicle Safety Standard No.135, "Passenger Car Brake Systems." Vehicles produced in the VIN range below are included in this recall.

➤ R171

Reservoir Label

2003-2004

S-TYPE

M44998-N13088

What is the Concern?

Recall - R167/166

Investigations have determined that the electronic park brake module, which controls the application of the parking brake, may unintentionally apply the parking brake without any indication or warning to the driver. In some cases warning lights displayed on the instrument cluster may accompany this.

This condition can cause the vehicle to decelerate and, in extreme conditions, may cause rear wheel "lockup" at any road speed, which could result in a vehicle crash without prior warning.

It is important to schedule an appointment with your dealer to have this repair performed.

Recall - R171

The leaf screen finisher located at the base of the windshield obscures the existing embossed warning on the brake fluid reservoir. Therefore your vehicle is not in compliance with the Federal Motor Vehicle Safety Standard "FMVSS" 135 requirement. Additionally, there is a potential risk of using the incorrect specification brake fluid as a result of the warning statement being obscured. Using the incorrect brake fluid could affect the performance of your vehicles braking system. A listing of all recommended fluids can be found in your owner's handbook.

What will Jaguar and your Dealer do?

R166 or R167

Jaguar Cars will fit a suppressor module and link lead to the electrical wiring harness to all vehicles included in both recall actions, while only some vehicles will receive a replacement Electronic Park Brake Module.

R171

Jaguar Cars will also fit a new brake fluid-warning label to your vehicle.

What should you do?

At your earliest convenience you should contact your authorized Jaguar Dealer who will be able to make an appointment to undertake the necessary actions. These recalls will be performed on a **free of charge** basis. To assist your dealer, please ensure that at the time of contact you have at hand your applicable Vehicle Identification Number.

How long will it take?

The time to complete the repair on your vehicle is approximately 2 hours. However, due to vehicle scheduling, your dealer may need to keep your vehicle longer to complete the repair.

Moved or no longer own a Jaguar?

Please fill out the enclosed card and return it to Jaguar by simply putting it in the mail.

What you should do if you have already paid to have this work completed?

If you meet all the following requirements, you are eligible to receive reimbursement

- 1. You own or have owned a 2003 MY Jaguar S-TYPE within the VIN range listed above.
- 2. You have paid for an Electronic Brake Module due to the defect outlined previously in this letter
- 3. The repair was performed before December 2004.
- 4. You have an original or legible copy of the paid repair order or invoice showing:
 - A description of the concern reported
 - Itemized parts and labor charges
 - The vehicle model and year and the vehicle identification number
 - The repair date
 - Repair mileage
 - Name and address of the authorized Jaguar Dealer or licensed repair shop
 - Your name and address at the time of the repair

If you have all of the above information, present it to the Dealership Service Manager and they will arrange reimbursement of your claim.

Please ensure that you retain copies of all of the paperwork supporting this claim.

If an authorized Jaguar Dealer fails or is unable to satisfactorily answer your concerns about this notice, without charge within 60 days, pursuant to law 49 U.S.C. Chapter 301, you may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, S.W., Washington, D.C. 20590 or call the toll-free Auto Safety Hotline at 888-327-4236.

Attention Leasing Agencies:

Federal regulation requires that you forward this recall notice to the lessee within 10 days.

What should you do if you have further questions?

Please contact your authorized Jaguar Dealer or the Jaguar Customer Relationship Center at 1 800 4JAGUAR (1-800-452-4827), option 9, by e-mail at <u>jaguarowner@jaguar.com</u>, or by mail using the return address listed above.

Sincerely,

Benjamin I. Weiner

Customer Satisfaction Manager