

04V-010



RECEIVED

2004 MAY 12 P 1:11

OFFICE OF THE DIRECTOR  
NHTSA

**IC CORPORATION**  
751 SOUTH HARKRIDER, CONWAY, AR. 72032

**ADDENDUM # 2 TO IC CORPORATION RECALL # 03306**  
**NHTSA RECALL # 04V-010**

March 30, 2004

**REF: Modesty Panel at Front Barriers**

The original recall letter omitted the repair method with a special condition on the right side (entrance door side) modesty panel. The modesty panel at the wall sometimes is too short in height where it attaches to the new bracket at the wall. The two guide holes do not line-up with the panel and therefore you cannot attach the panel to the bracket. If the modesty panel at this area is not long enough in height to match the repair bracket predrilled guide holes, drilling one or two 1/8-inch diameter hole(s) closer to the center of the bracket and through the modesty panel to rivet the two parts together is permissible. The function of the bracket is to prevent the modesty panel from being kicked out of position and the closer location or one fastener will provide this function. Also the location of the existing rivets on the wall in the area varies and may interfere with the installation of the bracket in the desired position. Putting large diameter flat washers with a 3/16" to 1/4" inch hole as a spacer between the supplied bracket and the wall will move the bracket away from the existing rivet and provide an approved installation. The picture below shows the method of installing this bracket with the two rivets closer to the center of the bracket. If snake rubber is on the panels in the area it does not have to be trimmed back to clear the bracket. The rivet when installed will pull the panel as tight as needed.

Install washers between  
bracket and wall if needed.



Original hole location

New Hole locations

Original whole location

If you have any questions please contact IC's Compliance Department at 1-800-843-5615.

Sincerely,

IC Compliance Department