




**IC CORPORATION**  
751 SOUTH HARKRIDER, CONWAY, AR 72032

**ADENDUM TO IC CORPORATION RECALL # 03306**  
**NHTSA RECALL # 04V-010**

March 17, 2004

**REF: Modesty Panel at Front Barriers**

The original recall letter omitted the repair method and parts for a combination of the left modesty panel and drivers under seat heater, code 048PLX. The bracket supplied with the kit for this combination will not provide the proper repair and should not be used. In place of the bracket supplied with the kit, a new bracket part number 2209386C1 must be used. It mounts in a different location using the same size mounting hardware supplied with the kit and same size drill. When ordering a kit for units with this combination the new bracket must also be ordered. The picture below shows the proper method of installing this new bracket. This does not affect the repair of the right side modesty panel.

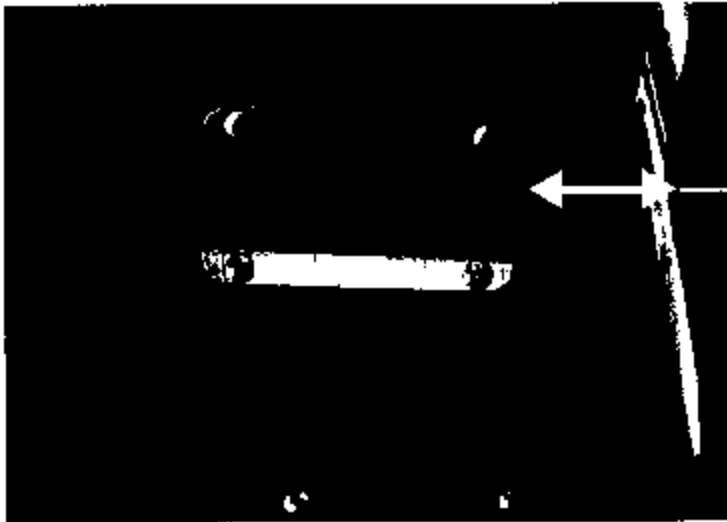

Position the bracket approximately 1.5 inches from the vertical face of the heater cover with the greater angle (about 45 degrees) attached to the wheel well. For ease of installation, attach the bracket to the floor first with the upper portion in line with the modesty panel.

If you have any questions please contact IC's Compliance Department at 1-800-843-5615.

Sincerely,

IC's Compliance Department