

RECEIVED

2004 JUL 10 A.M. 15

SAFETY RECALLS

G-04518
November 2004

SUBJECT: SAFETY RECALL (U.S., EXPORT)
TURN SIGNAL SWITCH assemblies on certain 3300,
4200, 4300, 4400, and CE School Bus models built
5/24/2004 thru 8/17/2004

DEFECT DESCRIPTION

An incorrectly manufactured switch contact can cause intermittent contact in the turn signal stalk assembly. This results in intermittent left turn signal lamp and indicator light operation when the hazard switch is activated.

Intermittent light operation reduces the ability to warn other motorists of the driver's intentions. This could cause a **vehicle crash without warning** that may result in **property damage, personal injury or death.**

MODELS INVOLVED

This Safety Recall involves 3300, 4200, 4300, 4400, and CE School bus models built according to the following table:

<u>Assembly Plant</u>	<u>VIN Position 11</u>	<u>Start Date</u>	<u>End Date</u>
Springfield, Oh	H	5/24/2004	7/16/2004
Garland, TX	J	6/1/2004	7/22/2004
Escobedo, Mexico	L	6/2/2004	7/26/2004
Conway, AK	A	5/19/2004	8/17/2004
Tulsa, OK	B	6/4/2004	8/16/2004

OWNER NOTIFICATION

International Truck and Engine Corporation will notify owners of these vehicles about this campaign. A copy of the owner letter is attached. During the recall process, a listing of owner names and addresses will be furnished to the involved dealers to enable dealers to follow up with owners and have the vehicles corrected. You must limit the use of this listing to this campaign because the list may contain information obtained from state motor vehicle registration records and the use of such motor vehicle registration data for purposes other than this campaign is a violation of law in several states.

PARTS INFORMATION

The part required for this recall is:

Part Number	Part Description	Quantity
3587009C91	SWITCH, TURN SIGNAL	1 As Required by Service Procedure

SERVICE PROCEDURE



WARNING:

TO PREVENT SERIOUS EYE INJURY, ALWAYS WEAR SAFE EYE PROTECTION WHEN YOU PERFORM VEHICLE MAINTENANCE OR SERVICE.



WARNING:

TO PREVENT UNEXPECTED MOVEMENT OF THE VEHICLE AND POSSIBLE SERIOUS PERSONAL INJURY OR DEATH, BLOCK THE WHEELS TO PREVENT THE VEHICLE FROM MOVING IN BOTH DIRECTIONS.

DATE CODE INSPECTION

1. Remove the three (3) screws that fasten the lower steering column trim to the steering column.

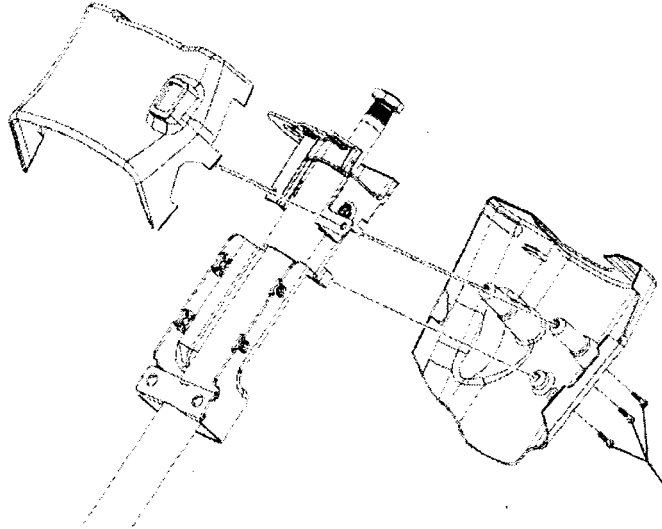


Figure 1

2. Inspect the underside of the turn signal stalk assembly for the build date code.

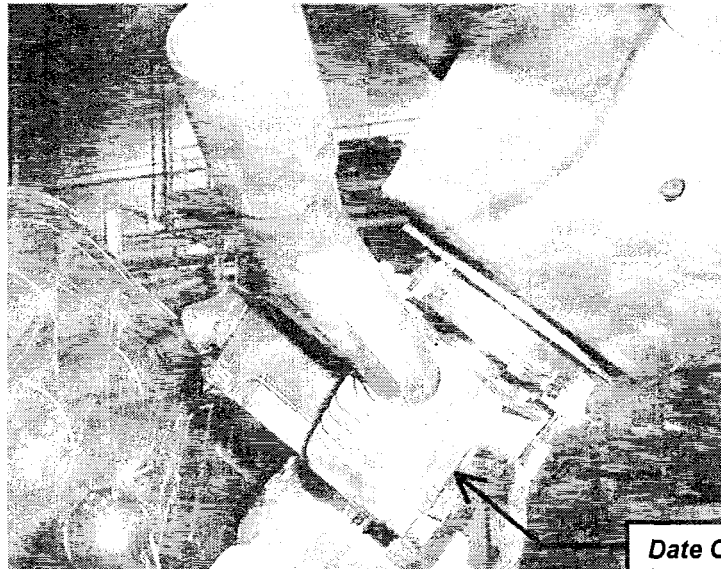


Figure 2

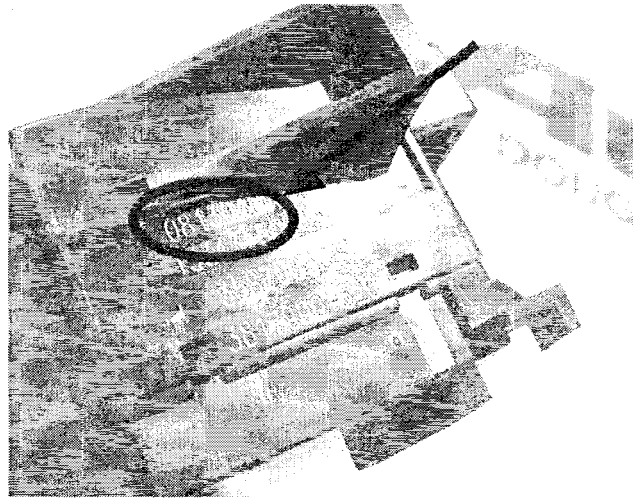


Figure 3

NOTE: The example in Figure 3, 081304, corresponds to a build date of August 13th of 2004.

3. Replacement of the turn signal switch is required if the build date codes are between **051504** (May 15, 2004) thru **062804** (June 28, 2004). Skip to step 5.
4. If the date code on the switch assembly is **NOT** in the range listed in step 3, **NO FURTHER ACTION IS NECESSARY**, re-install lower column trim panel and fasteners.

TURN SIGNAL SWITCH REPLACEMENT

5. Remove the upper column trim panel.
6. Disconnect electrical connector and remove switch assembly.

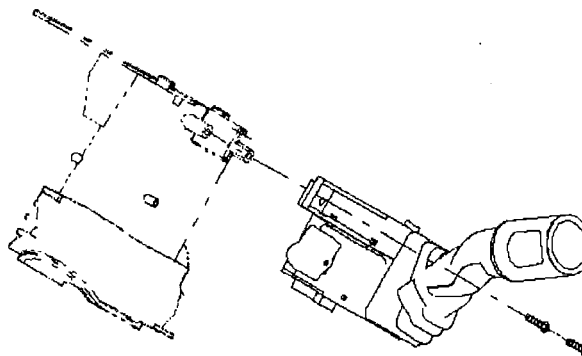


Figure 4

7. Install new switch assembly and connect electrical connector. See **Figure 4**.
8. Re-install upper and lower steering column trim panels. See **Figure 1**.
9. Perform functional test on switch to verify all turn signals and hazard lamps function.

END OF SERVICE PROCEDURE

LABOR INFORMATION

<u>Operation No.</u>	<u>Description</u>	<u>Time</u>
A40-04518-1	<i>Inspect Switch Date Code</i>	0.3
A40-0458-2	<i>Add on for Switch Replacement</i>	0.2

CAMPAIGN IDENTIFICATION LABEL

*Each vehicle corrected in accordance with this campaign **must be** marked with a CTS-1075 Campaign Identification Label.*

Complete the label and attach on a clean surface next to the vehicle identification number (VIN) plate.

DO NOT REMOVE

INTERNATIONAL

Campaign No. _____

VIN _____

Eng.# _____

COMPLETED

Service Location Code # _____

DO NOT REMOVE

ADMINISTRATIVE/DEALER RESPONSIBILITIES (U.S. & POSSESSIONS)

Proceed immediately to make necessary correction to units in inventory. **All inventory vehicles subject to this recall campaign must be corrected prior to sale, transfer or delivery.** If vehicles have been sold or transferred and you are in receipt of Customer Notification Letters and Authorization for Recall Service cards for those vehicles, the transfer location or customer must be notified **IMMEDIATELY** from your dealer location.

Dealers must correct all vehicles subject to this campaign at no charge to the owner, regardless of mileage, age of vehicle, or ownership, from this time forward.

The National Traffic and Motor Vehicle Safety Act, as amended, provides that each vehicle that is subject to a vehicle recall campaign must be adequately **repaired** within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within **60 days** after a tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. If the condition is not adequately repaired within 60 days, the owner may be entitled to **replacement** with an identical or reasonable equivalent vehicle at no charge, or to a **refund** of the purchase price less a reasonable allowance for depreciation.

However, consistent with the customer notification, dealers are expected to complete the repairs on the mutually agreed upon service date.

To avoid having to replace an owner vehicle or refund the purchase price, every effort must be made to promptly schedule an appointment with each owner to repair his or her vehicle as soon as possible.

WARRANTY CLAIMS

Refer to Dealer Warranty Manual for procedures to conduct Recall Campaigns.

It is important that the Recall Coding be completed properly to assist in processing the warranty claim. Complete instructions will be found in the Warranty Manual, Section 7-1. Special attention should be given to Items 39 through 44:

GROUP	NOUN	C	WARR.	TP	PAD
GROUP Enter number G—	NOUN Leave blank	C (CAUSE) Enter either 1, 2, 3. (see below)	WARRANTY (Warranty Code) Enter 40.	TYPE PART Enter P for type part causing failure.	PAD Enter 100
		1. Inspected (No repair required).			
		2. Inspected and repaired.			
		3. Defective part from parts stock.			

ADMINISTRATIVE/DISTRIBUTOR RESPONSIBILITY (EXPORT)

Proceed immediately to make necessary correction to units in inventory. All inventory vehicles subject to this recall campaign must be corrected prior to sale, transfer or delivery. If vehicles have been sold or transferred and you are in receipt of Customer Notification Letters and Authorization for Recall Service cards for those vehicles, the transfer location or customer must be notified from your distributor location.

Export locations are to submit warranty claims in the usual manner making reference to this recall number.

We ask for your full cooperation and follow-up to this important subject matter. If you have any questions or need further assistance, please contact the Regional Service Manager at your regional office.

INTERNATIONAL TRUCK AND ENGINE CORPORATION

MISSING QUARTERLY REPORTS FOR 2004-2

Recall Number	Manufacturer	Subject	Last Quarter Submitted	Last Quarter Number	Date Letter Sent	Received Report	Notes:
00C-018	Basic Comfort	Seat backs & cushions	2000-4	3	9/15/2004	No ltr sent	I want one current report
03E-017	Masterlock	Zero tilt ball mount trailer hitch	2003-2	1	9/15/2004		
03E-023	Vector Products	Coffee maker	2003-2	1	9/15/2004		
03V-167	Crane Carrier	Brake slack adjuster	2003-3	99	9/15/2004	N/A	Campaign is at 100%
03E-006	AFX	FMVSS 208/Motorcycle helmets/weak spots	2003-4	3	9/15/2004		
03E-007	AFX	FMVSS 208/Motorcycle helmets/Chin Strap	2003-4	3	9/15/2004		
02V-234	Capacity of Texas	ABS sensor wires	2003-4	1	9/15/2004		Talk w/GP
03E-042	Catz USA	FMVSS 108/Lights too bright	2003-4	1	9/15/2004		
02V-257.001	Daewoo Puerto Rico	FMVSS 106/Brake hoses	2003-4	5	9/15/2004	~~10-12-04~~	
03V-080	Damon	brake system warning indicator	2003-4	3	9/15/2004	10/6/2004	
03V-095	Damon	Water contamination	2003-4	3	9/15/2004	10/6/2004	
02E-046	Dexter Axle	Wheel hubs	2003-4	4	9/15/2004		
03V-016	Explorer Van	Running board light	2003-4	4	N/A		Company is sending in new rpts - 9/16/04
02C-014	Graco	Missing hooks	2003-4	4	N/A	9/9/2004	J. Rice resent reports
03E-029	Jost	Fifth wheels - cracks	2003-4	2	9/15/2004	9/30/2004	
03V-194	Mitsubishi	Electrical corrosion	2003-4	2	9/15/2004		
02V-093	Newmar	Braking device	2003-4	5	N/A	9/22/2004	called company on 9/13/04 - Vac. Left Message
02V-188	Newmar	Brake air lines	2003-4	5	N/A	9/22/2004	called company on 9/13/04 - Vac. Left Message
02V-198	Newmar	TV bracket	2003-4	5	N/A	9/22/2004	called company on 9/13/04 - Vac. Left Message
02E-051	Northpole USA	Ames cargo carrier	2003-4	2	N/A		Co. has closed its doors/disconnected phones
03V-114	Starcraft Bus	Seat mounting	2003-4	2	9/15/2004	9/28/2004	B. Dettman called - will have report by 9/27/04
02E-007	Teleflex	Floor pedals	2003-4	5	9/15/2004		
03V-236	Van Hool	Wheel chair lift	2003-4	2	9/15/2004	10/1/2004	

MISSING QUARTERLY REPORTS FOR 2004-2 part 2

Recall Number	Manufacturer	Subject	Last Quarter Submitted	Last Quarter Number	Date Letter Sent	Received Report	Notes:
03V-530	Accubilt	FMVSS 225/Child Restraint Anchorages	2004-1	1	9/15/2004	~~10-12-04~~	
03E-013	ArvinMeritor	Front axle assembly	2004-1	5	9/15/2004	10/1/2004	
03V-021	Campagna	Fuel Pressure regulator	2004-1	5	9/15/2004	9/23/2004	
02E-016	Dana	Wheel bearings	2004-1	4	9/15/2004	10/6/2004	
02V-271	Fleetwood	Refrigerator wiring	2004-1	5	9/15/2004	9/28/2004	
03V-347	Forest River	brake system warning indicator	2004-1	3	9/15/2004	9/8/2004	
02V-296	Forest River	Fog lamps	2004-1	5	9/15/2004	9/8/2004	
03V-055	Gillig	Conditioner mounting bolt	2004-1	5	9/15/2004	9/22/2004	
03E-063	Globetech	Warning triangle kit	2004-1	1	9/15/2004	9/22/2004	
03V-092	Gulf Stream	brake system warning indicator	2004-1	4	9/15/2004	9/21/04	
03V-329	Gulf Stream	T-1 circuit breaker	2004-1	2	9/15/2004	9/21/04	
03V-330	Gulf Stream	Trailer Hitch	2004-1	2	9/15/2004	9/21/04	
03E-049	KBC	Motorcycle helmets	2004-1	1	9/15/2004	9/29/2004	Will send in rpt by Sept. 29, 2004
02V-203	Mercedes	Seat belt chime	2004-1	5	9/15/2004	N/A	Didn't send first report
03E-025	Moss	Kingpins	2004-1	3	9/15/2004	9/22/2004	
03V-059	National RV	brake system warning indicator	2004-1	1	9/15/2004	9/27/2004	
03E-035	Pioneer Entertainment	Stereo Amplifiers	2004-1	3	9/15/2004	9/23/2004	
03V-148	Rexhall	brake system warning indicator	2004-1	2	9/15/2004	9/23/2004	
03V-436	Rhodes Trailers	Axle grease	2004-1	2	9/15/2004	9/29/2004	
03V-533	Trail King	Fifth wheel plate	2004-1	1	9/15/2004	9/27/2004	
02E-043	Volvo Cars	Brink tow hitch	2004-1	5	9/15/2004	9/30/2004	

03V-208	Wabash	Winch	2004-1	3	9/15/2004		
---------	--------	-------	--------	---	-----------	--	--

MISSING QUARTERLY REPORTS FOR 2004-2 part 3

Recall Number	Manufacturer	Subject	Last Quarter Submitted	Last Quarter Number	Date Letter Sent	Received Report	Notes:
04E-016	G.R. Motorsports	FMVSS 108/HID kits	2004-1	1	9/15/2004	9/30/2004	
04V-157	Keystone RV	Hitch pins	2004-1	1	9/15/2004		
04E-011	McCulloch Motors	FMVSS 108/HID kits	2004-1	1	9/15/2004	9/23/2004	
04V-238	Mobility Works	Raised roof loosens/detaches from veh.	2004-1	1	9/15/2004		
04V-161	Starcraft Bus	FMVSS 108/Brake lights	2004-1	1	9/15/2004		B. Dettman called - will have report by 9/27/04
04V-212	Tracker Marine	Wheels	2004-1	1	9/15/2004	9/22/2004	
04V-209	Tracker Marine	Fiberglass fender	2004-1	1	9/15/2004	9/22/2004	
04V-211	Tracker Marine	Wheels	2004-1	1	9/15/2004	9/22/2004	
04V-210	Tracker Marine	Wheels	2004-1	1	9/15/2004	9/22/2004	
04V-114	Winnebago	LP tanks	2004-1	1	9/15/2004		

MISSING QUARTERLY REPORTS FOR 2004-2 part 4 - (NULLS)

Recall Number	Manufacturer	Subject	Last Quarter Submitted	Last Quarter Number	Date Letter Sent	Received Report	Notes:
03E-015	Trans/Air	Compressor mount kit	0	0	9/17/2004		
04E-024	AmSafe	FMVSS Seat belt assembly	0	0	9/22/2004	9/28/2004	
04E-028	Galaxy Tire & Wheel	Truck wheel	0	0	9/22/2004	9/27/2004	
04E-029	MDT Consumer Group	Portable loading ramps	0	0	9/22/2004	10-13-04	
04V-049	Liberty Bus	FMVSS 217 - Emergency Door	0	0	9/22/2004		
04V-050	Liberty Bus	FMVSS 222 - Seats and padding	0	0	9/22/2004		
04V-095	Mitsubishi	Tire loading info label	0	0	9/22/2004		
04V-108	Mid-West Chopper	Swing arm pivot bolt	0	0	9/22/2004	10-11-04	Faxed them a guide 9/30/04
04V-112	DaimlerChrysler	Crank shaft position sensor wire	0	0	9/22/2004	9/30/2004	
04V-130	Bentley	Fuel feed line fuel quick connect	0	0	9/22/2004	10/6/2004	
04V-136	Jaguar	Air bag rupture	0	0	9/22/2004	9/28/2004	
04V-138	Mitsubishi	GVWA label	0	0	9/22/2004		
04V-045	GM	FMVSS 135 - brake valve	0	0			
04V-162	Accubuilt	FMVSS 207-seats	0	0	9/22/2004	10-12-04	
04V-197	Mitsubishi	Trailer hitch wiring	0	0	9/22/2004		
04V-254	Honda	Motorcycle speedometer	0	0	9/22/2004		
04V-281	GM	Fuel feed pipe assembly	0	0			
03V-461	Liberty Bus	FMVSS 111 - rearview mirrors	0	0	9/22/2004		

Recalls with 577 dates and no owner letter

04V-125	Ditch Witch		
04V-166	Triple E	Lossened seat belt bolt	10/1/2004
04V-265			
04V-266			
04V-393			

KS
11-3-04

ArvinMeritor Light Vehicle Aftermarket

RECALL NOTICE

Recall Number: TBD

October 28, 2004

CUSTOMER: «CUSTOMER_NAME»

NOTICE: PUROLATOR F55493, F65501, & F65502 FUEL FILTER RECALL

Dear ArvinMeritor Light Vehicle Aftermarket Customer:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Purolator Products, Inc., a division of ArvinMeritor Light Vehicle Aftermarket ("Purolator") has been ^{Dec:Dec} informed by one of its suppliers that a defect, which relates to motor vehicle safety, exists in Purolator part numbers F55493, F65501, & F65502 fuel filters. These filters are available for use in 1999 thru 2002 Jeep vehicles equipped with V8 4.7L engines; 2000 thru 2002 Jeep vehicles equipped with 6 cylinder 4.0 L engines; and 2002 Jeep vehicles equipped with V8 4.7FI HO (VIN J) engines.

The F65502 fuel filter has a three-port gray plastic housing with an internal pressure-regulating valve; while the F65501 and F55493 fuel filters have three-port stainless steel housing with internal regulating valve.

The supplier has indicated that the suspect fuel filters were manufactured with regulating valves that have incorrect spring pressure. As a result, vehicles equipped with one of the suspect fuel filters may experience immediate engine failure (i.e., engine will not start); engine misfire; engine stall, and/or damage to the fuel pump.

RECOMMENDED ACTION REGARDING UNSOLD PRODUCT

(NEW PRODUCT THAT HAS NOT BEEN INSTALLED)

Purolator requests that you return any of the Purolator F65502, F65501 and F55493 fuel filter part numbers in your current inventory. Purolator also recommends that you notify persons to whom you may have distributed suspect fuel filters to return such fuel filters.

«CUSTOMER_NAME»

F65502 total quantity shipped was «Total».

F65501 total quantity shipped was «Total».

F55493 total quantity shipped was «Total».

How to identify suspect material:

1. F65502 fuel filter has a three-port gray plastic housing with an internal pressure-regulating valve, while the F65501 and F55493 fuel filters have a three-port stainless steel housing with internal regulating valve.
2. The filter country of origin 'Taiwan' is printed on the body of the filters
3. The filter date code is printed on the body of the filter. The suspect date codes are:
F65502 date code P320327
F65501 date code P320327 and P620327
F55493 date code '01-03

*(We
are
entering
these
products
w/ the
std.
date
code)
So they come
upon a
search by
vehicle.*

John

After auditing your inventory and isolating any problem fuel filters.

- Summarize the quantity of F65502, F65501 and F55493 in your possession
- Receive an RGA# by calling Purolator Customer Service at 800-637-0580 ext.111
- If 125 or less units, Purolator Customer Service will issue a UPS Call Tag for the units to be picked up at your location
- If 126 or more units, contact your local Roadway terminal to arrange for a freight collect shipment pick up or visit their website at <http://www.roadway.com/tools/pu.html>.
- Mark the outside shipping container with the RGA# supplied by customer service.
- Ship the merchandise to:

ArvinMeritor
Purolator Product Company
3200 Natal Road
Fayetteville, NC 28306
Attn: Janice Wheeler

- Upon merchandise receipt, credit will be issued within 30 days
- Submit a replenishment order during your next regular order cycle.

RECOMMENDED ACTION REGARDING SOLD PRODUCT **(PRODUCT THAT HAS BEEN INSTALLED IN A VEHICLE)**

If you purchased one of the recalled fuel filters and if you have serviced or own one of the applicable vehicles and had your fuel filter serviced after June 2003, please call Purolator Claims Services at (800) 848-3783 for information about how to obtain a replacement part or a full refund. Purolator recommends that you return, at Purolator's expense, all suspect regulators for credit.

add this to recall

1. F65502 fuel filter has a three-port gray plastic housing with an internal pressure-regulating valve; while the F65501 and F55493 fuel filters have a three-port stainless steel housing with internal regulating valve.
2. The filter country of origin 'Taiwan' is printed on the body of the filters
3. The filter date code is printed on the body of the filter. The suspect date codes are:
F65502 date code P320327
F65501 date code P320327 and P620327
F55493 date code '01-03

Please contact Purolator Claims Services at (800) 848-3783, to receive an RGA (Returned Goods Authorization) number. This number will allow ArvinMeritor and you to track the return of your inventory. Please note that:

If you are calling from the U.S.A., Customer Service will issue you a UPS call tag. You should mark the outside of the shipping container with the RGA number you receive from Customer Service. This number is needed by the Distribution Center to receive, inspect and issue you a credit for the parts you are returning.

The filters should be returned for credit to:

ArvinMeritor/Purolator
3200 Natal Road
Fayetteville, NC 28036
Attn: Vicki Haveman

Availability of Replacement Parts and Service Instructions:

Replacement parts and service instructions are not currently available. Enclosed is a placard, number TP-XXX, concerning the suspect regulators that you can display at the point of purchase.

Communication:

If you conclude that Purolator Products, Inc., has not enabled you to remedy this condition in a reasonable time, you may submit a complaint to the:

**Administrator
National Highway Traffic Safety Administration
400 Seventh Street, S.W.
Washington, D.C. 20590**

- or -

Call the toll free Auto Safety Hotline: 1-888-DASH-2-DOT or 1-888-327-4236

We regret any inconvenience that this situation may cause. ArvinMeritor and Purolator Products, Inc. want to assure you that we are concerned for customer safety and your continued satisfaction with our products.

Sincerely,

Ramon C. Nunez
Director, Filter Product Management
ArvinMeritor Light Vehicle Aftermarket

DRAFT

APPENDIX D

PUROLATOR FUEL FILTERS Safety Recall

Part Numbers: F55493, F65501, & F65502

Photo of product to be
inserted

Purolator is recalling its fuel filters identified by Part Nos. F55493, F65501 and F65502 manufactured from March 1, 2003 through August 31, 2003

The date of manufacture is printed on the body of the filter. The suspect date codes are as follows:

Part No. F65502: Date Code P320327
Part No. F65501: Date Codes P320327 and P620327
Part No. F55493: Date Code '01-03

Purolator has been informed by one of its suppliers that suspect fuel filters were manufactured with regulating valves that have incorrect spring pressure. As a result, vehicles equipped with one of the suspect fuel filters may experience immediate engine failure (i.e., engine will not start); engine misfire; engine stall, and/or damage to the fuel pump. These filters are available for use in 1999 thru 2002 Jeep vehicles equipped with V8 4.7L engines; 2000 thru 2002 Jeep vehicles equipped with 6 cylinder 4.0 L engines; and 2002 Jeep vehicles equipped with V8 4.7FI HO (VIN J) engines.

The F65502 fuel filter has a three-port gray plastic housing with an internal pressure-regulating valve; while the F65501 and F55493 fuel filters have three-port stainless steel housing with internal regulating valve.

You should return the fuel filter to your retailer for credit.

If you have any questions, please contact ArvinMeritor LVA Customer Service at

800-848-3783

ArvinMeritor • 100 Westwood Place • Brentwood, TN 37027 USA