



Mr. George Person
Chief, Recall Management Office
National Highway Traffic Safety Administration
400 7th Street, S.W.
Washington, D.C. 20590

May 4, 2005

Subject: 573 Submittal

050-209
(17 pages)

Dear Mr. Person:

Vehicle Systems, Inc notified Country Coach Inc. on April 11, 2005 that certain Aqua-Hot, Hydro-Hot (equipped with the Webasto DBW 2010 Diesel-Burner) and Webasto DBW 2010 Coolant Heaters supplied to Country Coach, Inc. may have a potential safety defect. These products may have been installed in certain motor homes manufactured by Country Coach Inc. In accordance with 49 CFR Part 573, Country Coach is providing notification to your office of this potential safety defect.

Country Coach was notified that the Aqua-Hot, Hydro-Hot (equipped with the Webasto DBW 2010 Diesel-Burner) and Webasto DBW 2010 Coolant Heaters supplied to Country Coach Inc. between December 01, 2002 and April 01, 2005 may have this safety defect.

The defect involves the Diesel-Burner which is equipped with a Combustion Chamber (generic name - "burner tube") that may be made out of material that is not within specification and in those cases could fail prematurely. If such a failure occurs, the surface temperature of the exhaust tube exiting from the heater could increase and could potentially ignite combustible materials in or around the vehicle which could cause personal injury.

To date, Country Coach has not been notified of any fires involving the subject equipment.

VSI will administer the recall campaign and perform the replacement work free of charge to owners and dealers pursuant to the attached Safety Defect Report Pursuant to 49 CFR Part 573.

Please let me know if you have any questions.

Sincerely,

Gary Dwyer
Country Coach Inc.
Director, Quality Assurance and Compliance

Enclosures

THE WORLD'S FINEST MOTORCOACHES

135 East First Avenue | PO Box 400 | Junction City, OR 97448

**Safety Defect Report
Pursuant to 49 CFR part 573**

Vehicle Systems, Inc has notified Country Coach Inc. that certain Aqua-Hot, Hydro-Hot (equipped with the Webasto DBW 2010 Diesel-Burner) and Webasto DBW 2010 Coolant Heaters supplied to Country Coach, Inc. may have a potential safety defect. These products may have been installed in certain motor homes manufactured by Country Coach Inc. as listed below. In accordance with 49 CFR Part 573, Country Coach is providing notification to your office of this potential safety defect.

The information required by your regulations follows.

1. 573.5 (c)(1) Manufacturer's name and address.

Country Coach Inc.
135 East First Ave.
P.O. Box 400
Junction City, OR 97448

2. 573.5 (c)(2) Equipment involved in this notification:

Model: Allure
Model Year: 2003
VIN Range: 4U7A8EV1731103365 – 4U7A8EV1731103463
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Intrigue
Model Year: 2003
VIN Range: 4U7B8DY1631103366 – 4U7B8DY1931103460
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Magna
Model Year: 2003
VIN Range: 4U7C8EW1531103307 – 4U7C8EW1441103400
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Allure
Model Year: 2004
VIN Range: 4U7A8EY1941103901 – 4U7A8EY1441104034
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Magna
Model Year: 2004
VIN Range: 4U7C8EW1X41103398 – 4U7C8EW1X41103451
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Affinity
Model Year: 2005
VIN Range: 4U7D9FZ1X51104426 – 4U7D9FZ1551104706
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Intrigue
Model Year: 2005
VIN Range: 4U7B8EZ1351104370 – 4U7B8DZ1104670
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Allure
Model Year: 2005
VIN Range: 4U7A8DY1251104495 – 4U7A8ES1951104766
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Magna
Model Year: 2005
VIN Range: 4U7C9EZ1651104705 – 4U7C9FZ1X51104387
Vehicle Type: MPV
Bodystyle: Motor Home

• **Model:** Affinity
Model Year: 2006
VIN Range: 4U7D9FZ1861104734 – 4U7D9FZ21561104769
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Intrigue
Model Year: 2006
VIN Range: 4U7B8EZ1761104616 – 4U7B8EZ1761104762
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Magna
Model Year: 2006
VIN Range: 4U7C9EZ1961104733 – 4U7C9DZ1761104823
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Bus Conversion
Model Year: 2004
VIN Range: 2PCW3349021027914– 2PCW3349331028086
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Bus Conversion
Model Year: 2005
VIN Range: 2PCW3349341028283 – 2PCW3349051028372
Vehicle Type: MPV
Bodystyle: Motor Home

Model: Bus Conversion
Model Year: 2006
VIN Range: 2PCW3349651028375 – 2PCW3349751028496
Vehicle Type: MPV
Bodystyle: Motor Home

3. 573.5 (c)(3) Total number of items of equipment:

A total of 49 Model Year 2003 motor homes are involved
A total of 30 Model Year 2004 motor homes are involved
A total of 149 Model Year 2005 motor homes are involved
A total of 54 Model Year 2006 motor homes are involved

A cumulative total of 282 motor homes are consumer owned

4. 573.5 (c)(4) Approximate percentage of equipment estimated to actually contain the noncompliance:

Vehicle Systems, Inc. has estimated that 100% of the motor homes identified in item 2, above, may exhibit the safety defect.

5. 573.5 (c)(5) Description of the noncompliance:

Brief summary of noncompliance:

Country Coach received notification from Vehicle Systems, Inc. of a potential defect in the Aqua-Hot, Hydro-Hot (equipped with the Webasto DBW 2010 Diesel-Burner) and Webasto DBW 2010 Coolant Heaters

supplied to Country Coach Inc. between December 01, 2002 and April 01, 2005.

The Diesel-Burner is equipped with a Combustion Chamber (generic name – “burner tube”) that may be made out of material that is not within specification and in those cases could fail prematurely. If such failure occurs, the surface temperature of the exhaust tube exiting from the heater can increase and could potentially ignite combustible materials in or around the vehicle which could cause personal injury.

A copy of the notice from Vehicle Systems, Inc. is attached.

6. **If the defect or noncompliance is in a component or assembly purchased from a supplier, identify the supplier by corporate name and address.**

Vehicle Systems, Inc.
500 Jackson St.
Columbus, IN 47202

7. **Chronological summary of events leading to this determination:**

Vehicle Systems, Inc. Inc. notified Country Coach Inc via US Postal Service dated April 11, 2005 of the defect. It has been determined that 249 consumer owned motor homes built by Country Coach Inc. may be affected by this safety defect.

To date there have been no incidents related to this defect reported to Country Coach Inc. involving any of the affected motor homes.

8. **573.5 (c)(8) Description of proposed remedy:**

The field fix will involve the replacement of the “burner tube”.

9. **Program for Remedy Campaign:**

Vehicle Systems, Inc. will track completion of the units and handle reporting responsibilities for this campaign. Country Coach Inc. will mail a Safety recall notice with a copy of the VSI notification letter attached to each customer that may have an affected motor home, and a Dealer Vehicle Safety Defect Service Bulletin to all dealers.

Vehicle Systems, Inc. has offered to remedy the affected motor homes free of charge to the owner.

APR 11 2005

Vehicle Systems

I N C O R P O R A T E D

March 30, 2005

Re: Safety Recall No. 05E-015 OEM Notification Letter

Dear: Sir or Madam

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

REASON FOR THIS SAFETY RECALL

Webasto Product North America, Inc., our Diesel-Burner supplier, has determined that a safety-related defect which relates to motor vehicle safety may exist in certain Aqua-Hot, Hydro-Hot (equipped with the Webasto DBW 2010 Diesel-Burner), along with Webasto DBW 2010 Coolant Heaters. The Diesel-Burner is equipped with a Combustion Chamber (generic name – “burner tube”) that may be made out of material that is not within specification and in those cases could fail prematurely. If such failure occurs, the surface temperature of the exhaust tube exiting from the heater can increase and could potentially ignite combustible materials in or around the vehicle which could cause personal injury. Vehicle occupants may notice an increase in noise relating to such an occurrence and may observe heat related discoloration of components of the heater’s exhaust system. This Combustion Chamber material defect may have affected heaters manufactured during the dates of November, 2002 through February of 2005.

Motor Homes that would be affected by this campaign would be manufactured after December 1, 2002 thru April 1, 2005

More specifically Aqua-Hot Serial # 02-1606 thru 05-0249 and Hydro- Hot Serial # HM/E 02-529 thru HM/E 05-0374 or Webasto Serial # 100265 thru 802066.

WHAT WE WILL DO

Webasto Product North America Inc., with the support of Vehicle Systems, Inc., will replace all affected Combustion Chambers (i.e. burner tube) with a new one.

WHAT YOU SHOULD DO

As the OE Manufacturer please contact your Motorhome Servicing Dealers as well as your Customer (End Users) as soon as possible to update them regarding this no-charge Safety Recall Campaign.

oem notification 05E-015 .ltr Page 1 of 2

Motor Coach Heating Specialists • Manufacturers and Distributors

15549 East Highway 52 • Fort Lupton, CO 80621 • 303.659.8221 • FAX 303.857.9000

www.vehiclestv.com • www.aqua-hot.com • www.hydro-hot.com

~~Vehicle Systems~~

 
I N C O R P O R A T E D

We have enclosed sample copies of the "Servicing Dealer letter", "End User letter" along with a copy of the "Service Instructions" and "Campaign Claim Form" for distribution to your dealers and Customers.

Please be sure to contact our company directly at 1-800-685-4298 and ask to speak with our Technical Support staff should you have any questions regarding the logistics of this Recall campaign.

We are sorry for this inconvenience; however, we have taken this action in the interest of your safety and continued satisfaction with our products.

Sincerely,



Dean Jackson

Manager of Technical Support, Product Service, and Warranty Administration

~~Vehicle Systems~~

I N C O R P O R A T E D

March 30, 2005

Re: Safety Recall No. 05E-015 Servicing Dealer Letter

Attn: Service Managers

~~Dear Sir or Madam~~

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

REASON FOR THIS SAFETY RECALL

Webasto Product North America, Inc., the Diesel-Burner supplier for the Aqua-Hot and Hydro-H heating systems, has determined that a safety-related defect which relates to motor vehicle safety may exist in certain Aqua-Hot, Hydro-Hot (equipped with the Webasto DBW 2010 Diesel-Burner), along with Webasto DBW 2010 Coolant Heaters. The Diesel-Burner is equipped with a Combustion Chamber (generic name – “burner tube”) that may be made out of material that is not within specification and in those cases could fail prematurely. If such failure occurs, the surface temperature of the exhaust tube exiting from the heater can increase and could potentially ignite combustible materials in or around the vehicle which could cause personal injury. Vehicle occupants may notice an increase in noise relating to such an occurrence and may observe heat related discoloration of components of the heater’s exhaust system. This Combustion Chamber material defect may have affected heaters manufactured during the dates of November, 2002 through February of 2005.

Motorhomes that would be affected by this campaign would be manufactured after December 1, 2002 thru April 1, 2005

More specifically Aqua-Hot Serial # 02-1606 thru 05-0249 and Hydro- Hot Serial # HM/E 02-529 thru HM/E 05-0374 or Webasto Serial # 100265 thru 802066.

WHAT WE WILL DO

Webasto Product North America Inc., with the support of Vehicle Systems, Inc., will replace all affected Combustion Chambers (i.e. burner tube) with a new one. All Qualified Servicing Dealers will be sent a limited supply of replacement Combustion Chambers at no charge to the dealer for the initiation of this campaign.

~~Vehicle Systems~~

I N C O R P O R A T E D

WHAT YOU SHOULD DO

 
As the Qualified Servicing Dealer please review all technical correspondence enclosed with this notice to understand the scope of this Safety Recall Campaign.

Educate your service and claims personnel concerning which heaters are affected by this recall as well as reviewing the "Process Instructions" for clarity in claim submission and reimbursement procedures.

We have enclosed sample copies of the "End User letter" along with a copy of the "Process Instructions" and "Campaign Claim Form" for distribution to your Service Technicians. Please be sure to contact our company directly at 1-800-685-4298 and ask to speak with our Technical Support staff should you have any questions regarding the logistics of this Recall campaign.

We are sorry for this inconvenience; however, we have taken this action in the interest of your safety and continued satisfaction with our products.

Sincerely,



Dean Jackson

Manager of Technical Support, Product Service, and Warranty Administration

Vehicle Systems

I N C O R P O R A T E D

April 11, 2005

Re: Safety Recall No. 05E-015 Owner Notification Letter

Dear Vehicle Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

REASON FOR THIS SAFETY RECALL

Webasto Product North America, Inc., the Diesel-Burner supplier for the Aqua-Hot and Hydro-Hot heating systems, has determined that a safety-related defect which relates to motor vehicle safety may exist in certain Aqua-Hot, Hydro-Hot (equipped with the Webasto DBW 2010 Diesel-Burner), along with Webasto DBW 2010 Coolant Heaters. The Diesel-Burner is equipped with a Combustion Chamber (generic name – “burner tube”) that may be made out of material that is not within specification and in those cases could fail prematurely. If such failure occurs, the surface temperature of the exhaust tube exiting from the heater can increase and could potentially ignite combustible materials in or around the vehicle which could cause personal injury. Vehicle occupants may notice an increase in noise relating to such an occurrence and may observe heat related discoloration of components of the heater’s exhaust system. This Combustion Chamber material defect may have affected heaters manufactured during the dates of November, 2002 through February of 2005.

Motorhomes that would be affected by this campaign would be manufactured after December 1, 2002 thru April 1, 2005

More specifically Aqua-Hot Serial # 02-1606 thru 05-0249 and Hydro- Hot Serial # HM/E 02-529 thru HM/E 05-0374 or Webasto Serial # 100265 thru 802066.

WHAT WE WILL DO

Webasto Product North America Inc., with the support of Vehicle Systems Inc. will replace all affected Combustion Chambers (i.e. burner tube) with a new one.

WHAT YOU SHOULD DO

Please contact your Motorhome Manufacturer or Vehicle Systems as soon as possible for assistance in locating a Qualified Service facility regarding this no-charge Safety Recall Campaign. Please be sure to ask if they are aware of this particular Safety Recall

End-user ltr.05E-015 Page 1 of 2

Motor Coach Heating Specialists • Manufacturers and Distributors

15549 East Highway 52 • Fort Lupton, CO 80621 • 303.659.8221 • FAX 303.857.9000

www.vehiclesvs.com • www.aqua-hot.com • www.hydro-hot.com

Vehicle Systems

I N C O R P O R A T E D

Campaign #05E-015 prior to scheduling a service appointment. If the Motorhome Dealer has not been notified about this Safety Recall Campaign, please contact Vehicle Systems Inc. at 1-800-685-4298 and ask to speak with our Technical Support and Service Department. A company representative will then either contact your particular Motor Home Dealer regarding this Safety Recall Campaign matter, or they will provide you with information regarding where there is an (authorized) Motorhome Dealer that can perform the necessary service correction, if applicable.

 
If you have sold or traded your Motorhome, please let us know by contacting our Technical Support and Service Department at 1-800-685-4298.

After contacting your Motorhome Manufacturer and Vehicle Systems, Inc., if you are unable to have the safety-related defect/noncompliance remedied without charge and within a reasonable time, you may notify:

Administrator
National Highway Traffic Safety Administration
400 7th Street, SW Washington, DC 20590
(Or call 1-888-327-4236)


We are sorry for this inconvenience; however, we have taken this action in the interest of your safety and continued satisfaction with our products.

Sincerely,



Dean Jackson
Manager of Technical Support, Product Service, and Warranty Administration

Process Instruction

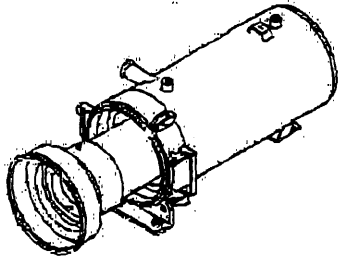

Process Instruction for the Replacement of the Burner Tube

April 2005

These Instructions are in reference to Safety Recall No. 05E-015

Webasto will allow \$92.50 labor to a qualified Servicing Dealer for each Burner Tube installed in accordance with the parameters of this Safety Recall.

Qualified Servicing Dealers will be provided with a limited stock of burner Tubes at no cost to the dealer.

**Before beginning work on the heater, the main power cable must be removed from the vehicle battery!
Do not work on a hot heater!**

A Philips screw driver, 10mm socket, extension and a 1/4 drive ratchet or a 10mm Tee-handle and socket combination is required.

For full service instructions, a service and repair manual is available online at:

<http://www.vehiclesys.com/manuals.htm>

Before starting work, check to see if the heater is already marked. Corrected heaters are marked with a yellow dot on the data/serial# plate on the outside of the of the Aqua-Hot or Hydro-Hot cover and on the front side of the burner head (black plastic) cover (see fig. 6&7).

Remove the heater access cover and locate the burner head attaching eye bolts. For burner head removal, both eye bolts of the housing are to be loosened (see fig. 1&2).

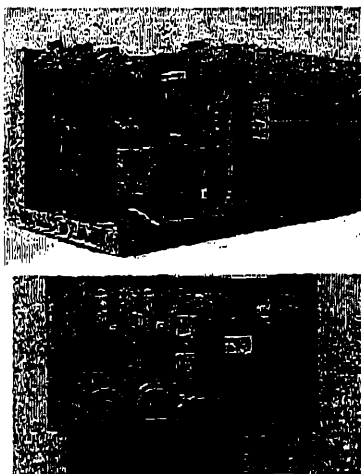


Figure 1


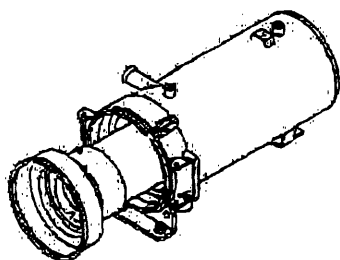


Figure 2


Once the burner head has been unlatched move it back away from the combustion chamber location, taking care not to bend or misalign the ignition electrodes or flame sensor disc.

Note: The wiring harness and fuel lines are long enough to allow for the burner head to be placed in a vertical position to allow plenty of clearance to remove the combustion chamber. (See fig. 3)

Process Instruction

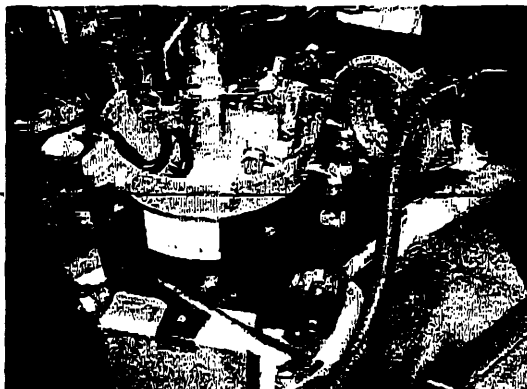

(Fig. 3)

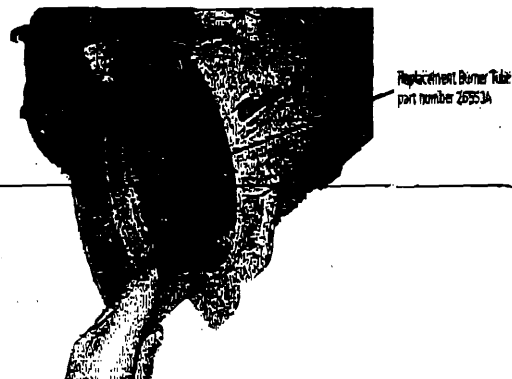

(Fig. 4)


The burner tube can now be pulled out (see fig. 4). If burner tube fit is very tight, use two screwdrivers to gently pry it evenly away from the heat exchanger. Do a visual check of the heat exchanger for damages. If necessary remove carbon deposits with a steel brush. Insert the new burner tube into the heat exchanger until it is fully seated.

No further adjustment is necessary.

When reassembling the burner head to the heat exchanger the eyebolts and ears must be in the correct position during tightening (see fig. 1). Tighten the eyebolts to a maximum of 4.0 Nm (35.5 lb/in.). Over-tightening could damage the casting.


Once the burner head has been re-installed, make sure that all four grommets (2 rights and 2 left) are in place.

To minimize combustion air leakage, ensure grommets are fitted tightly around wire cables and fuel pipes. (See fig. 5).

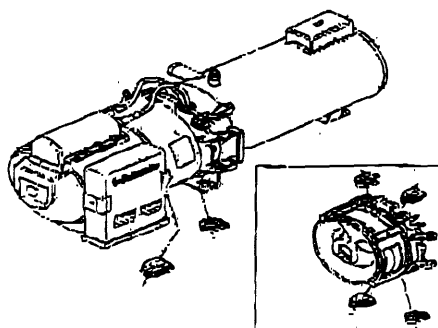


(Fig. 5)

Process Instruction

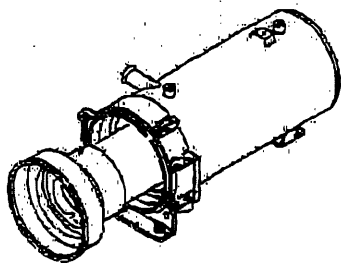

Place the special yellow adhesive dots (2 each provided) on the front side of the burner head and on the outside cover data plate to identify corrected heaters. (See figure 6&7)

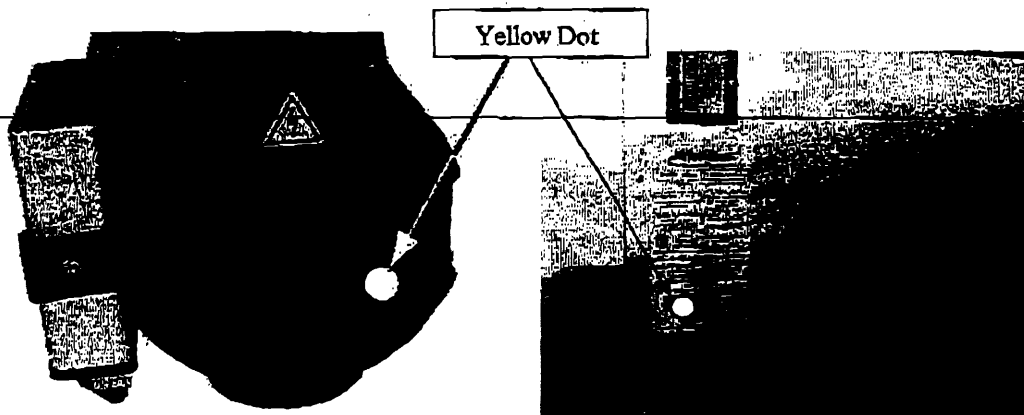

(Fig. 6)

(Fig. 7)

After completing the correction, a visual inspection and test run of the heater must be performed according to the service instructions.

In case of technical questions or technical problems please call our hotline at: (800) 685-4298.

Removed Material Disposition

To obtain reimbursement for labor, handling and expenses associated with installing replacement burner tubes dealers should:

- 1) Complete the Webasto Recall #05E-015 Claim Form and fax to 303-857-7881**
Webasto requires the return of the removed parts to Vehicle Systems Inc. (See Claim Form)
- 2) Upon submission of the claim, Vehicle Systems will issue a Return Goods Authorization (RGA) Number along with instructions for returning the parts.**

~~Vehicle Systems~~

I N C O R P O R A T E D

Webasto Recall #05E-015 Claim Form

Customer Name: _____ Coach Date of Purchase ____/____/____

Coach Manufacturer: _____ Coach VIN# _____

Aqua-Hot / Hydro-Hot Serial # _____ Webasto Serial # _____

Note: Only Aqua-Hot Serial # 02-1606 thru 05-0249 and Hydro- Hot Serial # HM/E 02-529 thru HM/E 05- 0374 or Webasto Serial # 100265 thru 802066 are covered by this campaign.

WPX-265-53A Combustion Chamber	No Cost to Dealer	NA
Combustion Chamber R&R Labor	Recall Flat Rate \$92.50	\$92.50
Return Shipping	Not to exceed 20% of actual shipping cost	\$
		Total \$ _____
Dealer Name: _____ Technician _____		
Address: _____ Phone #: _____		
City _____ State _____ Zip _____		
Service Mgr Signature: _____ Date: ____/____/____		

This recall claim form **DOES NOT** include normal warranty coverage. All other warranty repairs must be submitted separately.

Note: All parts replaced under this recall campaign" must be returned to Vehicle Systems with this completed claim form before any credit or reimbursement will be given.

Please call 800-685-4298 for Return Authorization and return this completed Claim Form and the parts replaced to: Vehicle Systems, Inc.

Warranty / Recall Campaign 05E-015

15549 East Highway 52

Fort Lupton, CO 80621

RGA# _____

Vehicle Systems

I N C O R P O R A T E D

April 11, 2005

Re: Safety Recall No. 05E-015 Owner Notification Letter

Dear Vehicle Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

REASON FOR THIS SAFETY RECALL

Webasto Product North America, Inc., the Diesel-Burner supplier for the Aqua-Hot and Hydro-Hot heating systems, has decided that a defect which relates to motor vehicle safety exists in certain Aqua-Hot, Hydro-Hot (equipped with the Webasto DBW 2010 Diesel-Burner), along with Webasto DBW 2010 Coolant Heaters. The Diesel-Burner is equipped with a Combustion Chamber (generic name – “burner tube”) that may be made out of material that is not within specification and in those cases could fail prematurely. If such failure occurs, the surface temperature of the exhaust tube exiting from the heater can increase and could potentially ignite combustible materials in or around the vehicle which could cause personal injury. Vehicle occupants may notice an increase in noise relating to such an occurrence and may observe heat related discoloration of components of the heater’s exhaust system. This Combustion Chamber material defect may have affected heaters manufactured during the dates of November, 2002 through February of 2005.

Motorhomes that would be affected by this campaign would be manufactured after December 1, 2002 thru April 1, 2005

More specifically Aqua-Hot Serial # 02-1606 thru 05-0249 and Hydro- Hot Serial # HM/E 02-529 thru HM/E 05-0374 or Webasto Serial # 100265 thru 802066.

WHAT WE WILL DO

Webasto Product North America Inc., with the support of Vehicle Systems Inc. will replace all affected Combustion Chambers (i.e. burner tube) with a new one.

WHAT YOU SHOULD DO

Please contact your Motorhome Manufacturer or Vehicle Systems as soon as possible for assistance in locating a Qualified Service facility regarding this no-charge Safety Recall Campaign. Please be sure to ask if they are aware of this particular Safety Recall

Campaign #05E-015 prior to scheduling a service appointment. If the Motorhome Dealer has not been notified about this Safety Recall Campaign, please contact Vehicle Systems Inc. at 1-800-685-4298 and ask to speak with our Technical Support and Service Department. A company representative will then either contact your particular Motor Home Dealer regarding this Safety Recall Campaign matter, or they will provide you with information regarding where there is an (authorized) Motorhome Dealer that can perform the necessary service correction, if applicable.

If you are Lessor of a vehicle which is affected by the defect federal regulations require that any vehicle Lessor receiving this recall notice must forward a copy of this notice to the Lessee within 10 days.

If a repair has been made prior to the receipt of this notice you could be eligible for reimbursement. Please contact Webasto Product at 1-800-432-8376.

If you have sold or traded your Motorhome, please let us know by contacting our Technical Support and Service Department at 1-800-685-4298.

After contacting your Motorhome Manufacturer and Vehicle Systems, Inc., if you are unable to have the safety-related defect/noncompliance remedied without charge and within a reasonable time, you may notify:

Administrator
National Highway Traffic Safety Administration
400 7th Street, SW Washington, DC 20590
(Or call 1-888-327-4236)

We are sorry for this inconvenience; however, we have taken this action in the interest of your safety and continued satisfaction with our products.

Sincerely,

Dean Jackson
Manager of Technical Support, Product Service, and Warranty Administration



135 East 1st Avenue • P.O. Box 400 • Junction City, Oregon 97448 • (800)547-8015 • (541)998-3720 • (541)998-9272 [FAX]

Fax Cover Sheet

DATE:	04 May 2005	TIME:	
TO:	George Person		
COMPANY:	NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION		
PHONE:	(202) 366-5210	FAX:	(202) 366-7882
FROM:	DICK SABATH		
	<i>Country Coach, Inc.</i>		
PHONE:	(541) 998-3720 Ext. 382	FAX:	(541) 998-7303
RE:	573, Webasto Heaters		

Number of pages including cover sheet: [16]

Message:

Attached is the 573 addressing the potential safety defect concerning the Webasto Heater installed in certain Country Coach motor homes.

Original documentation is being sent to your attention via Certified Mail.