

MONACO
COACH CORPORATION

December 22, 2005

VEHICLE SAFETY DEFECT SERVICE BULLETIN

Recall Campaign No. 05V568000

Monaco File # R05020

Re: Safety Recall – Driveline Straps

Dear Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Monaco Coach Corporation has decided that a defect which relates to motor vehicle safety exists in certain 2006 Signature Motorhomes manufactured from June 1, 2005 through September 29, 2005.

The affected units are:

Monaco: 2006 Signature Class A Motorhomes with an ISX 600 HP Engine

According to our information, your unit identified on the enclosed form is affected. *Federal law requires that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessee within ten days.*

Monaco Coach Corporation became aware of a defect with regards to the driveline straps used on specific 2005 Monaco Signature Class A Motorhomes. The defect relates to the straps that hold the u-joints into the rear end and the transmission. The lock washer on the aftermarket straps can spread out and allow the mounting bolts to work loose. This can allow the driveline to separate from the transmission and fall out of the coach. If this would occur, it can cause you to lose control of your vehicle, which could result in a crash. As a precautionary measure, Monaco Coach Corporation with Machine Services has elected to perform this voluntary safety recall. The remedy will involve replacing U-Joint straps, bolts, and lock washers with new straps and bolts with Lock Tite. The recall repair will be performed at no cost to you. If you had the defect, which is the subject of this letter, remedied prior to receiving this letter, you may be eligible for reimbursement by Monaco Coach Corporation for your remedy costs.

You may contact your Monaco Coach Corporation dealer to arrange for a service appointment. Instructions for making this correction have been sent to your dealer and parts are readily available.

MONACO COACH CORPORATION
606 Nelsons Parkway • P.O. Box 465 • Wapakoneta, IN 46786
Telephone: (574) 262-7211 • (877) 4-MONACO

The labor time necessary to perform this recall campaign is approximately 0.5 hours. Please ask your dealer if you wish to know how much additional time may be needed to schedule and process your motorhome.


The enclosed Recall Notification Form identifies your motorhome and will serve as an authorization and claim form to have the correction made. Presentation of this form to your dealer will assist in making the necessary correction in the shortest possible time. If you have sold or traded your vehicle, or for any reason cannot have this recall service performed, please let us know by completing the postage paid reply card and returning it to us promptly.

Your Monaco Coach Corporation dealer is best equipped to provide service to ensure your motorhome is corrected as promptly as possible. If, however, you take your unit to your dealer on the agreed service date and the dealer does not remedy this condition on that date or within three (3) days, please call our toll free recall hotline at (800) 685-6545 or our toll free number for Technical Service at (877) 466-6226..

If, after contacting your dealer, and the recall assistance service line, you believe Monaco Coach Corporation has failed or has been unable to remedy the noncompliance without charge or there has been an unreasonable delay in securing the remedy, you may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, SW, Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY:1-800-424-9153); or go to <http://www.safercar.gov>.

We apologize for any inconvenience that this may cause you. However, we have taken this action in the interest of your safety and continued satisfaction with your Monaco Coach Corporation Signature.

Sincerely,

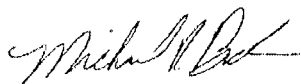

Michael R. Becker
Customer Service Manager
Monaco Coach Corporation

Replacement Procedures:

1. Locate the incorrect straps and remove and replace the straps one at a time.
2. Use only the new bolts provided in the parts kit to secure the new Spicer straps.
3. Once the straps are installed torque the mounting bolts to the proper amount specified on the new Spicer straps.
4. Grease all fitting on the driveline.

Spicer Strap:

Order # USA 05V568000

Order # CANADA 05-384

Parts: 1 Kit for each Coach

Kit Contains: 2 boxes - each containing 2 straps & 4 bolts

Please fax the enclosed Recall Parts Purchase Order to 1-800-498-9478.

Warranty Processing:

A Warranty Claim and Recall Notification Form must be submitted for each unit repaired, per instructions with Job Operation Code and time stated below. Units inspected and correct - with no repairs - are required to use the code below, and reduce the time to .25 to .5 accordingly by inspection time.

Labor:

Re-torque/Inspection Only

USA Job Operation Code: 22650259RC

Labor Allowance: .5

Canadian Job Operation Code: 05660259RC

Labor Allowance: .5