

**Recall Information Bulletin****No:** C0027010 **Issued:** 4/11/2005**Re:** Brake Master Cylinder**Group:** 35 **Models:** FG84D**SUBJECT:**

Safety Recall C0027010 - Brake Master Cylinder

MODELS:

FG84D

VEHICLES INVOLVED:

Certain 2005 model year FG84D vehicles produced from September 9, 2004 through September 16, 2004.

A list of vehicles your Dealership has sold that require this Recall can be found on the Dealer's "Open Campaigns" list supplied by MFTA via Fusonet. Some individual vehicles described above may not need the Recall. Always check the "VIN Inquiry" tab under "Service" or "Warranty" on Fusonet to verify that the VIN requires this Safety Recall.

Important note: It is a violation of Federal law for a dealer to deliver a new or used motor vehicle covered by this Recall Information Bulletin, under a sale or lease, until the Safety Recall has been completed.

OWNER NOTIFICATION:

Owners of affected vehicles will be notified by mail. A copy of the customer letter is included with this Bulletin.

CONDITION:

Mitsubishi Fuso Truck of America, Inc. has decided that a defect which relates to motor vehicle safety exists in the brake master cylinder. On affected vehicles, the brake master cylinder piston cups may have been manufactured with a defect in the rubber surface. Residue may have invaded the piston cups during the master cylinder manufacturing process. The residue could stick to the cups and cause them to crack during normal braking operation. In the worst case, a crack in a piston cup could adversely affect the truck's braking ability, and cause a crash without warning.

MODIFICATION:

The brake master cylinder assembly will be replaced with an assembly with improved piston cups.

PARTS TO BE REPLACED:

The brake master cylinder assembly will be replaced.

Part Number	Description
MK429254	Brake Master Cylinder
MR493229	Seal

RECALL PARTS RETENTION:

All parts that have been removed and replaced must be properly identified and retained, as outlined in the Warranty and Service Policy Manual, section 3.8. The Field Service Manager will inspect each part and authorize its scrapping.

RECALL CLAIM SUBMITTAL:

Claim parts and labor via the DIN System using the Recall Claim Entry screen. Enter all requested information, including the Recall Number C0027010. The system will apply a 3.4 hour labor allowance and US \$187.56 parts pricing adjustment (\$178.56 replacement parts + \$9.00 brake fluid).

Safety Recall Campaign Number	Allowances	
	Labor Time	3.4 hours
C0027010	Parts Pricing	US \$187.56

REPAIR PROCEDURE:

Follow the repair procedures outlined in Section 35 (TWSE0405-35A) of the 2005 FE/FG Service Manual TWSE0405-B.