

05V-252



TECHNICAL SERVICE BULLETIN

THE NEW AMERICAN MOTORCYCLE
Date: 06/10/2005

Victory Motorcycle

Bulletin Number: V-05-03(A)
Model Years: 2005

Safety Alert Fax Safety Recall Service Bulletin Service Alert Fax Production Update Kit

Distribution: Owner / Principal Service Manager Sales Manager Parts Manager Technicians

8 Pages

This Service Bulletin is located at www.polarisdealers.com



-Confidential and Proprietary-

SUBJECT: CAMSHAFT CHAIN DRIVE SPROCKET INSPECTION

PURPOSE: The Victory Motorcycle Division of Polaris Industries Inc. has decided that a defect which relates to motor vehicle safety exists in some 2005 Victory Hammer™ motorcycles. The cam chain drive sprocket (located on the crankshaft) may have cracked during installation. If cracks are present, the sprocket may fail during operation. Sprocket failure could cause the engine to lock up which could result in loss of operator control, increasing the risk of a crash.

DO NOT SELL, DELIVER, OR OPERATE AN AFFECTED UNIT UNTIL THE SPROCKET HAS BEEN INSPECTED!

MODEL(S) AFFECTED:

Model(s) Affected	Model Number(s)	Serial Numbers of Affected Vehicles
2005 Hammer™	V05H126, V05HB26UA, V05HB26US, V05HB26CA, V05HB26CAP, V05HB26CL, V05HB26CM, V05HB26CSP, V05HB26DA, V05HB26DAP, V05HB26DK, V05HB26DL, V05HB26DM, V05HB26DSP V05HB26LA, V05HB26LAP, V05HB26LK, V05HB26LL, V05HB26LM, V05HB26LSP,	SEE LIST OF AFFECTED VEHICLES ON PAGES 5-8

WHAT YOU MUST DO:

- 1) Follow the procedure on page 4 to inspect the cam chain drive sprocket for cracks on all affected motorcycles in your inventory. DO NOT deliver an affected motorcycle until this inspection and (if necessary) repair has been completed.
- 2) Contact owners of delivered units immediately and make arrangements to perform this recall inspection.
- 3) If inspection reveals a cracked sprocket, replace the engine following procedure on page 4. If the sprocket is not cracked, no further action is required.
- 4) File a warranty claim for affected units immediately after completing this inspection and / or repair. Refer to Warranty Claim Information on page 2.

CUSTOMER NOTIFICATION:

A customer notification letter 05V-252 (05-171 in Canada) will be sent to registered owners of motorcycles affected by this bulletin. An example of the letter is shown on page 3. In addition to the notification letter sent by Victory, dealers are required to notify owners of motorcycles sold by their dealership, and to make arrangements to perform this bulletin inspection/repair immediately.

The information contained within this bulletin is confidential and protected by U.S. and international copyright laws, and is the property of Polaris Industries Inc. This service bulletin is provided for the sole use of authorized Polaris dealers and distributors. This service bulletin is not to be distributed, duplicated, or copied, digitally or otherwise, without the written consent of Polaris Industries Inc.

Printed in U.S.A. - © 2005 Polaris Industries Inc.

WARRANTY CLAIM INFORMATION:

V-05-03(A) Page 2 of 8



Safety Recall Number	V-05-03 (for Inspection only) or V-05-03A (if sprocket is cracked and engine replacement is required)
Claim Type	File Warranty Claim Type SB for both registered units and units in your inventory.
Labor Allowance	Inspection: 15 minutes Repair: 5:00 hrs (this includes additional time for inspection and engine handling)
Warranty Claim Special Instructions	A single group claim using the claim type SB (Service Bulletin) may be submitted listing the serial number and date of repair for all machines with the <u>same model number</u> . DO NOT PUT MORE THAN ONE MODEL NUMBER ON A CLAIM.
Part Numbers to List on Claim	Automatically entered by the Warranty system for V-05-03. For V-05-03A, enter 0000505 (Service Bulletin Labor Only Code) and 7170107 in the parts used field.

PARTS INFORMATION

Part Number & Description (For V-05-03 Inspection Only)	5830227 Gasket (for inspection only) 7170107 Decal, Bulletin Completion
Part Number & Description (For V-05-03A Engine Replacement)	Contact Victory Technical Service at 1-800-330-9407
Quantity	1
Direct-Ship From Polaris?	No
To Be Ordered By Dealer?	Yes (for gasket / inspection only) If engine replacement is required, contact Victory Technical Service with information listed in Step 1 of Repair Procedure on page 4. <i>Do not order an engine through the parts department.</i>
Availability	Parts are in stock

BULLETIN COMPLETION DECAL:

After completion of this bulletin, fill out a service bulletin completion decal (P/N 7170107) and install on the inside of left side cover as shown.

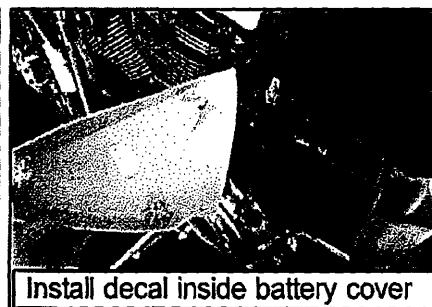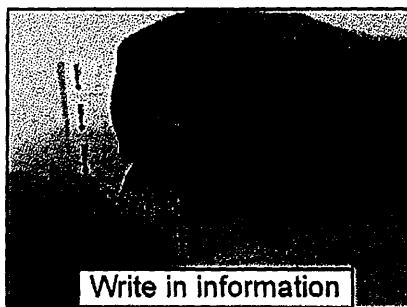

Sincerely,

Karl Iverslie

Karl Iverslie
Manager, Technical Service & Warranty

The information contained within this bulletin is confidential and protected by U.S. and international copyright laws, and is the property of Polaris Industries, Inc. This service bulletin is provided for the sole and exclusive use of the original recipient as prescribed by Polaris Industries, Inc. and may not be distributed, duplicated, or copied, digitally or otherwise, without the written consent of Polaris Industries, Inc.

Printed in U.S.A. - © 2005 Polaris Industries Inc.

Polaris Industries Inc.
2100 Hwy 55
Medina, Minnesota 55340



Phone: 763-542-0500
FAX: 763-542-0599

THE NEW AMERICAN MOTORCYCLE

**SUBJECT: RECALL CAMPAIGN - CAMSHAFT CHAIN DRIVE SPROCKET INSPECTION
2005 Victory Hammer™ Motorcycles**

Warning and Safety Recall Notice 05V-252 (05-171 in Canada)

Example of U.S. Consumer Letter Reference Victory Safety Recall Bulletin V-05-03(A)

Dear Victory Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

The Victory Motorcycle Division of Polaris Industries Inc. has decided that a defect which relates to motor vehicle safety exists in some 2005 Victory Hammer™ motorcycles. Our records indicate that you have purchased an affected vehicle.

The reason for this recall:

On the affected motorcycles, the camshaft chain drive sprocket located on the crankshaft may have cracked upon installation. If cracks are present, the sprocket may fail during operation. Sprocket failure could cause the engine to lock up which could result in loss of operator control, increasing the risk of a crash.

What Victory and your dealer will do:

To correct this defect, your authorized Victory dealer will remove the lower right engine cover and inspect the sprocket for cracks. If no cracks are visible, repair is not required. For those machines that fail the visual inspection, Victory dealers will replace the engine and/or necessary components. Repairs will be made by an authorized Victory motorcycle dealer at no cost to you. The inspection will take approximately 15 minutes after the engine and exhaust have cooled sufficiently to safely perform the inspection. However, parts replacement will require a longer period of time due to service scheduling requirements and the parts required.

What you should do:

Please call your authorized Victory motorcycle dealer to schedule an appointment. Do not attempt repairs yourself. Repairs must be done only by an authorized Victory dealer.

Do not ride your motorcycle until your dealer has inspected the camshaft chain drive sprocket.

While your Victory dealer is in the best position to answer your questions, if you have any questions that your dealer cannot address, or if you are having difficulty obtaining the recall repair outlined in this letter, please call our Consumer Service Department at (763) 417-8650.

If you no longer own your motorcycle, please call our Consumer Service Department at (763) 417-8650 or write to the address below with the name and address of the new owner.

If you believe that the Victory Motorcycle Division of Polaris Industries Inc. has failed to remedy this defect without charge or is unable to do so within a reasonable time, you may submit a complaint to the Administrator of the National Highway Traffic Safety Administration at 400 Seventh Street S.W., Washington D.C. 20590 or call the toll-free safety hotline at 1-888-327-4236.

Please accept our apologies for any inconvenience this may cause you. Your safety and continued satisfaction with your Victory motorcycle is our primary concern. Thank you for your prompt attention to this matter.

Sincerely,

VICTORY MOTORCYCLE DIVISION OF POLARIS INDUSTRIES INC.

Karl Iverslie

Manager, Technical Service & Warranty

Federal law requires that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessee within 10 days. If you are no longer the owner of the Victory motorcycle indicated by this letter, please contact our Consumer Service Department @ 763-417-8650 so we may update our records. Or write to us at:

Polaris Industries, Inc.
Consumer Service Department
2100 Highway 55
Medina, MN 55340-9962

REF: V0503(A)

The information contained within this bulletin is confidential and protected by U.S. and international copyright laws, and is the property of Polaris Industries Inc. This service bulletin is provided for the sole use of authorized Polaris dealers and distributors. This service bulletin is not to be distributed, duplicated, or copied, digitally or otherwise, without the written consent of Polaris Industries Inc.



INSPECTION PROCEDURE:

V-05-03(A) Page 4 of 8


1. Remove the lower cam chain drive sprocket cover.
2. Carefully inspect the entire surface of the sprocket for cracks.

If the sprocket is NOT CRACKED, proceed to Step 3.

If the sprocket is cracked, proceed to REPAIR PROCEDURE.

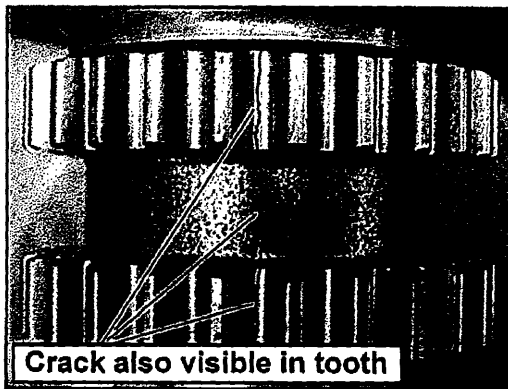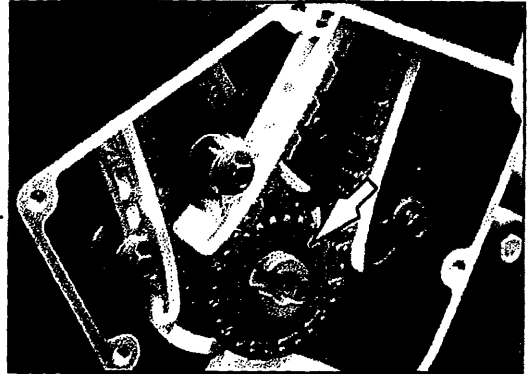


3. Clean gasket surface and install new gasket with sealant bead facing OUT (toward cover). Torque screws in a cross pattern to 85 in. lbs. (9.6 Nm).

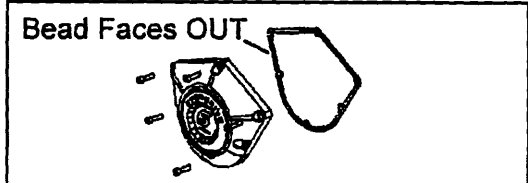

REPAIR PROCEDURE

1. If the sprocket is cracked, contact Victory Technical Service department to obtain an authorization and replacement engine. You must provide all information listed below in order to receive an authorization. The engine number will be stamped to match the existing engine in the motorcycle.
 - Dealer Name & Shipping Address
 - Dock Hours (Days and Times your dealership can receive delivery of the engine.)
 - Vehicle VIN (and mileage on vehicle)
 - Engine Serial Number (See photo at below right for location)
 - Engine Color (Silver or Black)
2. Return shipping instructions will be included with the engine. Save the shipping container from the new engine and follow the instructions to return the original engine (shipping is pre-paid by Victory). You **MUST** return the defective engine. Engines not received within 60 days of the replacement engine's shipping date will be charged back to your dealership at replacement value of \$16,000.00 (U.S. funds).
3. Refer to Engine Removal and Installation procedure in Chapter 6 of the Hammer Service Manual (PN 9919633). One copy of this manual was directly shipped to each Victory dealer.

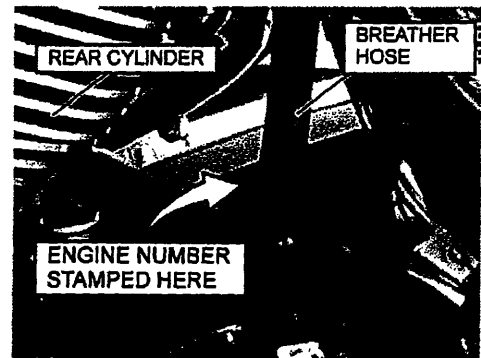

The information contained within this bulletin is confidential and protected by U.S. and International copyright laws, and is the property of Polaris Industries, Inc. This service bulletin is provided for the sole and exclusive use of the original recipient as prescribed by Polaris Industries, Inc. and may not be distributed, duplicated, or copied, digitally or otherwise, without the written consent of Polaris Industries, Inc.

Printed in U.S.A. - © 2005 Polaris Industries Inc.

LIST OF AFFECTED VEHICLES FOR V-05-03(A)

**Perform this bulletin on the following vehicles
(Last 6 digits of VIN are in sequential order)**

5VPHB26C05	3007709	5VPHB26D05	3010067	5VPHB26D65	3010123	5VPHB26D15	3010191
5VPHB26D55	3007715	5VPHB26D25	3010068	5VPHB26D85	3010124	5VPHB26D35	3010192
5VPHB26D95	3009998	5VPHB26D05	3010070	5VPHB26DX5	3010125	5VPHB26D55	3010193
5VPHB26D05	3009999	5VPHB26D25	3010071	5VPHB26D15	3010126	5VPHB26D75	3010194
5VPHB26D55	3010002	5VPHB26L55	3010072	5VPHB26D55	3010128	5VPHB26D95	3010195
5VPHB26D75	3010003	5VPHB26D65	3010073	5VPHB26D75	3010129	5VPHB26D05	3010196
5VPHB26D95	3010004	5VPHB26DX5	3010075	5VPHB26D55	3010131	5VPHB26D25	3010197
5VPHB26D25	3010006	5VPHB26D15	3010076	5VPHB26D75	3010132	5VPHB26D45	3010198
5VPHB26D45	3010007	5VPHB26D55	3010078	5VPHB26D95	3010133	5VPHB26D65	3010199
5VPHB26D65	3010008	5VPHB26D75	3010079	5VPHB26D05	3010134	5VPHB26D95	3010200
5VPHB26D85	3010012	5VPHB26D35	3010080	5VPHB26D25	3010135	5VPHB26D05	3010201
5VPHB26DX5	3010013	5VPHB26D55	3010081	5VPHB26D45	3010136	5VPHB26D25	3010202
5VPHB26L45	3010015	5VPHB26D75	3010082	5VPHB26D65	3010137	5VPHB26D45	3010203
5VPHB26D55	3010016	5VPHB26D25	3010085	5VPHB26D85	3010138	5VPHB26D65	3010204
5VPHB26D05	3010019	5VPHB26D45	3010086	5VPHB26DX5	3010139	5VPHB26D85	3010205
5VPHB26D75	3010020	5VPHB26D65	3010087	5VPHB26D65	3010140	5VPHB26DX5	3010206
5VPHB26D05	3010022	5VPHB26DX5	3010089	5VPHB26D85	3010141	5VPHB26D15	3010207
5VPHB26D25	3010023	5VPHB26D65	3010090	5VPHB26DX5	3010142	5VPHB26D35	3010208
5VPHB26D45	3010024	5VPHB26D85	3010091	5VPHB26D15	3010143	5VPHB26D55	3010209
5VPHB26D85	3010026	5VPHB26DX5	3010092	5VPHB26D35	3010144	5VPHB26D15	3010210
5VPHB26L05	3010027	5VPHB26D15	3010093	5VPHB26D55	3010145	5VPHB26D35	3010211
5VPHB26C25	3010028	5VPHB26C45	3010094	5VPHB26D75	3010146	5VPHB26D55	3010212
5VPHB26DX5	3010030	5VPHB26D55	3010095	5VPHB26D95	3010147	5VPHB26D75	3010213
5VPHB26D15	3010031	5VPHB26D75	3010096	5VPHB26D05	3010148	5VPHB26D95	3010214
5VPHB26D35	3010032	5VPHB26D95	3010097	5VPHB26D25	3010149	5VPHB26D05	3010215
5VPHB26D75	3010034	5VPHB26D05	3010098	5VPHB26D95	3010150	5VPHB26C35	3010216
5VPHB26D95	3010035	5VPHB26D25	3010099	5VPHB26C15	3010151	5VPHB26D45	3010217
5VPHB26D05	3010036	5VPHB26D55	3010100	5VPHB26C35	3010152	5VPHB26D65	3010218
5VPHB26D45	3010038	5VPHB26D75	3010101	5VPHB26D45	3010153	5VPHB26D85	3010219
5VPHB26D65	3010039	5VPHB26D95	3010102	5VPHB26D65	3010154	5VPHB26D45	3010220
5VPHB26D25	3010040	5VPHB26D05	3010103	5VPHB26D85	3010169	5VPHB26D65	3010221
5VPHB26D65	3010042	5VPHB26D25	3010104	5VPHB26D45	3010170	5VPHB26D85	3010222
5VPHB26D85	3010043	5VPHB26D45	3010105	5VPHB26D65	3010171	5VPHB26DX5	3010223
5VPHB26DX5	3010044	5VPHB26D65	3010106	5VPHB26D85	3010172	5VPHB26D15	3010224
5VPHB26D35	3010046	5VPHB26D85	3010107	5VPHB26DX5	3010173	5VPHB26D35	3010225
5VPHB26D55	3010047	5VPHB26DX5	3010108	5VPHB26D15	3010174	5VPHB26D55	3010226
5VPHB26D75	3010048	5VPHB26D15	3010109	5VPHB26D35	3010175	5VPHB26D75	3010227
5VPHB26D55	3010050	5VPHB26D85	3010110	5VPHB26L65	3010176	5VPHB26D95	3010228
5VPHB26D75	3010051	5VPHB26DX5	3010111	5VPHB26L85	3010177	5VPHB26D05	3010229
5VPHB26D95	3010052	5VPHB26C25	3010112	5VPHB26LX5	3010178	5VPHB26C85	3010230
5VPHB26D25	3010054	5VPHB26D35	3010113	5VPHB26D05	3010179	5VPHB26CX5	3010231
5VPHB26D45	3010055	5VPHB26D55	3010114	5VPHB26D95	3010181	5VPHB26C15	3010232
5VPHB26D65	3010056	5VPHB26D75	3010115	5VPHB26D25	3010183	5VPHB26C35	3010233
5VPHB26DX5	3010058	5VPHB26D95	3010116	5VPHB26D45	3010184	5VPHB26D65	3010235
5VPHB26D15	3010059	5VPHB26D05	3010117	5VPHB26D65	3010185	5VPHB26D85	3010236
5VPHB26D85	3010060	5VPHB26D25	3010118	5VPHB26D85	3010186	5VPHB26DX5	3010237
5VPHB26D15	3010062	5VPHB26D45	3010119	5VPHB26DX5	3010187	5VPHB26D15	3010238
5VPHB26D35	3010063	5VPHB26D05	3010120	5VPHB26D15	3010188	5VPHB26D35	3010239
5VPHB26D55	3010064	5VPHB26L35	3010121	5VPHB26D35	3010189	5VPHB26DX5	3010240
5VPHB26D95	3010066	5VPHB26C55	3010122	5VPHB26DX5	3010190	5VPHB26D15	3010241

The information contained within this bulletin is confidential and protected by U.S. and international copyright laws, and is the property of Polaris Industries Inc. This service bulletin is provided for the sole use of authorized Polaris dealers and distributors. This service bulletin is not to be distributed, duplicated, or copied, digitally or otherwise, without the written consent of Polaris Industries Inc.

LIST OF AFFECTED VEHICLES FOR V-05-03(A) V-05-03(A) Page 6 of 8

**Perform this bulletin on the following vehicles
(Last 6 digits of VIN are in sequential order)**

5VPHB26D35	3010242	5VPHB26D45	3010296	5VPHB26D25	3010362	5VPHB26D15	3010420
5VPHB26D55	3010243	5VPHB26D65	3010297	5VPHB26D45	3010363	5VPHB26D55	3010422
5VPHB26D75	3010244	5VPHB26D85	3010298	5VPHB26D65	3010364	5VPHB26D75	3010423
5VPHB26D95	3010245	5VPHB26DX5	3010299	5VPHB26D85	3010365	5VPHB26D95	3010424
5VPHB26D05	3010246	5VPHB26D25	3010300	5VPHB26DX5	3010366	5VPHB26D25	3010426
5VPHB26D25	3010247	5VPHB26D45	3010301	5VPHB26D15	3010367	5VPHB26D45	3010427
5VPHB26D45	3010248	5VPHB26D65	3010302	5VPHB26D35	3010368	5VPHB26D65	3010428
5VPHB26C75	3010249	5VPHB26D85	3010303	5VPHB26D55	3010369	5VPHB26D45	3010430
5VPHB26C35	3010250	5VPHB26DX5	3010304	5VPHB26D15	3010370	5VPHB26D65	3010431
5VPHB26DX5	3010254	5VPHB26D15	3010305	5VPHB26D35	3010371	5VPHB26D85	3010432
5VPHB26D15	3010255	5VPHB26D55	3010307	5VPHB26D55	3010372	5VPHB26D15	3010434
5VPHB26D35	3010256	5VPHB26D75	3010308	5VPHB26D75	3010373	5VPHB26D35	3010435
5VPHB26D55	3010257	5VPHB26D95	3010309	5VPHB26D95	3010374	5VPHB26D55	3010436
5VPHB26C85	3010258	5VPHB26D55	3010310	5VPHB26D05	3010375	5VPHB26D95	3010438
5VPHB26D95	3010259	5VPHB26D75	3010311	5VPHB26D25	3010376	5VPHB26D05	3010439
5VPHB26D55	3010260	5VPHB26D95	3010312	5VPHB26D45	3010377	5VPHB26D75	3010440
5VPHB26D75	3010261	5VPHB26D05	3010313	5VPHB26D65	3010378	5VPHB26D05	3010442
5VPHB26D95	3010262	5VPHB26D25	3010314	5VPHB26D85	3010379	5VPHB26D25	3010443
5VPHB26D05	3010263	5VPHB26D45	3010315	5VPHB26D45	3010380	5VPHB26D45	3010444
5VPHB26D25	3010264	5VPHB26D65	3010316	5VPHB26D65	3010381	5VPHB26D85	3010446
5VPHB26D45	3010265	5VPHB26D85	3010317	5VPHB26D85	3010382	5VPHB26DX5	3010447
5VPHB26D65	3010266	5VPHB26DX5	3010318	5VPHB26D15	3010384	5VPHB26D15	3010448
5VPHB26D85	3010267	5VPHB26D15	3010319	5VPHB26D35	3010385	5VPHB26DX5	3010450
5VPHB26DX5	3010268	5VPHB26D85	3010320	5VPHB26D55	3010386	5VPHB26D15	3010451
5VPHB26D15	3010269	5VPHB26DX5	3010321	5VPHB26D75	3010387	5VPHB26D35	3010452
5VPHB26D85	3010270	5VPHB26D15	3010322	5VPHB26D95	3010388	5VPHB26D75	3010454
5VPHB26DX5	3010271	5VPHB26D35	3010323	5VPHB26D05	3010389	5VPHB26D95	3010455
5VPHB26D15	3010272	5VPHB26D55	3010324	5VPHB26D75	3010390	5VPHB26D05	3010456
5VPHB26D35	3010273	5VPHB26D75	3010325	5VPHB26D95	3010391	5VPHB26D25	3010457
5VPHB26D55	3010274	5VPHB26D95	3010326	5VPHB26D05	3010392	5VPHB26D45	3010458
5VPHB26D75	3010275	5VPHB26D85	3010334	5VPHB26D25	3010393	5VPHB26D65	3010459
5VPHB26D95	3010276	5VPHB26DX5	3010335	5VPHB26D45	3010394	5VPHB26D25	3010460
5VPHB26D05	3010277	5VPHB26D15	3010336	5VPHB26D65	3010395	5VPHB26D45	3010461
5VPHB26D25	3010278	5VPHB26D35	3010337	5VPHB26D85	3010396	5VPHB26D65	3010462
5VPHB26D45	3010279	5VPHB26D55	3010338	5VPHB26DX5	3010397	5VPHB26D85	3010463
5VPHB26D05	3010280	5VPHB26D75	3010339	5VPHB26D15	3010398	5VPHB26DX5	3010464
5VPHB26D25	3010281	5VPHB26D35	3010340	5VPHB26D35	3010399	5VPHB26D55	3010470
5VPHB26D45	3010282	5VPHB26D55	3010341	5VPHB26D65	3010400	5VPHB26D75	3010471
5VPHB26D65	3010283	5VPHB26D75	3010342	5VPHB26DX5	3010402	5VPHB26D45	3010475
5VPHB26D85	3010284	5VPHB26D95	3010343	5VPHB26D15	3010403	5VPHB26D65	3010476
5VPHB26DX5	3010285	5VPHB26D05	3010344	5VPHB26D35	3010404	5VPHB26D85	3010477
5VPHB26D15	3010286	5VPHB26D25	3010345	5VPHB26D55	3010405	5VPHB26DX5	3010478
5VPHB26L45	3010287	5VPHB26D45	3010346	5VPHB26D95	3010407	5VPHB26D15	3010479
5VPHB26D55	3010288	5VPHB26D65	3010347	5VPHB26D05	3010408	5VPHB26D85	3010480
5VPHB26D75	3010289	5VPHB26D85	3010348	5VPHB26D95	3010410	5VPHB26DX5	3010481
5VPHB26D35	3010290	5VPHB26DX5	3010349	5VPHB26D05	3010411	5VPHB26D15	3010482
5VPHB26D55	3010291	5VPHB26D65	3010350	5VPHB26D65	3010414	5VPHB26D35	3010483
5VPHB26D75	3010292	5VPHB26D85	3010351	5VPHB26D85	3010415	5VPHB26C95	3010527
5VPHB26D95	3010293	5VPHB26D25	3010359	5VPHB26DX5	3010416	5VPHB26DX5	3010528
5VPHB26D05	3010294	5VPHB26D95	3010360	5VPHB26D35	3010418	5VPHB26D15	3010529
5VPHB26D25	3010295	5VPHB26D05	3010361	5VPHB26D55	3010419	5VPHB26D85	3010530

The information contained within this bulletin is confidential and protected by U.S. and international copyright laws, and is the property of Polaris Industries, Inc. This service bulletin is provided for the sole and exclusive use of the original recipient as prescribed by Polaris Industries, Inc. and may not be distributed, duplicated, or copied, digitally or otherwise, without the written consent of Polaris Industries, Inc.

LIST OF AFFECTED VEHICLES FOR V-05-03(A) V-05-03(A) Page 7 of 8

**Perform this bulletin on the following vehicles
(Last 6 digits of VIN are in sequential order)**

5VPHB26L05	3010531	5VPHB26D85	3010589	5VPHB26D65	3010641	5VPHB26D25	3010703
5VPHB26L25	3010532	5VPHB26D45	3010590	5VPHB26D85	3010642	5VPHB26L55	3010704
5VPHB26L45	3010533	5VPHB26D65	3010591	5VPHB26DX5	3010643	5VPHB26D65	3010705
5VPHB26L65	3010534	5VPHB26D85	3010592	5VPHB26D15	3010644	5VPHB26L95	3010706
5VPHB26L85	3010535	5VPHB26DX5	3010593	5VPHB26D35	3010645	5VPHB26D15	3010708
5VPHB26LX5	3010536	5VPHB26D35	3010595	5VPHB26D55	3010646	5VPHB26D35	3010709
5VPHB26L15	3010537	5VPHB26D55	3010596	5VPHB26D75	3010647	5VPHB26D15	3010711
5VPHB26L35	3010538	5VPHB26D75	3010597	5VPHB26D95	3010648	5VPHB26D75	3010714
5VPHB26L55	3010539	5VPHB26D95	3010598	5VPHB26L15	3010649	5VPHB26D95	3010715
5VPHB26L15	3010540	5VPHB26D05	3010599	5VPHB26L85	3010650	5VPHB26D05	3010716
5VPHB26L35	3010541	5VPHB26D35	3010600	5VPHB26LX5	3010651	5VPHB26D25	3010717
5VPHB26L55	3010542	5VPHB26D55	3010601	5VPHB26L15	3010652	5VPHB26D85	3010723
5VPHB26L75	3010543	5VPHB26D75	3010602	5VPHB26L35	3010653	5VPHB26L05	3010724
5VPHB26L95	3010544	5VPHB26D95	3010603	5VPHB26L55	3010654	5VPHB26D15	3010725
5VPHB26L05	3010545	5VPHB26D05	3010604	5VPHB26L75	3010655	5VPHB26L45	3010726
5VPHB26L25	3010546	5VPHB26D25	3010605	5VPHB26L95	3010656	5VPHB26D55	3010727
5VPHB26D35	3010547	5VPHB26D45	3010606	5VPHB26L05	3010657	5VPHB26L85	3010728
5VPHB26D55	3010548	5VPHB26D65	3010607	5VPHB26L25	3010658	5VPHB26D95	3010729
5VPHB26D35	3010550	5VPHB26D85	3010608	5VPHB26L45	3010659	5VPHB26D55	3010730
5VPHB26D55	3010551	5VPHB26DX5	3010609	5VPHB26L05	3010660	5VPHB26D75	3010731
5VPHB26D75	3010552	5VPHB26D65	3010610	5VPHB26L25	3010661	5VPHB26D95	3010732
5VPHB26D95	3010553	5VPHB26D85	3010611	5VPHB26L45	3010662	5VPHB26L15	3010733
5VPHB26D05	3010554	5VPHB26DX5	3010612	5VPHB26L65	3010663	5VPHB26D25	3010734
5VPHB26D25	3010555	5VPHB26D15	3010613	5VPHB26L85	3010664	5VPHB26L55	3010735
5VPHB26D45	3010556	5VPHB26D35	3010614	5VPHB26LX5	3010665	5VPHB26D65	3010736
5VPHB26D65	3010557	5VPHB26D55	3010615	5VPHB26D05	3010666	5VPHB26L95	3010737
5VPHB26D85	3010558	5VPHB26D75	3010616	5VPHB26D25	3010667	5VPHB26DX5	3010738
5VPHB26DX5	3010559	5VPHB26D95	3010617	5VPHB26D45	3010668	5VPHB26L25	3010739
5VPHB26D65	3010560	5VPHB26D05	3010618	5VPHB26D65	3010669	5VPHB26D85	3010740
5VPHB26D85	3010561	5VPHB26D25	3010619	5VPHB26D25	3010670	5VPHB26D55	3010761
5VPHB26DX5	3010562	5VPHB26D95	3010620	5VPHB26D45	3010671	5VPHB26D75	3010762
5VPHB26D15	3010563	5VPHB26D05	3010621	5VPHB26D65	3010672	5VPHB26D95	3010763
5VPHB26D35	3010564	5VPHB26D25	3010622	5VPHB26D85	3010673	5VPHB26D05	3010764
5VPHB26D55	3010565	5VPHB26D45	3010623	5VPHB26DX5	3010674	5VPHB26D25	3010765
5VPHB26D75	3010566	5VPHB26D65	3010624	5VPHB26D35	3010676	5VPHB26D45	3010766
5VPHB26D95	3010567	5VPHB26D85	3010625	5VPHB26D55	3010677	5VPHB26D65	3010767
5VPHB26D05	3010568	5VPHB26DX5	3010626	5VPHB26D75	3010678	5VPHB26DX5	3010769
5VPHB26D25	3010569	5VPHB26D15	3010627	5VPHB26D95	3010679	5VPHB26D65	3010770
5VPHB26D95	3010570	5VPHB26D35	3010628	5VPHB26D95	3010682	5VPHB26D85	3010771
5VPHB26D05	3010571	5VPHB26D55	3010629	5VPHB26D05	3010683	5VPHB26DX5	3010772
5VPHB26D25	3010572	5VPHB26D15	3010630	5VPHB26L35	3010684	5VPHB26D15	3010773
5VPHB26D45	3010573	5VPHB26D35	3010631	5VPHB26L55	3010685	5VPHB26D35	3010774
5VPHB26D65	3010574	5VPHB26D55	3010632	5VPHB26L75	3010686	5VPHB26D55	3010775
5VPHB26D85	3010575	5VPHB26D75	3010633	5VPHB26L95	3010687	5VPHB26D75	3010776
5VPHB26D55	3010582	5VPHB26D95	3010634	5VPHB26L05	3010688	5VPHB26D95	3010777
5VPHB26D75	3010583	5VPHB26D05	3010635	5VPHB26L25	3010689	5VPHB26D05	3010778
5VPHB26D95	3010584	5VPHB26D25	3010636	5VPHB26L95	3010690	5VPHB26D25	3010779
5VPHB26D05	3010585	5VPHB26D45	3010637	5VPHB26L25	3010692	5VPHB26D95	3010780
5VPHB26D25	3010586	5VPHB26D65	3010638	5VPHB26L65	3010694	5VPHB26D05	3010781
5VPHB26D45	3010587	5VPHB26D85	3010639	5VPHB26L35	3010698	5VPHB26D25	3010782
5VPHB26D65	3010588	5VPHB26D45	3010640	5VPHB26L15	3010702	5VPHB26D45	3010783

The information contained within this bulletin is confidential and protected by U.S. and international copyright laws, and is the property of Polaris Industries Inc. This service bulletin is provided for the sole use of authorized Polaris dealers and distributors. This service bulletin is not to be distributed, duplicated, or copied, digitally or otherwise, without the written consent of Polaris Industries Inc.

LIST OF AFFECTED VEHICLES FOR V-05-03(A)

**Perform this bulletin on the following vehicles
(Last 6 digits of VIN are in sequential order)**

5VPHB26D65 3010784	5VPHB26D05 3010859	5VPHB26D55 3010937	5VPHB26D65 3011045
5VPHB26DX5 3010786	5VPHB26D95 3010861	5VPHB26D75 3010938	5VPHB26D15 3011051
5VPHB26C25 3010787	5VPHB26D05 3010862	5VPHB26D55 3010940	5VPHB26D25 3011172
5VPHB26C45 3010788	5VPHB26D25 3010863	5VPHB26D25 3010961	5VPHB26D35 3011276
5VPHB26C65 3010789	5VPHB26D45 3010864	5VPHB26D45 3010962	5VPHB26D55 3011277
5VPHB26C25 3010790	5VPHB26D65 3010865	5VPHB26D85 3010964	5VPHB26D75 3011278
5VPHB26C45 3010791	5VPHB26D85 3010866	5VPHB26DX5 3010965	5VPHB26D45 3011304
5VPHB26C65 3010792	5VPHB26DX5 3010867	5VPHB26D15 3010966	
5VPHB26C85 3010793	5VPHB26D15 3010868	5VPHB26D55 3010968	
5VPHB26CX5 3010794	5VPHB26D35 3010869	5VPHB26D75 3010969	
5VPHB26C15 3010795	5VPHB26D05 3010876	5VPHB26D35 3010970	
5VPHB26C35 3010796	5VPHB26D45 3010878	5VPHB26D75 3010972	
5VPHB26C55 3010797	5VPHB26D65 3010879	5VPHB26D95 3010973	
5VPHB26C75 3010798	5VPHB26U25 3010880	5VPHB26D05 3010974	
5VPHB26C95 3010799	5VPHB26U45 3010881	5VPHB26D45 3010976	
5VPHB26C15 3010800	5VPHB26U65 3010882	5VPHB26D65 3010977	
5VPHB26C35 3010801	5VPHB26U85 3010883	5VPHB26D85 3010978	
5VPHB26C75 3010803	5VPHB26DX5 3010884	5VPHB26D65 3010980	
5VPHB26C95 3010804	5VPHB26D15 3010885	5VPHB26D85 3010981	
5VPHB26D35 3010810	5VPHB26D35 3010886	5VPHB26DX5 3010982	
5VPHB26D55 3010811	5VPHB26C65 3010890	5VPHB26D35 3010984	
5VPHB26D75 3010812	5VPHB26CX5 3010892	5VPHB26D55 3010985	
5VPHB26D95 3010813	5VPHB26C55 3010895	5VPHB26D75 3010986	
5VPHB26D05 3010814	5VPHB26C75 3010896	5VPHB26D05 3010988	
5VPHB26D25 3010815	5VPHB26C95 3010897	5VPHB26D95 3010990	
5VPHB26D45 3010816	5VPHB26C05 3010898	5VPHB26D25 3010992	
5VPHB26D65 3010817	5VPHB26C25 3010899	5VPHB26D45 3010993	
5VPHB26D85 3010818	5VPHB26C55 3010900	5VPHB26DX5 3011002	
5VPHB26D65 3010820	5VPHB26D65 3010901	5VPHB26D55 3011005	
5VPHB26D85 3010821	5VPHB26D85 3010902	5VPHB26D95 3011007	
5VPHB26C05 3010822	5VPHB26DX5 3010903	5VPHB26D05 3011008	
5VPHB26C25 3010823	5VPHB26D15 3010904	5VPHB26D25 3011009	
5VPHB26C65 3010825	5VPHB26D35 3010905	5VPHB26D95 3011010	
5VPHB26U65 3010834	5VPHB26D55 3010906	5VPHB26D05 3011011	
5VPHB26U85 3010835	5VPHB26C85 3010907	5VPHB26D15 3011017	
5VPHB26UX5 3010836	5VPHB26CX5 3010908	5VPHB26D35 3011018	
5VPHB26U15 3010837	5VPHB26D15 3010918	5VPHB26D55 3011019	
5VPHB26U35 3010838	5VPHB26D35 3010919	5VPHB26D15 3011020	
5VPHB26D15 3010840	5VPHB26DX5 3010920	5VPHB26D45 3011030	
5VPHB26D35 3010841	5VPHB26D35 3010922	5VPHB26D65 3011031	
5VPHB26D55 3010842	5VPHB26D55 3010923	5VPHB26D85 3011032	
5VPHB26D85 3010849	5VPHB26D75 3010924	5VPHB26D15 3011034	
5VPHB26D45 3010850	5VPHB26D95 3010925	5VPHB26D35 3011035	
5VPHB26D65 3010851	5VPHB26D05 3010926	5VPHB26D55 3011036	
5VPHB26D85 3010852	5VPHB26D45 3010928	5VPHB26D75 3011037	
5VPHB26DX5 3010853	5VPHB26D65 3010929	5VPHB26D95 3011038	
5VPHB26D15 3010854	5VPHB26D25 3010930	5VPHB26D05 3011039	
5VPHB26D35 3010855	5VPHB26D65 3010932	5VPHB26D75 3011040	
5VPHB26D55 3010856	5VPHB26D85 3010933	5VPHB26D95 3011041	
5VPHB26D75 3010857	5VPHB26DX5 3010934	5VPHB26D05 3011042	
5VPHB26D95 3010858	5VPHB26D35 3010936	5VPHB26D45 3011044	

The information contained within this bulletin is confidential and protected by U.S. and international copyright laws, and is the property of Polaris Industries, Inc. This service bulletin is provided for the sole and exclusive use of the original recipient as prescribed by Polaris Industries, Inc. and may not be distributed, duplicated, or copied, digitally or otherwise, without the written consent of Polaris Industries, Inc.

This page left intentionally blank.