



TECHNICAL BULLETIN

No: RB021
Issue: 1
Date: 03 Feb 2006

CIRCULATE: TO

Service Mgr
X

Warranty
X

Workshop
X

Body Shop
X

Parts
X

SECTION: 501-20A

RECALL: Second Row Seat Belt Buckle Inspection

AFFECTED VEHICLE RANGE:

Range Rover Sport (LS)

VIN: Specific Vehicles ONLY

VIN	Retailer
6A911094	253
6A919673	187
6A919699	285

CONDITION SUMMARY:

INSPECT AND IF INDICATED REPLACE THE LEFT HAND SECOND ROW SEAT BELT BUCKLE

Situation: Land Rover has decided that a condition that impacts occupant safety can exist in some specific Range Rover Sport vehicles. The affected vehicles may have been manufactured with a left hand second row rear seat belt buckle that does not meet engineering specification.



NOTE: Many vehicles have been repaired by Land Rover at the factory and at the Ports. Verify using DDW that the vehicle subject to this Recall action prior to making any repairs.

Action: Inspect the left hand second row seat belt buckle and replace it if indicated by the inspection process. Refer to the Repair Procedure section of this bulletin.

PARTS:

EVL500750PMALeft Hand Second Row Seat Belt Buckle Qty 1

NOTE: The information in Technical Information bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers."
If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether the bulletin applies to a specific vehicle.



TECHNICAL BULLETIN

No: RB021
Issue: 1

WARRANTY:



NOTE: Always refer to DDW to verify vehicle eligibility for this Service Campaign and to determine if the vehicle is affected by any other Service Actions.

Warranty claims should be submitted quoting program code **B021** together with the appropriate option code. As option codes are used, there is no requirement to enter parts or labor. They are provided for information only.

Drive in/drive out can only be claimed if the vehicle is brought back into the workshop for this action alone to be undertaken.

Program Code	Option	Job Description	SRO	Time (Hours)	Part Number	Part Description	QTY	Misc Expense
B021	A	Inspect left hand second row seat belt buckle	76.73.60	0.1	N/A	N/A	N/A	N/A
B021	K	Inspect left hand second row seat belt buckle	76.73.60	0.1	N/A	N/A	N/A	N/A
		Drive in/Drive out	02.02.02	0.2				
B021	B	Replace Left Hand Second Row Seat Belt Buckle	76.73.60	0.1	EVL500750PMA	Seat Belt Buckle	1	
B021	C	Replace Left Hand Second Row Seat Belt Buckle	76.73.60	0.1	EVL500750PMA	Seat Belt Buckle	1	
		Drive in/drive out	02.02.02	0.2				

Normal warranty policy and procedures apply.



REPAIR PROCEDURE

INSPECT AND IF INDICATED REPLACE SEAT BELT LATCH

1. Open left hand rear door.
2. Identify the left hand rear second row seat belt buckle. (Circled in Figure 1)
3. Fold the seat cushion forward
4. Inspect the serial number stamped on the buckle. (Figure 2)
5. Determine if the serial number is either "05 02 02" or "05 03 02."
6. If the serial number is **any other than** 05 02 02 or 05 03 02, no further action is required.



NOTE: GTR lookup sequence is as follows:
GTR Home > NAS > Service Information/ LS Range Rover Sport/2006 > Workshop Manuals > Range Rover Sport 2005 Workshop Manual > Body and Paint/Body and Paint > Bookmark "501-20A Safety Belt System" > Link "Rear Safety Belt Buckle LH - Vehicles With: 60/40 Split Seat (76.73.60) "

7. If the serial number is 05 02 02 or 05 03 02, refer to GTR Section 76.73.60 and replace the seat belt buckle with a new component (EVL500750PMA). (Figure 3)
8. Return the seat cushion to its normal position.
9. Close the left hand rear door.

