



903 South Main Street • P.O. Box 460 • Middlebury, IN 46540 • (574) 825-0608 • Fax (574) 825-0572

January 23, 2006

VEHICLE SAFETY DEFECT SERVICE BULLETIN
NHTSA Recall Campaign #05V-556

Dear Jayco Dealer

Jayco, Inc. has found that there was an error on six –(6) serial number ranges on our header page for the instruction sheet. The models are 2004 MU, RZ, UA, UG, UM, and UU. Attached is the revised header page and instructions for your records.

Please contact Jayco with any questions you may have about this error. You can contact us at 574-825-0608 or e-mail us at service@jayco.com. Please ask for the Technical Research Department.

We apologize for this inconvenience. However, we have taken this action in the interest of your safety and continued satisfaction with our customers.

Sincerely,

Jayco, Inc.
After Market Services



RECALL CAMPAIGN

05V-556

Requires inspection before ordering parts.

Subject:	Hitch reinforcing plates missing from installation	
Units Affected:	2004 - 2005 Ambient, Escapade, Greyhawk & Granite Ridge Motorhomes	
	• 2004 Ambient › 46M10050 – 0097 › 46M20051 – 0057 › 46M30051 – 0059 › 46M40051 – 0058 › 46M50051 – 0071	• 2005 Ambient › 56M10051 – 0064 › 51M10065 – 0067 › 56M20051 – 0055 › 56M30051 – 0055 › 56M50051 – 0055 › 51M50056
	• 2004 Greyhawk › 46MA0051 – 0105 › 46MB0050 – 0120 › 46ME0051 – 0080, 0082 – 0146 › 46MG0051 – 0056 › 46MH0051 – 0054 › 46MJ0050 – 0246 › 46MP0051 – 0128 › 46MS0052 – 0082 › 46MU0051 – 0063 › 46MV0051 – 0156 › 46MY0051 – 0167	• 2005 Greyhawk › 56MA0051 – 0060 › 51MA0061 – 0074 › 56MB0051 – 0063 › 51MB0064 – 0075 › 56ME0051 – 0072 › 51ME0073 – 0085 › 56MJ0051 – 0118 › 51MJ0119 – 0150 › 56MP0051 – 0066 › 56MV0051 – 0068 › 51MV0069 – 0082 › 56MY0051 – 0052, 0054 – 0063, 0065 – 0072 › 51MY0073 – 0092
	• 2004 Granite Ridge › 46RB0051 – 0122 › 46RJ0052 – 0312 › 46RV0051 – 0111 › 46RZ0129 – 0155 › 46TC0051 – 0060	• 2005 Granite Ridge › 56RB0051 – 0060 › 51RB0061 – 0072 › 56RJ0051 – 0116 › 51RJ0117 – 0140
	• 2004 Escapade › 46UA0051 – 0095 › 46UG0051 – 0105 › 46UM0051 – 0069 › 46UU0051 – 0081	• 2005 Escapade › 56UA0051 – 0060, 0062 – 0068 › 51UA0069 – 0070 › 56UG0051 – 0070 › 51UG0071 – 0081 › 56UM0051 – 0082 › 56UU0051

Action Required:	Inspection and replacement of hitch installation hardware.
Job Operation Code:	9901064 N NOTE: Please provide complete repair description when filing claim.
Series Code:	RC005 INSPECT ONLY RC013 INSPECT AND REPAIR (Includes hitch replacement, if applicable)
Flat Rate Time:	RC005 0.1 Hrs. RC013 1.0 Hrs (Includes Inspection Time) (Authorization Required for hitch replacement)
Kit Part Number:	0700021
Parts Kit Includes:	1 - Instruction Sheet 1 - Carriage Bolt Kit
Tools Required:	• 1/2" drive 3/4" socket • 1/2" torque wrench

Instructions

(N) NOTE: Check to ensure that your trailer hitch is labeled with part number 64-6004, and the weight rating is 5,000#/500# weight carry. If your hitch is rated differently, or is not part number 64-6004, it is not covered by this campaign.

1. Inspect the mounting hardware that mounts the hitch to the frame rail. Each 1/2" carriage bolt needs to have a 3-1/4" x 1" x 1/4" top plate and a 2" x 1-3/16" x 5/32" bottom plate.
(Fig. 1)
2. If all eight (8) plates are not there, proceed to the following steps. If all the plates are there, complete the warranty claim for inspection time. (Fig. 2)
3. Inspect the top flange on the hitch. If there is any distortion around the hole or the top flange is bent, contact your Jayco customer service department for authorization and hitch replacement.
4. Remove each 1/2" carriage bolt one at a time and replace the hardware as shown.
5. Repeat for all three (3) bolts.
6. Torque all 1/2" carriage bolts to the specified range as listed on the installation instructions for the hitch attached.

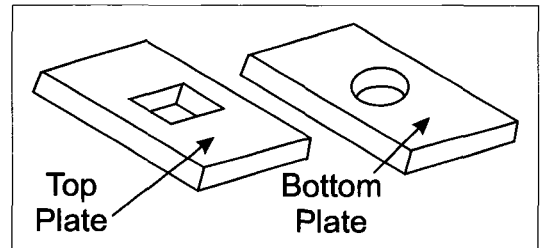


Fig. 1


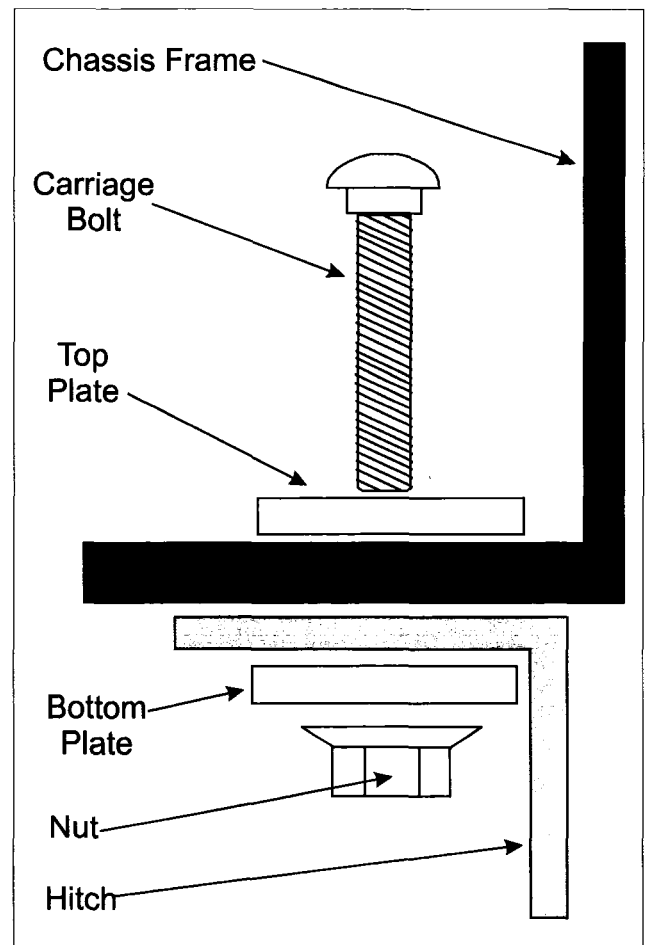


Fig. 2

HIDDEN HITCH®

64-6004

MAKE / MODEL(S):
VARIOUS

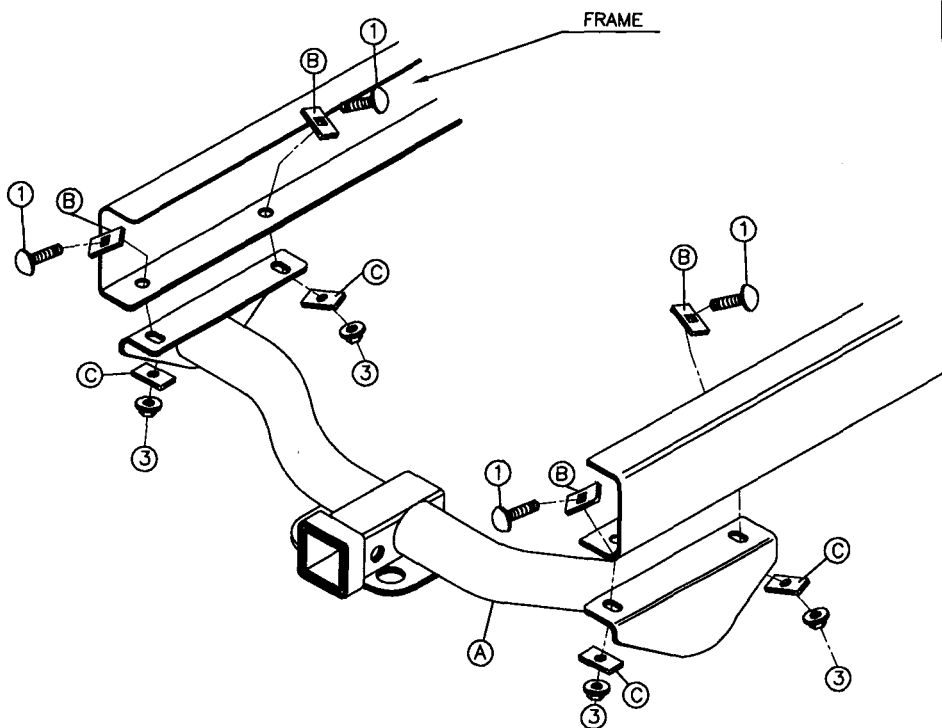

PARTS IDENTIFICATION / IDENTIFICATION DES PIÈCES (HARDWARE KIT NO. KA-8002-180)

A) Receiver Assembly		1)	Carriage Bolt	1/2" x - 2"	(4)
B) Reinforcing Plate – Sq. Hole	(4)	2)	Flange Nut	1/2"	(4)
C) Reinforcing Plate – Rd. Hole	(4)				

TOOLS REQUIRED: 3/4" socket, ratchet or impact gun to suit, 100 FT/LB torque wrench

INSTRUCTIONS:

1. Loosely attach hitch assembly (A) to the frame as shown above.
2. Tighten all bolts; refer to torque table on the instruction sheet.

MAX TRAILER WEIGHT/POIDS MAX DE LA REMORQUE 7500lbs

MAX TONGUE WEIGHT/POIDS MAX DU TIMON 750lbs

Bolt Size Grandeur des boulons	Grade 5 Torque Dynamométrique	Metric / Métrique	Grade 8.8 Torque
3/8	30 Ft. Lb.	8 mm	18 Ft. Lb.
7/16	54 Ft. Lb.	10 mm	36 Ft. Lb.
1/2	88 Ft. Lb.	12 mm	64 Ft. Lb.
5/8	150 Ft. Lb.	14 mm	103 Ft. Lb.
3/4	245 Ft. Lb.		

Warning: This hitch is designed to safely carry the loads specified. Under no circumstances do we recommend exceeding the towing vehicle manufacturer's recommended vehicle towing capacities.

Avertissement: Cet attelage a été créé pour porter sans danger les charges prévues. En aucun cas vous ne devez dépasser les normes de capacités de remorquage établies par le fabricant de votre véhicule.

**Jayco Service / Parts
Recall Order Form
Fax (877) 222-1234**



**2004 & 2005
Motorhome Hitch
Reinforcing Plate
Recall #05V-556 / 9901064**

Dealer Name:	Recall Account: 2292000	Date:
Dealer Account Number:	Phone:	Fax:
Ship To:	P.O. #:	
	Date Shipped	
Attn:	Ship Via	

120504&05MotorhomeHitchReinforcingPlate.cdr

**Each unit's serial number MUST be recorded
when ordering this recall kit.**

Quantity Ordered	Quantity Shipped	Serial Number of Unit (Last 8 Digits)	Part Number	U/M	Unit Price
1			0700021	EA	N/C
1			0700021	EA	N/C
1			0700021	EA	N/C
1			0700021	EA	N/C
1			0700021	EA	N/C
1			0700021	EA	N/C
1			0700021	EA	N/C
1			0700021	EA	N/C
1			0700021	EA	N/C

**THESE PARTS CAN ONLY BE
ORDERED USING THIS FORM.
YOU CAN NOT ORDER THIS THROUGH EMPART.**