

Federal Recall Information

RECEIVED

2006 FEB 16 A 11:20

106-A

Supplier

Peterbilt

Description

Recall for Trailer Antilock Brake System (ABS) Dash Indicator Light

Release Date

2/6/06

Introduction

Recall 106-A Indicator Light for Trailer Antilock Braking System (ABS)

Peterbilt Motors Company has decided that some Model 335 Peterbilt vehicles manufactured between September 30, 2005 and December 9, 2005 fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) No. 121 S5.1.6.2(b) Air Brake Systems. The trailer ABS warning indicator was not installed.

Situation

The trailer antilock braking system (ABS) indicator light, located in the warning light bar of the vehicle cab, notifies the driver of a malfunction. It has been determined that the light for this indicator was not installed in some vehicles. Without the light, the driver may not be aware of a malfunction in the trailer ABS system.

On trailers manufactured on or after March 1, 1998, the operator may verify trailer ABS system status via the required external warning lamp mounted on the trailer. The indicator lamp on the trailer should be yellow and identified with the letters "ABS".

Resolution

Peterbilt has initiated a recall to inspect and, when necessary, install the dash mounted warning indicator light for the trailer ABS System. Customer letters will be mailed out on the week of February 6, 2006.

It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.

Warranty

The DWC system will indicate chassis involved in this recall with the designator of "106-A" in the campaign field.

Enter a standard warranty claim using the following codes:

Failure location	013-011-079 Indicator Lamp - ABS error
Failure type	705 Federal Recall
Claim type	C
Campaign Number	106-A

Parts

Peterbilt will cover parts purchased through Paccar Parts (dealer net + 30% parts mark up) according to the schedule below.

PARTS			
Qty	Part Number	Description	DealerNet (USD)
1	0822680180001	SOCKET	1.11 ea
1	73BULB	LAMP	0.37 ea
1	16-05936-033	LABEL,Trailer ABS Warning	6.17 ea

Labor

Peterbilt will cover labor according to the schedule below.

Labor		
013-XXX	0.2 hr	INSPECTION ONLY
013-XXX	0.3 hr	INSPECT AND REPLACE

Procedure



106A Procedure

Shipping

Freight

Contact

Please contact Peterbilt Motors for any questions: 940-591-4196

Attachments



106A US Customer Letter



106A US Chassis List


© Copyright 2006 PACCAR Inc. All Rights Reserved.

INSPECT


Cycle the key switch to verify that the trailer ABS light operates correctly. Proceed with replacement procedure if the light does not operate.

REPLACE


1. Remove the 4 screws holding the light bar to the dash panel

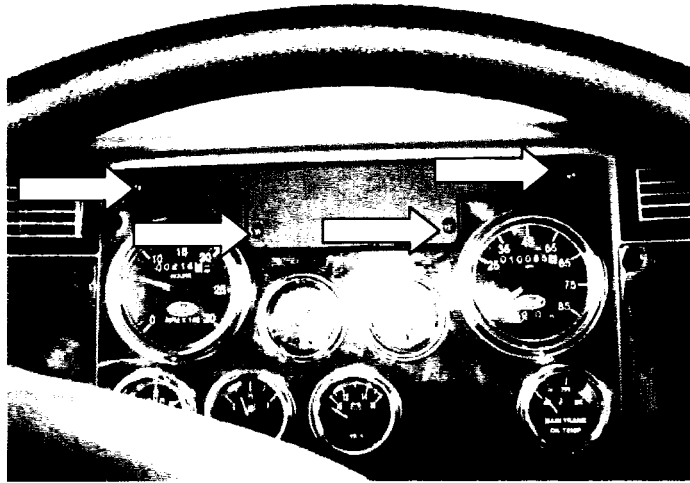


2. Remove Lens cover
3. Check for Trailer ABS Light in Location 2. If present, proceed directly to step 7.
4. If bulb is not present, remove light bar from dash.

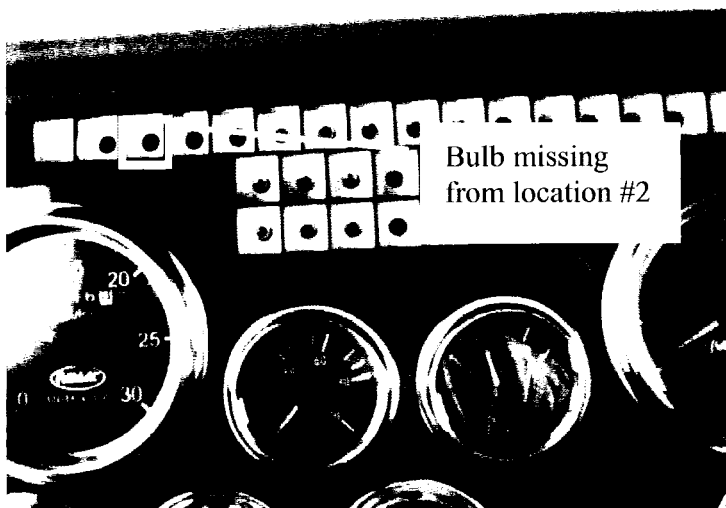


5. Remove plastic tab on the back side of the list bar with a flat head screwdriver on lamp # LP2

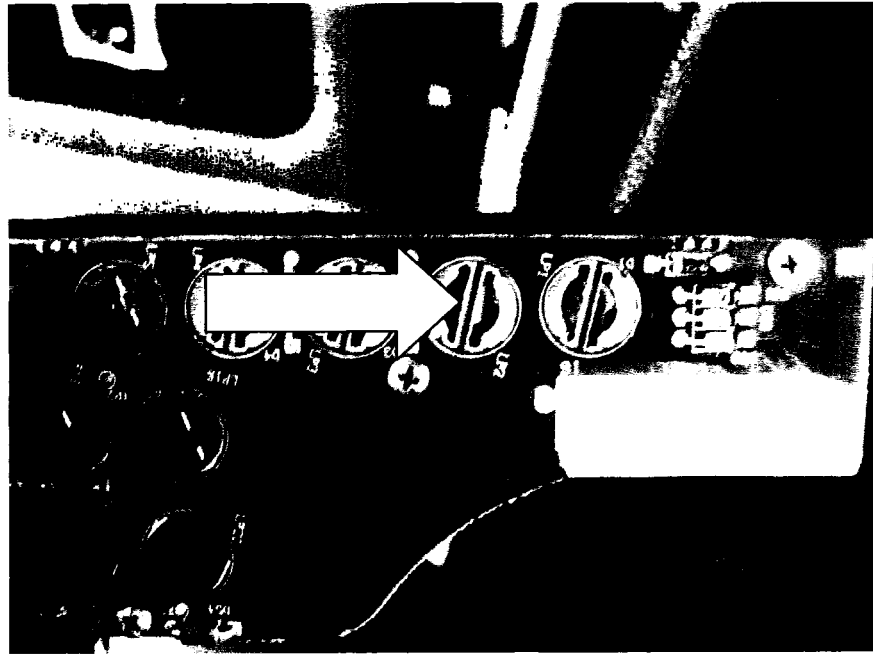

6. Insert bulb and socket

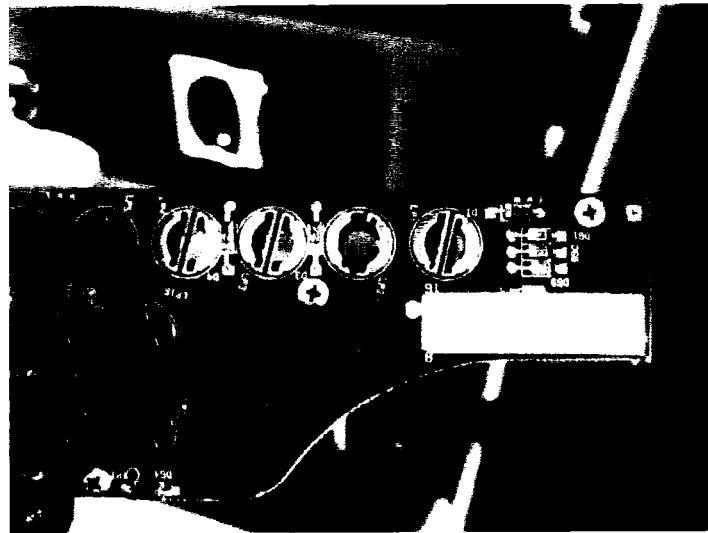

7. Install the warning label in the correct location on the reverse side of the lens.

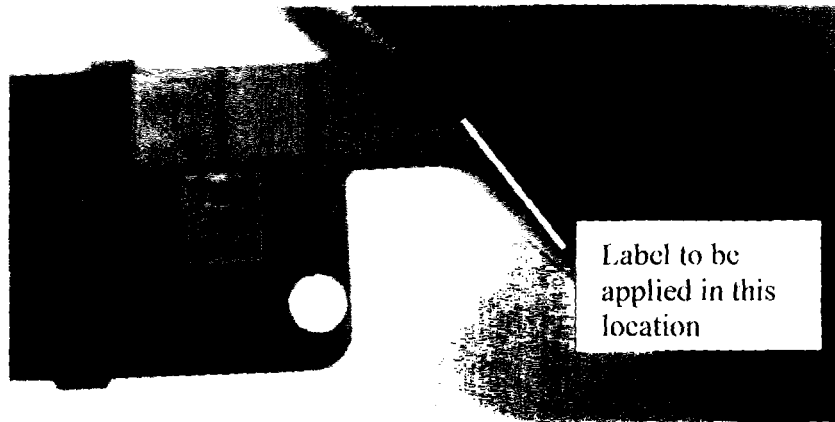

8. Install lens to the light bar and reassemble dash.
9. Cycle the key switch to verify that the trailer ABS light operates correctly