



Fleetwood Enterprises, Inc.
3051 Myers Street / Riverside, CA 92503-5527
P.O. Box 7638 / Riverside, CA 92513-7638
p: 800.322.8216 / www.fleetwood.com

IMPORTANT RECALL INFORMATION #60220
March 2006

**TO: ALL FLEETWOOD DEALER PRINCIPALS
SERVICE MANAGERS
PARTS MANAGERS**

SUBJECT: RECALL CAMPAIGN #60220 - KWIKEE STEP

Fleetwood Enterprises, Inc., on behalf of its subsidiary manufacturing centers located in Decatur, Indiana; Paxinos, Pennsylvania and Riverside, California is requesting your assistance in conducting a voluntary recall notification campaign in accordance with the National Highway Traffic and Motor Vehicle Safety Act.

Fleetwood Enterprises, Inc. has decided that a defect which relates to motor vehicle safety exists in certain 2006 model year Bounder Diesel, Excursion, Expedition, Providence, Discovery, Revolution LE, Pace Arrow, Southwind, Bounder, Flair, Storm, Terra, Fiesta, Tioga and Jamboree model motor homes.

We are notifying the owners of the affected units in order to correct the problem. A copy of the letter sent to owners is enclosed for your information.

WHAT IS THE PROBLEM?

On motor homes affected by this recall, the Kwikkee brand electric entry step, built with a control unit manufactured by American Technologies Corporation may develop an electrical short during cold weather, (temperatures below 10 degrees Fahrenheit), causing the plastic case to ignite, making the step inoperable and possibly resulting in risk of personal injury, vehicle and/or other property damage.

To correct this safety defect, it is necessary to inspect and if necessary replace the American Technologies Corporation control unit as described in the enclosed Recall Service Bulletin #60220.

WHAT SHOULD YOU DO?

Please check your motor home inventory and perform the repair procedure on affected units as described in the attached Recall Service Bulletin #60220. It is imperative that this procedure be completed prior to the sale of the affected units so your customers will not be inconvenienced.

Owners of the above mentioned motor homes have been asked to contact their Fleetwood dealer to have the described defective condition remedied. In the event that a customer contacts you, please verify eligibility by referring to the serial number range listed in the enclosed Recall Service Bulletin #60220 prior to beginning the inspection and repairs.

Should a customer have you perform this service, please complete the Fleetwood Repair Order (form X-SR-042). Once the inspection and repairs are completed, have the customer sign the Fleetwood Repair Order and return it to your National Warranty Processing Center in Decatur, Indiana for payment. You will be reimbursed in accordance with Service Bulletin #60220. Customers will not be charged for these repairs.

If the owner of a motor home contacts you with questions concerning this topic, please ask them to contact:

FLEETWOOD OWNER RELATIONS - RECALL #60220
800-509-3418

If you have one of these vehicles in your inventory, you will be mailed a Safety Recall Notice for that specific motor home. Fleetwood is asking our dealers to make repairs to stock units on dealer lots prior to sale or lease.

Federal Law (Section 154 of the National Highway Traffic and Motor Vehicle Safety Act of 1966) requires that:

If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

Please review this entire package with your parts and service staff to familiarize them with the step-by-step procedure and implement the Voluntary Safety Recall Campaign.

Thank you for helping Fleetwood with its continuing efforts to maintain customer satisfaction. If you have any questions, please contact your regional Fleetwood Service Center.

Sincerely,

FLEETWOOD ENTERPRISES, INC.



Tina Inkrote
Service Coordinator
Recreational Vehicle Group

Enclosures: Recall #60220 Customer Letter
Recall #60220 Service Bulletin

Recall Bulletin 60220



RECALL BULLETIN:
60220

YEAR(S) AFFECTED:
2006

PRODUCT(S) AFFECTED:
All Class "A" and Class "C" Motor Homes with Serial Numbers Listed in This Bulletin

MODEL(S) AFFECTED:
All

SUBJECT:
Inspection and Correction of Entry Step Controller

KEYWORDS:
Step, Entry Step, Kwikkee, Controller

ISSUE DATE:
March 2006

The purpose of this Bulletin is to inform Fleetwood dealers about an entry step inspection with possible controller replacement. This will assure proper electrical operation of the entry step.

Note: Read this entire document before starting repairs.

CONDITION:

The entry step electrical circuitry may fail in cold temperatures, preventing the step from properly functioning.

INSPECTION:

1. Park the motor home on a smooth flat surface. Put the transmission into PARK. Set the parking brake. Turn the ignition off and remove the key from the ignition switch.
2. Open the entry door to extend the electrically powered entry step. Turn off the step switch, located near the entrance, in order to keep the entry step extended.

Verify the step remains in the extended position by opening and closing the entry door.

⚠ SAFETY NOTE

In the interest of safety we suggest you remove the ignition key and attach a notice to the ignition switch in order to prevent a third party from powering up the system on which you are working.

⚠ WARNING

THE ENTRY STEP MAY CLOSE UNEXPECTEDLY. DO NOT REACH INTO AN OPEN STEP OR ATTEMPT TO MAKE REPAIRS WHILE POWER IS TURNED ON.

3. Examine the label on the step controller unit, mounted to the step frame.
 - A) If the motor home is equipped with a step controller displaying a date code ending in "a", as shown in Figure 1, a new Step Controller with Diode Harness (Kit Part #478178) must be installed. Proceed with the Repair Preparations section of this Bulletin, Step 4.

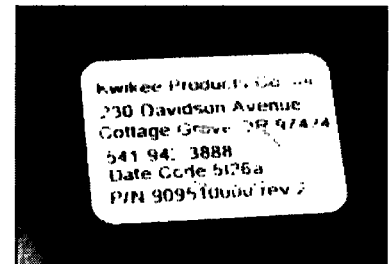


Figure 1
Affected Controller
(Requires Replacement)

© 2006 Fleetwood Enterprises, Inc.

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that: If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the NHTSA within ten days.

It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods.

- B) If the motor home is equipped with a correct step controller as shown in Figure 2 (with date code **not** ending in “a”), no further repairs are necessary for this Recall.

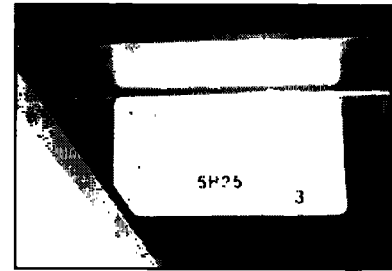


Figure 2
Correct Controller
(No repair necessary)

REPAIR PREPARATIONS:

4. Make sure the entry step is fully extended in the open position.
5. Unplug the motor home from shore power. Turn off the generator and disable Auto-Gen-Start capabilities.

⚠ WARNING

REMOVE JEWELRY BEFORE WORKING ON BATTERIES. BATTERIES CONTAIN ACID AND EXPLOSIVE GASES; USE EXTREME CARE WHEN WORKING ON BATTERIES. DO NOT SMOKE OR HAVE OPEN FLAMES. AVOID CREATING SPARKS AROUND WET CELL BATTERIES.

6. Disconnect the Negative (-) Battery Cable from the Chassis Battery. If the unit is a diesel powered motor home and equipped with two 12 Volt Chassis Batteries wired in parallel, disconnect the Negative (-) Battery Cable from the Chassis (Main) Battery post that has the cable connected to the motor home frame.

NOTE: Dash radio station presets and clock settings will be lost when power is interrupted from the Chassis Battery to the radio memory circuit.

STEP CONTROLLER REPLACEMENT:

Follow the procedure below for motor homes equipped with a step controller displaying a date code ending in “a”, as shown in Figure 1.

7. Unplug the 4-wire step controller plug from the Fleetwood harness.
8. Unplug the 2-wire step controller plug for the step motor.
9. Unplug the purple wire from the porch light circuit.
10. Unplug the black wire from the under-step light circuit.
11. Remove the ground screw and star washer from the step frame. Retain the ground screw for later reinstallation. Discard the old star washer.
12. Remove the ground bolt at the motor home frame rail. Retain all grounding hardware for later reinstallation.

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that: If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods.

- Note the orientation of the step controller on the step frame. Remove the step controller. Retain the original mounting screws for installation of the new step controller.

NOTE: The old step controller must be returned to Fleetwood when filing the warranty claim.

- Install the new step controller in the same orientation on the step frame as the original step controller, using the mounting screws saved in Step 13.
- Clean the two ground wire attachment locations, making sure rust and corrosion have been removed.
- Connect the short ground wire to the step frame using the original ground screw. Make sure the included star washer is positioned between the ring terminal and the step frame.
- Connect the long ground wire to the motor home chassis frame using the original hardware removed in Step 12.
- Connect the two-wire harness to the step motor.
- Connect the four-wire harness to the Fleetwood harness.

- Install a Diode Harness by performing the following: (See Figure 3)

- Connect the wire from the under-step light to the mating connector on one of the diode harness black wires.
- Connect the black wire from the Step Controller to the mating connector on the remaining black diode harness wire.
- Plug the moisture resistant connector on the diode harness purple wire into the porch light circuit.

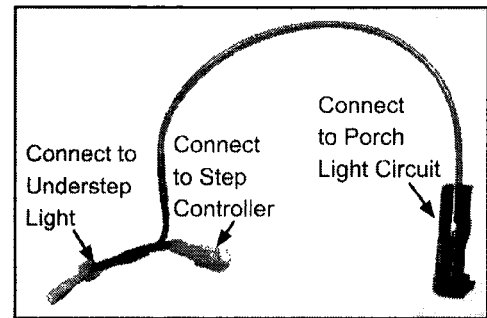


Figure 3
Diode Harness Connections

- Use wire ties to keep wires away from moving parts.
- After all necessary repairs have been made, reconnect the battery cables, making sure all battery connections are clean and tight.

NOTE: Allow motor homes built on Ford Chassis to idle uninterrupted for 15 minutes after restarting the engine to reset the engine computer control. This is only necessary for Ford Chassis systems.

- Test the step for proper operation and correct as necessary.

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that: If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods.

PARTS:

<u>Part No.</u>	<u>Description</u>	<u>Qty.</u>
478178	Kit, Step Controller with Diode Harness	1
Obtain Locally	Wire Ties	AR*

*AR = As Required

TOOLS

Power Driver with 1/4" Hex Bit
Wire Brush
7/16 Combination Wrench
7/16 Socket with Ratchet

WARRANTY LABOR ALLOWANCE:

Use Flat Rate Codes below for the inspection and/or installation of a Step Controller with Diode Harness.

NOTE: Step controllers requiring replacement must be returned with the Warranty Repair Claim.

Use Flat Rate Code:

9169 – 11	.2 hr.	Inspected/Not Defective
9169 – 12	.7 hr.	Inspected/Defective/Repaired
9169 – 13	.2 hr.	Inspected/Defective/Owner Decline
9169 – 14	.2 hr.	Inspected/Defective/Missing Parts
9169 – 15	.2 hr.	Inspected/Defective/Need Tools
9169 – 16	.2 hr.	Unable to Notify Customer
9169 – 17	.2 hr.	Customer Unreachable

If you have any questions concerning this bulletin, contact Fleetwood Dealer Technical Support at:
1-800-816-9825

Fleetwood Service Literature can be accessed at: <http://www.fleetwoodrvdealers.com>

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that: If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods.

Bounder**AFFECTED MOTOR HOMES - CLASS A**

739Z54788937	739W64792295	739F64792692	739F67169121
739E64791100	739W64792301	739W64792693	739F67169122
739R64791101	739W64792302	739W64792694	739E67169142
739W64791199	739W64792303	739W64792695	739E67169143
739F64791201	739W64792304	739W64792697	739E67169144
739W64792081	739W64792305	739W64792705	739E67169145
739W64792082	739F64792306	739W64792706	739E67169146
739W64792083	739F64792308	739W64792707	739Z67169163
739W64792084	739E64792311	739R64792708	739Z67169164
739W64792085	739E64792312	739R64792709	739E67169170
739E64792106	739E64792313	739R64792710	739E67169171
739E64792107	739E64792314	739R64792711	739E67169172
739E64792108	739E64792315	739R64792721	739E67169173
739E64792109	739W64792426	739R64792722	739E67169174
739E64792110	739W64792427	739F64792725	739F67169197
739R64792171	739W64792428	739F64792726	739F67169198
739R64792172	739W64792429	739F64792727	739R67169200
739R64792173	739W64792430	739R64792764	739R67169201
739R64792174	739E64792471	739E67168964	739E67169208
739R64792175	739E64792472	739E67168965	739E67169209
739Z64792181	739E64792473	739E67168966	739E67169210
739Z64792182	739E64792474	739E67169018	739W67169225
739Z64792183	739E64792475	739E67169020	739W67169228
739Z64792184	739W64792637	739F67169033	739E67169239
739R64792191	739W64792638	739F67169035	739E67169241
739R64792192	739W64792639	739F67169036	739E67169242
739R64792193	739W64792640	739F67169037	739E67169244
739R64792194	739W64792641	739F67169038	739Z67169253
739R64792195	739R64792644	739F67169039	739Z67169254
739E64792271	739R64792645	739W67169040	739Z67169273
739E64792272	739R64792646	739W67169041	739Z67169274
739E64792273	739E64792647	739W67169042	739Z67169276
739E64792274	739E64792648	739E67169054	739E67169285
739E64792275	739E64792649	739E67169055	739E67169286
739W64792291	739E64792650	739E67169056	739E67169288
739W64792292	739E64792651	739E67169057	739E67169289
739W64792293	739F64792689	739F67169120	739E67169355
739W64792294	739F64792691		

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that:
If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

AFFECTED MOTOR HOMES - CLASS A (CONTINUED)

Boulder Diesel

735N64495468	735N64495708	735L64496002	735N67169090
735N64495469	735H64495709	735L64496003	735N67169091
735N64495470	735H64495710	735L64496007	735U67169095
735N64495471	735L64495780	735H64496008	735U67169096
735N64495472	735H64495845	735H64496009	735Z67169147
735N64495473	735H64495847	735H64496010	735Z67169148
735N64495474	735N64495904	735H64496011	735Z67169149
735N64495475	735N64495905	735L64496021	735N67169158
735H64495508	735N64495906	735L64496022	735N67169159
735H64495509	735L64495907	735L64496024	735N67169160
735H64495510	735L64495908	735N67169005	735N67169162
735N64495603	735L64495909	735N67169006	735N67169176
735N64495604	735L64495910	735N67169007	735N67169177
735N64495605	735L64495911	735N67169008	735N67169178
735N64495606	735L64495912	735N67169009	735H67169182
735M64495612	735S64495932	735N67169010	735H67169183
735M64495613	735S64495933	735N67169021	735U67169184
735M64495614	735S64495935	735N67169022	735N67169220
735U64495648	735S64495965	735N67169023	735N67169223
735U64495649	735S64495966	735N67169024	735N67169249
735N64495705	735N64495998	735N67169025	735N67169250
735N64495706	735N64496000	735N67169088	735N67169252
735N64495707	735N64496001	735N67169089	

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that: If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Discovery AFFECTED MOTOR HOMES - CLASS A (CONTINUED)

770S64495426	770S64495539	770L64495638	770L64495855
770S64495427	770S64495540	770L64495639	770L64495856
770L64495428	770S64495541	770L64495640	770L64495857
770L64495429	770S64495542	770L64495641	770L64495858
770L64495430	770S64495543	770L64495642	770S64495878
770L64495431	770S64495544	770L64495643	770S64495879
770L64495432	770S64495545	770S64495677	770S64495880
770L64495433	770S64495547	770S64495678	770S64495881
770L64495434	770S64495548	770S64495679	770S64495882
770L64495435	770J64495563	770S64495680	770L64495897
770L64495436	770J64495564	770S64495681	770L64495898
770L64495437	770J64495565	770C64495682	770L64495899
770V64495459	770J64495566	770L64495683	770L64495900
770H64495460	770J64495567	770L64495684	770L64495901
770H64495461	770J64495568	770L64495685	770L64495902
770L64495489	770J64495569	770L64495686	770J64495919
770L64495490	770J64495570	770L64495687	770J64495920
770L64495491	770L64495571	770H64495756	770J64495921
770L64495492	770L64495572	770H64495757	770J64495922
770L64495493	770L64495573	770H64495758	770J64495923
770S64495494	770L64495574	770H64495759	770C64495924
770S64495495	770L64495575	770H64495760	770S64495926
770S64495496	770L64495576	770S64495812	770S64495927
770S64495497	770L64495577	770S64495813	770S64495928
770S64495498	770L64495578	770S64495814	770S64495929
770S64495499	770L64495579	770S64495815	770S64495930
770S64495500	770L64495580	770S64495816	770S64495931
770S64495501	770L64495581	770S64495817	770L64495957
770S64495502	770S64495628	770S64495818	770L64495958
770S64495503	770S64495629	770S64495819	770L64495959
770S64495504	770S64495630	770V64495848	770L64495960
770H64495505	770S64495631	770J64495849	770L64495961
770H64495506	770S64495632	770J64495850	770L64495962
770H64495507	770S64495633	770L64495851	770H64495963
770S64495535	770S64495634	770L64495852	770L64496017
770S64495536	770S64495635	770L64495853	770L64496018
770S64495537	770L64495636	770L64495854	770V64496030
770S64495538	770L64495637		

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that:
If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Excursion **AFFECTED MOTOR HOMES - CLASS A (CONTINUED)**

779L64495448	779J64495562	779L64495698	779S64495885
779L64495449	779L64495615	779J64495764	779S64495886
779L64495450	779L64495616	779J64495765	779S64495887
779L64495451	779L64495617	779J64495766	779V64495888
779L64495452	779L64495618	779S64495767	779L64495890
779L64495453	779L64495619	779S64495769	779L64495891
779L64495454	779L64495620	779S64495770	779L64495892
779L64495455	779L64495621	779S64495820	779L64495894
779L64495456	779L64495622	779S64495821	779L64495895
779L64495457	779L64495623	779S64495822	779S64495945
779L64495458	779L64495624	779C64495823	779S64495947
779S64495553	779C64495625	779L64495824	779L64495950
779S64495554	779C64495626	779L64495825	779L64495951
779S64495555	779C64495627	779L64495826	779L64496019
779S64495556	779L64495694	779L64495827	779L64496020
779S64495557	779L64495695	779L64495829	779C64496047
779S64495559	779L64495696	779S64495883	779J64496051
779J64495560	779L64495697	779S64495884	

Expedition

730U64495462	730N64495699	730N64495783	730N64495995
730U64495463	730N64495700	730N64495784	730N64495996
730U64495464	730N64495701	730N64495785	730N64495997
730U64495465	730N64495702	730N64495786	730H64496014
730N64495476	730N64495703	730N64495835	730H64496015
730N64495477	730H64495713	730N64495836	730S64496031
730N64495478	730H64495714	730N64495837	730S64496032
730N64495479	730H64495715	730N64495838	730S64496033
730N64495480	730H64495771	730N64495839	730S64496036
730H64495511	730H64495772	730H64495841	730S64496037
730H64495512	730H64495773	730H64495842	730S64496038
730H64495513	730H64495774	730H64495843	730S64496039
730H64495514	730H64495775	730H64495844	730L64496041
730N64495607	730H64495776	730L64495913	730L64496043
730N64495608	730H64495777	730L64495914	730L64496044
730N64495609	730H64495778	730L64495916	730L64496046
730M64495610	730N64495781	730L64495917	730H67168959
730M64495611	730N64495782	730L64495918	730H67168960

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that: if you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

AFFECTED MOTOR HOMES - CLASS A (CONTINUED)**Expedition (Continued)**

730H67168961	730U67168990	730N67169016	730N67169113
730N67168967	730N67168997	730H67169097	730N67169114
730N67168968	730N67168998	730H67169099	730N67169135
730N67168969	730N67168999	730H67169100	730N67169136
730N67168970	730N67169000	730H67169102	730N67169137
730N67168971	730N67169013	730N67169109	730N67169277
730N67168972	730N67169014	730N67169110	730N67169278
730U67168989	730N67169015	730N67169112	730N67169279

Fiesta

784Y64792015	784J64792100	784J64792316	784S67168949
784J64792076	784S64792113	784S64792368	784Y67169011
784J64792077	784S64792114	784S64792369	784H67169051
784J64792078	784S64792115	784S64792370	784S67169103
784J64792079	784J64792240	784S64792436	784S67169104
784J64792080	784S64792246	784S64792437	784S67169105
784Y64792086	784S64792247	784S64792438	784S67169106
784Y64792087	784S64792248	784S64792439	784J67169168
784Y64792088	784S64792249	784S64792440	784J67169169
784Y64792089	784S64792266	784S64792542	784S67169211
784Y64792090	784S64792267	784S64792543	784S67169212
784J64792096	784S64792268	784J64792553	784S67169213
784J64792097	784S64792269	784J64792563	784S67169219
784J64792098	784Q64792286	784J64792565	
784J64792099	784Q64792287	784S64792682	

Flair

732R64792066	732A64792253	732A64792468	732R64792636
732R64792067	732A64792254	732A64792469	732A64792713
732R64792068	732A64792255	732A64792470	732A64792850
732R64792070	732A64792361	732A64792546	732F67169123
732R64792186	732A64792362	732A64792547	732F67169124
732R64792187	732A64792363	732F64792617	732F67169125
732R64792188	732A64792364	732F64792618	732R67169127
732R64792190	732A64792365	732F64792620	732R67169128
732A64792251	732A64792466	732R64792632	732F67169131
732A64792252	732A64792467	732R64792633	732A67169319

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that:
If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

AFFECTED MOTOR HOMES - CLASS A (CONTINUED)

Pace Arrow

777B64792091	777C64792378	777D64792728	777C67168986
777B64792092	777C64792380	777D64792729	777C67168987
777B64792093	777L64792461	777C64792748	777C67168988
777B64792094	777L64792462	777C64792750	777B67169012
777C64792161	777D64792556	777C64792751	777C67169092
777C64792162	777D64792557	777C64792770	777C67169093
777C64792163	777D64792558	777D64792817	777C67169094
777C64792164	777D64792559	777D67168976	777D67169150
777C64792165	777D64792560	777D67168977	777D67169152
777D64792257	777D64792576	777D67168978	777C67169189
777D64792258	777D64792577	777D67168979	777C67169190
777D64792259	777D64792578	777D67168980	777C67169191
777D64792260	777D64792652	777C67168984	777C67169268
777C64792376	777B64792699	777C67168985	777C67169270
777C64792377			

Providence

772S64495438	772L64495484	772L64495647	772L64495761
772S64495439	772L64495485	772S64495672	772J64495762
772S64495440	772L64495486	772S64495673	772J64495763
772S64495441	772L64495487	772S64495674	772L64495830
772S64495443	772L64495488	772S64495675	772L64495831
772S64495444	772S64495549	772S64495676	772L64495832
772S64495445	772S64495550	772L64495688	772L64495833
772S64495446	772S64495551	772L64495689	772S64495936
772S64495447	772S64495552	772L64495690	772S64495939
772L64495481	772L64495644	772L64495691	772S64495940
772L64495482	772L64495645	772L64495692	772L64495953
772L64495483	772L64495646	772L64495693	772L64495954

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that:
If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

AFFECTED MOTOR HOMES - CLASS A (CONTINUED)

Revolution LE

781L64495327	781E64495412	781E64495659	781E64495748
781L64495328	781E64495413	781E64495660	781E64495749
781J64495331	781E64495414	781E64495661	781E64495750
781J64495333	781E64495415	781E64495662	781E64495751
781L64495334	781E64495416	781L64495665	781E64495752
781L64495335	781L64495520	781L64495666	781E64495753
781L64495336	781L64495521	781L64495667	781E64495754
781E64495337	781L64495522	781L64495668	781E64495793
781E64495338	781L64495523	781L64495669	781E64495794
781E64495339	781L64495524	781J64495670	781E64495795
781E64495340	781E64495530	781J64495719	781E64495796
781E64495341	781E64495531	781L64495720	781E64495797
781E64495342	781E64495532	781L64495721	781E64495798
781E64495343	781E64495533	781E64495724	781E64495799
781E64495345	781J64495588	781E64495725	781E64495800
781E64495346	781L64495595	781E64495727	781L64495806
781E64495347	781E64495597	781E64495728	781E64495807
781E64495348	781E64495598	781E64495729	781E64495808
781E64495349	781E64495599	781E64495730	781E64495810
781E64495350	781E64495600	781E64495731	781E64495811
781E64495351	781E64495601	781E64495732	781L64495859
781L64495401	781E64495602	781E64495734	781L64495860
781L64495402	781E64495651	781E64495735	781L64495861
781L64495403	781E64495652	781E64495736	781E64495863
781L64495404	781E64495653	781E64495737	781E64495864
781E64495407	781E64495654	781E64495738	781E64495865
781E64495408	781E64495655	781E64495744	781E64495866
781E64495409	781E64495656	781E64495745	781E64495867
781E64495410	781E64495657	781E64495746	781E64495872
781E64495411	781E64495658	781E64495747	

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that:
If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Southwind **AFFECTED MOTOR HOMES - CLASS A (CONTINUED)**

721C64792102	721V64792232	721V64792357	721V64792625
721C64792103	721V64792234	721V64792359	721V64792626
721C64792104	721V64792235	721V64792386	721V64792746
721C64792105	721V64792261	721V64792389	721V67168958
721V64792151	721V64792262	721V64792390	721C67169017
721V64792152	721V64792263	721V64792441	721V67169030
721V64792153	721V64792264	721V64792444	721V67169031
721V64792154	721V64792265	721B64792446	721C67169046
721V64792166	721V64792276	721B64792448	721C67169050
721V64792167	721V64792277	721C64792566	721V67169061
721V64792169	721V64792278	721C64792570	721V67169063
721V64792170	721V64792279	721V64792613	721V67169064
721V64792176	721V64792280	721V64792614	721V67169117
721V64792177	721L64792282	721V64792615	721V67169118
721V64792178	721C64792296	721V64792616	721V67169119
721V64792179	721C64792299	721V64792622	721C67169230
721V64792180	721C64792300	721V64792623	721V67169245
721V64792231	721V64792356	721V64792624	721V67169246

Storm

726W64792156	726W64792241	726A64792452	726W64792457
726W64792157	726W64792242	726A64792453	726W64792683
726W64792158	726W64792244	726A64792454	726F67169195
726W64792159	726W64792245	726A64792455	
726W64792160	726A64792451	726W64792456	

Terra

783Q64792014	783J64792237	783Y64792374	783J67168982
783Q64792061	783J64792238	783S64792544	783J67168983
783Q64792062	783J64792239	783S64792545	783H67169052
783Q64792063	783S64792270	783J64792552	783H67169053
783Q64792064	783Q64792288	783S64792679	783S67169058
783Q64792065	783Q64792289	783S64792798	783S67169059
783Y64792071	783Q64792290	783S64792799	783S67169060
783Y64792072	783J64792317	783S64792801	783S67169107
783Y64792073	783J64792318	783S64792802	783S67169108
783Y64792074	783J64792319	783J64793083	783S67169291
783Y64792075	783J64792320	783S67168973	783S67169292
783S64792111	783S64792366	783S67168974	783S67169293
783S64792112	783S64792367	783S67168975	
783J64792236	783Y64792373	783J67168981	

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that: if you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods.

AFFECTED MOTOR HOMES - CLASS C**Jamboree**

751Q64792126	751Q64792391	751M64792602	751M67169082
751Q64792127	751Q64792395	751M64792603	751M67169083
751Q64792129	751M64792396	751M64792604	751M67169084
751Q64792130	751M64792397	751M64792605	751M67169085
751E64792135	751M64792398	751M64792606	751M67169086
751M64792139	751M64792399	751M64792673	751M67169087
751M64792140	751M64792400	751M64792676	751E67169116
751M64792197	751M64792406	751M64792829	751M67169129
751M64792198	751M64792407	751M64792831	751M67169132
751M64792199	751M64792408	751M64792916	751D67169175
751M64792200	751M64792409	751M67169001	751M67169192
751D64792203	751M64792410	751M67169002	751M67169193
751D64792204	751M64792535	751M67169003	751M67169194
751D64792205	751Q64792539	751M67169004	751V67169206
751E64792214	751B64792592	751M67169026	751M67169237
751E64792215	751B64792593	751M67169027	751M67169238
751M64792349	751B64792594	751M67169028	
751M64792350	751B64792595	751M67169029	

Jamboree GT

773U64792221	773W64792354	773W64792416	773W64792608
773W64792226	773W64792355	773W64792417	773U64792667
773W64792227	773W64792411	773W64792418	773W67169130
773U64792335	773W64792412	773W64792419	773W67169204
773W64792351	773W64792413	773W64792420	773W67169205
773W64792352	773W64792414	773W64792598	
773W64792353	773W64792415	773W64792607	

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that:
If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

AFFECTED MOTOR HOMES - CLASS C (CONTINUED)

Tioga

741E64792131	741V64792343	741M64792585	741M67169044
741E64792132	741V64792344	741B64792596	741M67169045
741E64792133	741V64792345	741M64792653	741M67169065
741M64792136	741M64792346	741M64792654	741M67169066
741M64792137	741M64792347	741M64792656	741M67169067
741M64792138	741M64792348	741M64792657	741M67169068
741V64792141	741V64792401	741D64792778	741M67169069
741V64792142	741V64792402	741M64792783	741M67169070
741V64792143	741V64792403	741M64792784	741M67169071
741V64792144	741V64792404	741M64792785	741M67169072
741V64792145	741E64792477	741M64792787	741M67169073
741M64792196	741E64792478	741Q64792788	741M67169074
741D64792202	741Q64792496	741Q64792789	741M67169075
741M64792206	741Q64792498	741M64792793	741M67169076
741M64792207	741V64792511	741M64792794	741M67169077
741M64792208	741V64792513	741M64792819	741M67169078
741M64792210	741B64792521	741Q64792898	741M67169079
741E64792211	741B64792522	741Q64792899	741M67169080
741E64792212	741B64792523	741M64792903	741M67169081
741Q64792321	741B64792524	741M64792904	741E67169115
741Q64792322	741M64792531	741M67168991	741M67169187
741Q64792323	741M64792534	741M67168992	741M67169233
741Q64792324	741Q64792536	741M67168993	741M67169234
741Q64792325	741Q64792537	741M67168994	741M67169235
741V64792341	741M64792582	741M67168996	
741V64792342	741M64792584	741M67169043	

Tioga SL

763U64792123	763U64792222	763W64792339	763W64792823
763U64792124	763U64792224	763W64792421	763W67169138
763U64792125	763U64792225	763W64792422	763W67169140
763W64792146	763W64792228	763W64792425	763U67169156
763W64792147	763W64792230	763W64792590	763U67169157
763W64792148	763W64792326	763W64792591	763W67169214
763W64792150	763W64792327	763K64792668	763W67169215
763K64792217	763W64792328	763K64792669	763W67169216
763K64792218	763W64792329	763K64792670	
763K64792219	763U64792333	763U64792773	

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal Law (Section 154 of the National Traffic and Motor Vehicle Safety Act of 1966) requires that: If you have received a notice of recall or failure to comply from Fleetwood or any component manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods.