

# NISSAN

70 MAR 28 A 9:45  
DEFECTS INVESTIGATION

---

**NISSAN NORTH AMERICA, INC.**

Corporate Office  
18501 South Figueroa St.  
Gardena, California 90248-4500  
Mailing Address: P.O. Box 191  
Gardena, California 90248-0191  
Telephone: 310.532.3111

March 22, 2006

Mr. George Person  
Chief, Recall Analysis Division  
Office of Defects Investigation  
Safety Assurance  
National Highway Traffic Safety Administration  
400 Seventh Street, S.W.  
Washington, D.C. 20590

Ref: 06V-064

Dear Mr. Person:

The enclosed communication is being provided pursuant to 49 CFR Part 573.6(c)(9).

Technical Compliance Department

Encl.

Subject: 2006 Titan King Cab Door Latch Voluntary Safety Recall Campaign

06V-064

Attention – Dealer Principals, Sales, Parts and Service Managers

\*\*\*\*\* Campaign Announcement \*\*\*\*\*

Nissan is conducting a safety recall on approximately 427 model year 2006 Titan King Cab vehicles. Some 2006 model year Nissan Titan King Cab vehicles fail to conform to the Federal Motor Vehicle Safety Standard (FMVSS) 206 – Door Locks And Door Retention Components. FMVSS 206 specifies strength requirements for door locks, hinges and latches in vehicles. The upper latch assembly of the right side rear door in some Titan King Cab vehicles does not meet the requirement in this standard. This may result in the right side doors coming partially open in the case of certain crashes and increasing the risk of injury to occupants.

To prevent this condition from occurring, Nissan will replace the upper latch assemblies with ones that meet the standard. All other requirements under FMVSS 206 and other standards are met.

\*\*\*\*\* Dealer Responsibility \*\*\*\*\*

It is the retailer's responsibility to check Service Comm for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to delivery under a sale or lease. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration. While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Effective immediately, please use Service Comm (PB017) to determine which Titan King Cab vehicles, if any, in your inventory may require this campaign repair prior to being retailed. These vehicles must be placed on sales hold until the recall campaign repair is performed.

\*\*\*\*\* Interim Repair Instructions \*\*\*\*\*

Interim repair instructions to complete the campaign repair on Titan King Cab vehicles are available on NNA.net under My Documents in the Parts/Campaigns and Service/Campaigns categories. The Interim Repair Instructions included the service procedure, the related parts and warranty claim information and a complete list of the 427 VINs affected by this campaign.

\*\*\*\*\* Parts Availability \*\*\*\*\*

There is an adequate supply of parts to complete the campaign repair on Titan King Cab vehicles affected by this campaign. Please use the Titan King Cab Door Latch Campaign Parts Order Form to order parts for this campaign. The Titan King Cab Door Latch Campaign Parts Order Form is available on NNA.net under My Documents in the Parts/Campaigns and Service/Campaigns categories.

\*\*\*\*\* Owner Notification \*\*\*\*\*

Nissan will mail Owner Notification letters on April 3, 2006. The Recall Campaign Bulletin will be published on ASIST at that time.

If you have any additional questions related to this campaign, please contact your Dealer Parts and Service Manager (DPSM).

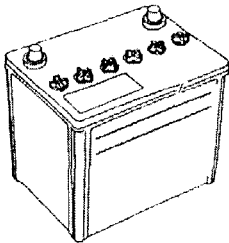


Nissan Parts and Service Operations  
03/22/2006

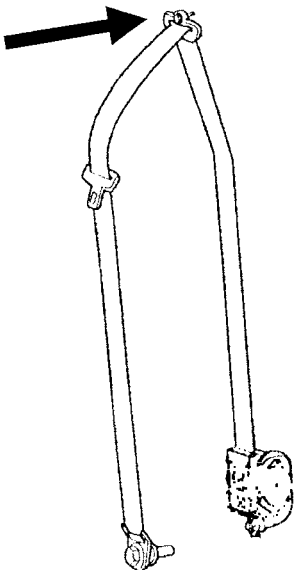
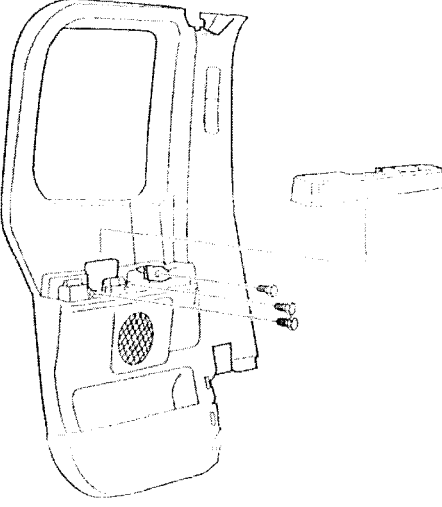


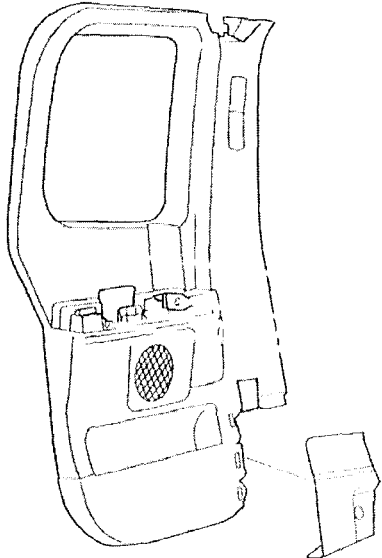
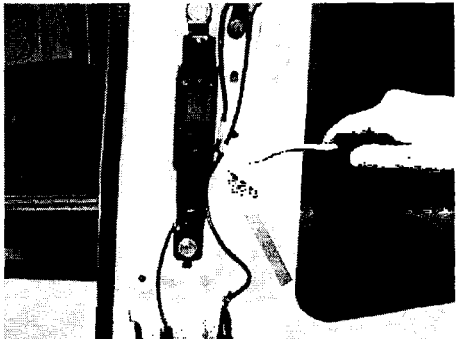
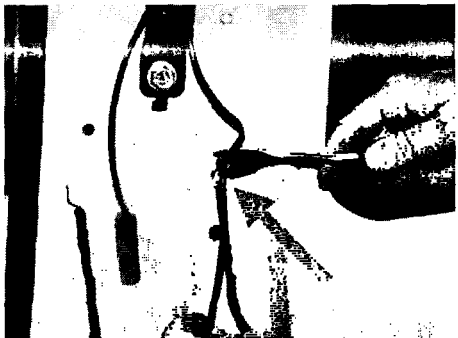
# TITAN RIGHT REAR UPPER DOOR LATCH INTERIM REPAIR INSTRUCTION

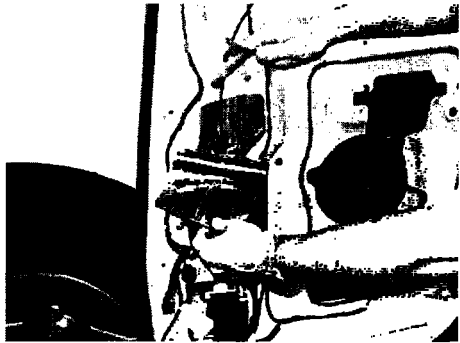
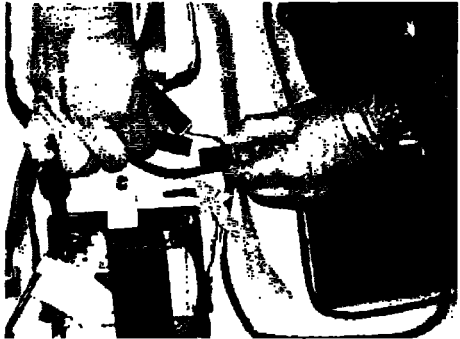
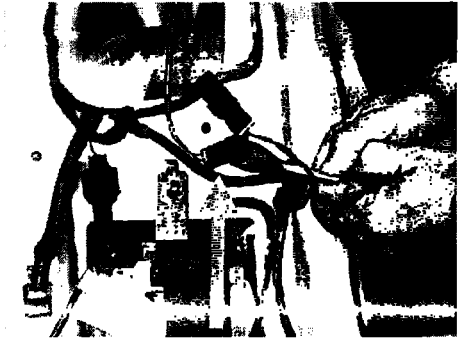

VEHICLE AFFECTED:	2006	NISSAN	TITAN / KING CAB	DATE: 03/16/2006
Vehicle built between:	1N6*A06**6N543640 – 546599			
	ATTN: SERVICE MANAGER		DLR: ALL	
Description:	REPLACE RIGHT REAR UPPER DOOR LATCH			

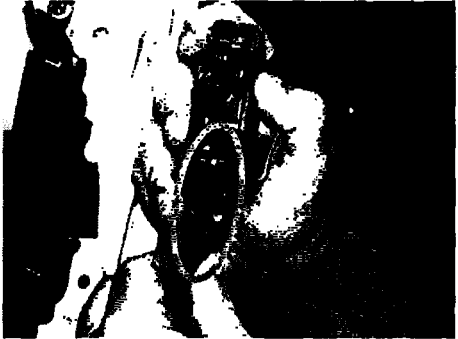

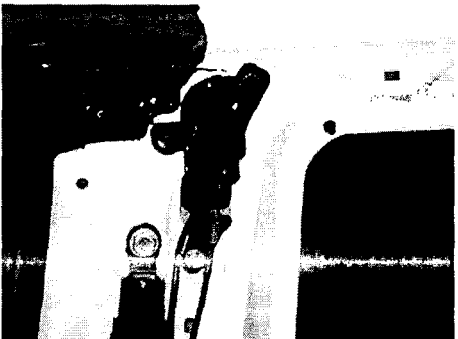
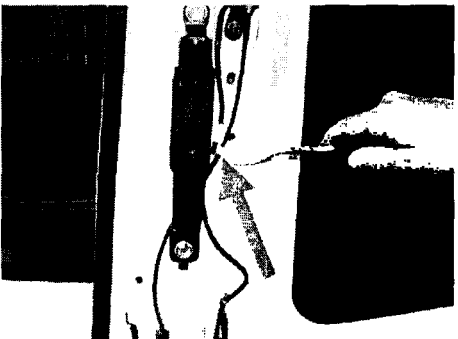
Use Service Comm to confirm this campaign applies to the vehicle you are working on.

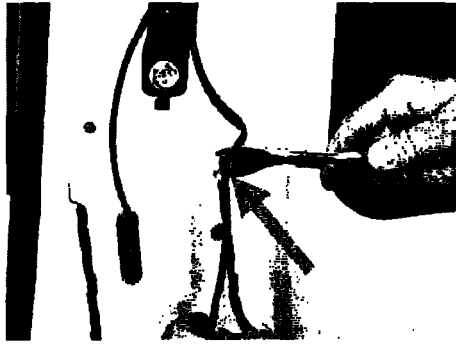
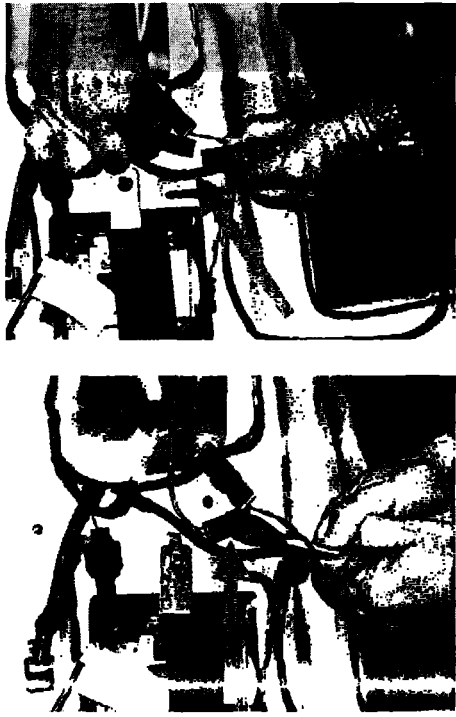
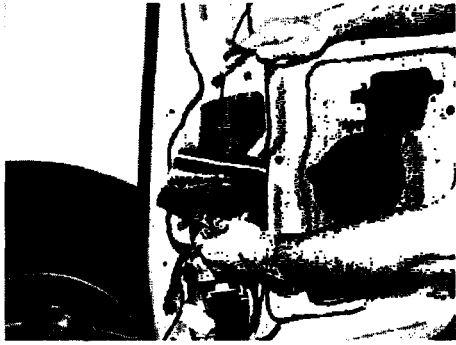
STEP	INSTRUCTION	NEXT	ILLUSTRATION / REFERENCE
1	<ul style="list-style-type: none"><li>Record radio presets.</li><li>Disconnect the negative battery cable.</li></ul>	GO TO STEP 2	
2	<ul style="list-style-type: none"><li>Remove upper seatbelt slide anchor trim.</li><li>Remove lower seatbelt anchor trim.</li></ul>	GO TO STEP 3	 UPPER TRIM  LOWER TRIM

3	<ul style="list-style-type: none"><li>Remove upper seatbelt anchor bolt.</li></ul>	GO TO STEP 4	 A line drawing of a seatbelt assembly. It shows a long, thin strap with a buckle at the bottom and a smaller strap at the top. A black arrow points to the top anchor point where the two straps meet.
4	<ul style="list-style-type: none"><li>Remove arm rest.</li><li>Remove three 10mm door panel bolts located behind armrest.</li></ul> <p><b>Note:</b> Use a Philips screwdriver to remove bolts.</p>	GO TO STEP 5	 A line drawing of a car door panel. The armrest is shown in its raised position. Three bolts are highlighted with dashed lines, indicating their locations behind the armrest. A Philips screwdriver is shown to the right, pointing towards the bolts.

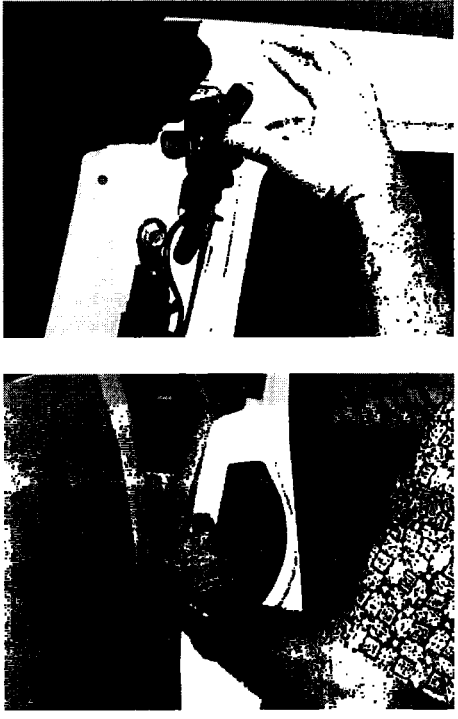
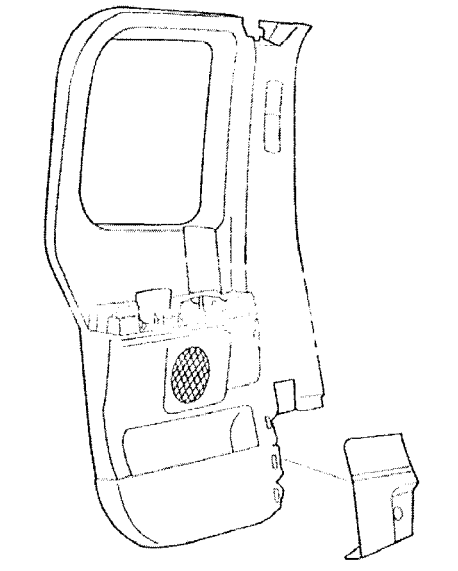
5	<ul style="list-style-type: none"><li>• Remove seatbelt retractor cover.</li><li>• Remove door finisher clips.</li></ul> <p><b>Note:</b> Start at lower left corner and continue counter-clockwise.</p> <ul style="list-style-type: none"><li>• Remove door panel.</li></ul>	GO TO STEP 6	
6	<ul style="list-style-type: none"><li>• Remove handle release cable from upper door latch white cable clip on door.</li><li>• Remove upper door latch white cable clip from door.</li></ul>	GO TO STEP 7	
7	<ul style="list-style-type: none"><li>• Remove upper door latch gray cable clip from door.</li></ul>	GO TO STEP 8	

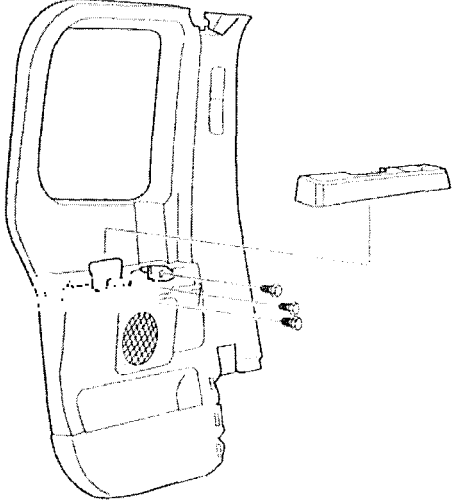
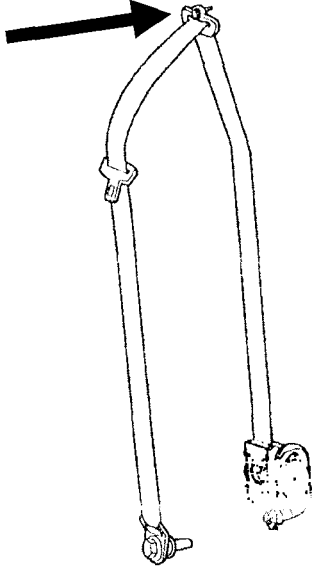
<p>8</p>	<ul style="list-style-type: none"> <li>• Peel back gray anti-rattle foam.</li> <li>• Remove gray anti-rattle foam.</li> </ul> <p><b>Note:</b> Gray anti-rattle foam will be reused. Store with adhesive side up.</p>	<p>GO TO STEP 9</p>	
<p>9</p>	<ul style="list-style-type: none"> <li>• Disconnect latch switch connector.</li> <li>• Remove latch switch connector from door.</li> </ul>	<p>GO TO STEP 10</p>	 
<p>10</p>	<ul style="list-style-type: none"> <li>• Remove three 10mm bolts from upper door latch.</li> </ul> <p><b>Note:</b> Observe wiring harness routing.</p>	<p>GO TO STEP 11</p>	



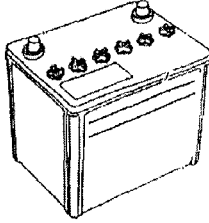
11	<ul style="list-style-type: none"> <li>Remove cable sheath and barrel cable end from upper door latch.</li> <li>Remove upper door latch from door.</li> </ul>	GO TO STEP 12	
12	<ul style="list-style-type: none"> <li>Install barrel cable end onto new upper door latch.</li> <li>Install cable sheath into receiving notch on new upper door latch.</li> </ul>	GO TO STEP 13	
13	<ul style="list-style-type: none"> <li>Install upper door latch to door with three 10mm bolts.</li> <li><b>Torque bolts to 51 in-lb</b></li> </ul> <p><b>Note:</b> Observe wiring harness routing. Do not pinch wire harness between door and upper door latch.</p>	GO TO STEP 14	
14	<ul style="list-style-type: none"> <li>Reinstall upper door latch white cable clip into door.</li> </ul> <p><b>Note:</b> Use lower locating hole.</p> <ul style="list-style-type: none"> <li>Reinstall handle release cable into upper door latch white cable clip on door.</li> </ul>	GO TO STEP 15	

<p>15</p>	<ul style="list-style-type: none"> <li>• Reinstall upper door latch gray cable clip into door.</li> </ul>	<p>GO TO STEP 16</p>	
<p>16</p>	<ul style="list-style-type: none"> <li>• Connect latch switch connector.</li> <li>• Reinstall latch switch connector onto door.</li> </ul>	<p>GO TO STEP 17</p>	
<p>17</p>	<ul style="list-style-type: none"> <li>• Reinstall gray anti-rattle foam.</li> </ul>	<p>GO TO STEP 18</p>	



18	<ul style="list-style-type: none"><li>• Test upper door latch operation.</li><li>• Push upper door latch into the closed position by hand.</li><li>• Pull release handle on door.</li></ul> <p><b>Note:</b> Upper door latch should close and open without binding or use of excessive force.</p>	GO TO STEP 19	
19	<ul style="list-style-type: none"><li>• Check that all door finisher clips are installed (replace any broken or missing door finisher clips).</li><li>• Reinstall door panel.</li><li>• Reinstall seatbelt retractor cover.</li></ul>	GO TO STEP 20	

20	<ul style="list-style-type: none"><li>• Reinstall three 10mm door panel bolts located behind armrest.</li></ul> <p><b>Note:</b> Use a Phillips screwdriver to remove bolts. Do not over tighten bolts.</p> <ul style="list-style-type: none"><li>• Reinstall arm rest.</li></ul>	GO TO STEP 21	
21	<ul style="list-style-type: none"><li>• Reinstall upper seatbelt anchor bolt.</li></ul> <ul style="list-style-type: none"><li>• <b>Torque bolt to 36 ft-lb</b></li></ul>	GO TO STEP 22	

<p>22</p>	<ul style="list-style-type: none"> <li>Reinstall upper seatbelt slide anchor trim.</li> <li>Reinstall lower seatbelt slide anchor trim.</li> </ul>	<p>GO TO STEP 23</p>	 <p>UPPER TRIM</p>  <p>LOWER TRIM</p>
<p>23</p>	<ul style="list-style-type: none"> <li>Reconnect the negative battery cable.</li> <li>Reset radio presets.</li> </ul>	<p>END</p>	

**PARTS INFORMATION**

DESCRIPTION	PART NUMBER	QUANTITY
Lock Assembly-Rear Door, RH	82540-7S200	1

**CLAIMS INFORMATION**

Submit a Campaign (CM) line claim using the following claims coding:

"CM" I.D.: PB017

DESCRIPTION	OP CODE	FRT
Replace Right Rear Upper Door Latch	PB0170	0.6 hrs

**AFFECTED VEHICLES VIN LIST**

1N6BA06BX6N543640	1N6AA06B86N544460	1N6AA06B36N545323	1N6BA06A56N545934
1N6BA06A46N543642	1N6BA06A96N544463	1N6AA06B56N545355	1N6AA06B76N545938
1N6BA06A16N543646	1N6BA06B16N544465	1N6BA06A86N545359	1N6BA06BX6N545940
1N6BA06B66N543649	1N6AA06A26N544476	1N6BA06A26N545387	1N6BA06AX6N545945
1N6AA06A86N543655	1N6BA06BX6N544495	1N6BA06A06N545405	1N6BA06B26N545950
1N6AA06A36N543661	1N6BA06B76N544499	1N6BA06A76N545417	1N6BA06A66N545957
1N6AA06A86N543669	1N6BA06B16N544515	1N6BA06B66N545420	1N6AA06A56N545959
1N6BA06A36N543678	1N6BA06B56N544520	1N6BA06B36N545438	1N6BA06AX6N545962
1N6BA06B46N543682	1N6BA06A26N544532	1N6AA06B06N545456	1N6BA06A06N545968
1N6AA06A16N543688	1N6BA06A36N544538	1N6BA06B16N545468	1N6BA06B86N545970
1N6BA06A46N543690	1N6BA06A56N544542	1N6BA06B56N545473	1N6AA06B76N545972
1N6BA06A16N543694	1N6BA06B36N544547	1N6BA06A16N545476	1N6BA06A66N545974
1N6AA06A66N543699	1N6BA06B96N544553	1N6BA06A56N545478	1N6BA06A66N545988
1N6AA06A16N543707	1N6BA06A06N544559	1N6BA06B46N545481	1N6BA06A16N545994
1N6BA06B96N543709	1N6BA06A26N544577	1N6BA06AX6N545492	1N6AA06A46N545998
1N6BA06B36N543723	1N6AA06A16N544582	1N6BA06B86N545497	1N6AA06B96N546007
1N6BA06B76N543725	1N6BA06A36N544586	1N6BA06A86N545507	1N6BA06A86N546012
1N6BA06A56N543732	1N6AA06B36N544589	1N6BA06B46N545514	1N6BA06A96N546018
1N6BA06B76N543739	1N6BA06B76N544597	1N6AA06A66N545517	1N6BA06B66N546020
1N6BA06AX6N543743	1N6BA06A16N544599	1N6BA06B46N545531	1N6BA06A86N546026
1N6BA06B16N543753	1N6BA06B06N544604	1N6AA06A36N545538	1N6BA06A16N546031
1N6BA06B26N543762	1N6AA06B36N544611	1N6AA06B36N545547	1N6BA06B66N546034
1N6BA06A46N543771	1N6AA06B46N544617	1N6BA06A46N545553	1N6BA06A26N546037
1N6BA06A56N543780	1N6BA06B26N544619	1N6BA06A16N545557	1N6BA06B36N546041
1N6BA06B16N543784	1N6BA06A76N544624	1N6BA06B36N545567	1N6BA06AX6N546044
1N6AA06A86N543798	1N6BA06B36N544631	1N6BA06A86N545569	1N6BA06A56N546047
1N6BA06A46N543804	1N6BA06B06N544635	1N6BA06A16N545574	1N6BA06B66N546051
1N6BA06A36N543812	1N6BA06A76N544638	1N6AA06A46N545595	1N6BA06B06N546059
1N6BA06A36N543826	1N6AA06A76N544649	1N6BA06A46N545603	1N6AA06A06N546064
1N6BA06B56N543836	1N6BA06A06N544657	1N6AA06A66N545615	1N6AA06A86N546068
1N6BA06B06N543839	1N6BA06B36N544659	1N6BA06A06N545632	1N6AA06A86N546071
1N6BA06B66N543845	1N6BA06A96N544706	1N6BA06B46N545643	1N6BA06AX6N546075
1N6AA06B96N543852	1N6AA06B56N544710	1N6BA06A26N545647	1N6BA06A76N546082
1N6BA06A56N543858	1N6AA06B76N544739	1N6AA06B76N545650	1N6BA06B36N546086
1N6BA06A16N543887	1N6BA06A06N544755	1N6BA06A56N545660	1N6BA06A86N546088
1N6BA06B06N543890	1N6BA06B86N544768	1N6BA06A06N545663	1N6AA06A16N546090
1N6AA06B76N543901	1N6BA06B16N544773	1N6BA06A66N545666	1N6BA06B96N546092
1N6BA06A86N543904	1N6BA06A86N544776	1N6AA06B46N545668	1N6AA06B86N546094
1N6BA06A56N543911	1N6BA06A16N544795	1N6AA06B46N545671	1N6BA06A06N546098
1N6BA06BX6N543914	1N6AA06B16N544803	1N6BA06A36N545673	1N6BA06A86N546107
1N6BA06A66N543917	1N6AA06B96N544807	1N6BA06A66N545683	1N6AA06A76N546109
1N6BA06A66N543920	1N6AA06AX6N544810	1N6BA06A16N545686	1N6BA06AX6N546111
1N6BA06B16N543929	1N6BA06A86N544812	1N6BA06B56N545697	1N6BA06B66N546115
1N6BA06A56N543939	1N6BA06B66N544817	1N6AA06B06N545702	1N6BA06A26N546118
1N6BA06B86N543944	1N6AA06B36N544821	1N6BA06B06N545719	1N6BA06B96N546125
1N6BA06B26N543955	1N6BA06B16N544823	1N6BA06A36N545723	1N6AA06A96N546127
1N6BA06A76N543957	1N6BA06B26N544832	1N6AA06B16N545725	1N6AA06A96N546130

1N6BA06B66N543960	1N6BA06A26N544837	1N6AA06A56N545735	1N6BA06A76N546132
1N6AA06A66N543976	1N6BA06A26N544840	1N6AA06A46N545743	1N6AA06A66N546134
1N6BA06B16N543994	1N6BA06A56N544850	1N6BA06A46N545746	1N6AA06AX6N546136
1N6BA06A26N544000	1N6BA06A06N544867	1N6AA06A36N545748	1N6AA06B56N546151
1N6BA06A36N544006	1N6AA06AX6N544869	1N6BA06A36N545754	1N6BA06A36N546175
1N6BA06B66N544008	1N6BA06B96N544875	1N6BA06A96N545757	1N6BA06B86N546181
1N6BA06B16N544014	1N6BA06A46N544886	1N6BA06B16N545762	1N6BA06B26N546189
1N6BA06A66N544016	1N6BA06A86N544888	1N6AA06A56N545766	1N6AA06A96N546192
1N6AA06A36N544020	1N6AA06B86N544894	1N6BA06A16N545770	1N6AA06B56N546196
1N6BA06A56N544024	1N6AA06B36N544902	1N6BA06A56N545772	1N6AA06B06N546199
1N6BA06A46N544029	1N6BA06A46N544905	1N6AA06B56N545775	1N6AA06A16N546204
1N6BA06B96N544035	1N6BA06B26N544913	1N6BA06A66N545778	1N6AA06A66N546215
1N6BA06A46N544046	1N6BA06A96N544916	1N6AA06A16N545781	1N6BA06A66N546218
1N6AA06A36N544048	1N6BA06B36N544919	1N6BA06A76N545787	1N6AA06B06N546221
1N6BA06A06N544058	1N6BA06B16N544921	1N6BA06A06N545789	1N6AA06A76N546224
1N6AA06A26N544087	1N6AA06B86N544927	1N6BA06A96N545791	1N6BA06A76N546227
1N6BA06A96N544091	1N6BA06B76N544938	1N6AA06A56N545797	1N6AA06A56N546237
1N6BA06A26N544093	1N6BA06A06N544948	1N6BA06A36N545799	1N6AA06BX6N546243
1N6AA06A16N544100	1N6AA06B26N544955	1N6AA06B86N545804	1N6AA06A56N546254
1N6AA06A26N544106	1N6BA06B66N544963	1N6BA06B16N545809	1N6BA06A36N546256
1N6BA06B16N544126	1N6BA06A86N544969	1N6BA06A06N545811	1N6AA06B16N546261
1N6AA06AX6N544130	1N6AA06A36N544972	1N6BA06A46N545813	1N6AA06A66N546263
1N6BA06A36N544135	1N6BA06B46N544976	1N6AA06A56N545816	1N6AA06AX6N546265
1N6BA06B16N544143	1N6BA06A36N545012	1N6BA06A36N545818	1N6AA06A46N546276
1N6AA06A46N544155	1N6BA06A66N545019	1N6AA06A06N545822	1N6AA06B86N546290
1N6BA06B16N544160	1N6BA06A56N545030	1N6AA06A46N545824	1N6BA06A86N546298
1N6BA06A86N544163	1N6AA06B76N545051	1N6BA06A66N545828	1N6AA06A86N546300
1N6BA06B26N544166	1N6AA06B46N545069	1N6AA06AX6N545830	1N6AA06A26N546311
1N6BA06A06N544173	1N6BA06B76N545071	1N6BA06AX6N545833	1N6BA06A06N546313
1N6BA06A46N544189	1N6BA06A26N545082	1N6BA06A76N545837	1N6BA06B76N546317
1N6BA06A46N544211	1N6BA06A56N545089	1N6BA06A76N545840	1N6BA06A76N546325
1N6BA06B06N544215	1N6AA06BX6N545092	1N6AA06A66N545842	1N6AA06B76N546331
1N6BA06B46N544217	1N6BA06A16N545106	1N6BA06A66N545845	1N6AA06B86N546337
1N6BA06BX6N544223	1N6BA06AX6N545119	1N6BA06AX6N545847	1N6BA06B66N546339
1N6BA06AX6N544231	1N6BA06A56N545142	1N6BA06A36N545849	1N6BA06B56N546347
1N6AA06A06N544234	1N6BA06BX6N545145	1N6BA06B06N545851	1N6AA06B76N546362
1N6AA06AX6N544242	1N6BA06B76N545149	1N6AA06A66N545856	1N6BA06A76N546390
1N6BA06A26N544272	1N6BA06B26N545155	1N6AA06AX6N545858	1N6BA06B46N546405
1N6BA06A46N544287	1N6BA06A96N545158	1N6BA06A66N545862	1N6BA06A26N546412
1N6BA06A86N544289	1N6BA06A76N545160	1N6BA06A16N545865	1N6AA06A76N546417
1N6BA06A76N544297	1N6BA06BX6N545162	1N6BA06A76N545868	1N6AA06BX6N546422
1N6BA06A56N544301	1N6AA06A56N545167	1N6AA06A06N545870	1N6BA06B56N546431
1N6BA06A66N544310	1N6BA06A26N545177	1N6BA06A96N545872	1N6BA06B36N546444
1N6AA06A86N544319	1N6AA06B26N545183	1N6BA06A46N545875	1N6AA06A76N546451
1N6BA06A16N544330	1N6BA06B96N545203	1N6AA06A06N545884	1N6BA06B66N546471
1N6BA06A76N544333	1N6AA06B86N545205	1N6AA06B56N545887	1N6AA06AX6N546475
1N6BA06A66N544338	1N6BA06A06N545226	1N6BA06A06N545890	1N6BA06BX6N546487
1N6BA06A46N544354	1N6AA06B76N545230	1N6BA06A46N545892	1N6AA06AX6N546489
1N6AA06A26N544364	1N6BA06A36N545236	1N6BA06B96N545895	1N6BA06A66N546493

1N6AA06A86N544367	1N6BA06B46N545240	1N6AA06A26N545899	1N6AA06B46N546495
1N6BA06B16N544370	1N6BA06B86N545242	1N6AA06A96N545902	1N6AA06B86N546497
1N6AA06A26N544378	1N6BA06A06N545257	1N6AA06B56N545906	1N6BA06A86N546513
1N6BA06A56N544380	1N6BA06B36N545259	1N6BA06B36N545908	1N6AA06A66N546523
1N6BA06BX6N544383	1N6BA06A46N545262	1N6BA06A46N545911	1N6AA06A16N546526
1N6BA06A86N544390	1N6BA06B96N545265	1N6AA06B46N545914	1N6BA06A06N546540
1N6BA06B06N544411	1N6BA06B46N545268	1N6AA06A96N545916	1N6BA06B26N546547
1N6BA06B86N544415	1N6BA06A86N545278	1N6BA06A76N545918	1N6BA06AX6N546576
1N6BA06B46N544430	1N6BA06A16N545283	1N6BA06A76N545921	1N6BA06B96N546593
1N6BA06A46N544435	1N6AA06B06N545294	1N6AA06A66N545923	1N6AA06B56N546599
1N6BA06A16N544442	1N6AA06B56N545310	1N6BA06A86N545927	

# 2006 Titan King Cab Door Latch Campaign **Parts Order Form**

**INCOMPLETE ORDER FORMS WILL NOT BE PROCESSED.**

**Order Date:** \_\_\_\_\_

**Vin Number:** \_\_\_\_\_

**Dealer Code:** \_\_\_\_\_

**Fax Number:** \_\_\_\_\_

## **Note: VIN must be specified**

**Facing PDC:**

- Sacramento PDC
- Los Angeles PDC
- Dallas PDC
- Smyrna PDC
- New York PDC

- Orlando PDC
- Chicago PDC
- Greenville PDC
- Baltimore PDC

Part Number	Description	Qty.
82540-7S200	Lock Assy Rear Door, RH	1

Fax the completed form to: **(310) 771-2626**

Or Email to Email: [campaign.parts@nissan-usa.com](mailto:campaign.parts@nissan-usa.com)

Note: Most orders will ship out the day after they are received. The bottom of this form will be completed and faxed to the dealer if the order cannot be processed.

*To be completed by NNA Parts Department only.*

Parts are on back order. Estimated ship date for your order is \_\_\_\_\_.

Incomplete order form received. Please complete the form and resend.