

U.S. Department of Transportation

National Highway Traffic Safety Administration 1200 New Jersey Avenue, SE. Washington, DC 20590

December 28, 2007

WILLIAM R. WILLEN MANAGING COUNSEL AMERICAN HONDA MOTOR CO., INC. 1919 TORRANCE BOULEVARD TORRANCE CA 905012746 NVS-215dgl 07V-549

Subject: WIRE HARNESS OCCUPANT DETECTION SYSTEM

Dear MR. WILLEN:

This letter serves to acknowledge American Honda Motor Company, Inc.'s notification to the National Highway Traffic Administration (NHTSA) of a safety defect in the products described below, for which a safety recall campaign shall be conducted pursuant to 49 U.S.C. § 30119.

Please review the following information to ensure that it conforms to your records as this information is being made available to the public. If the information does not agree with your records, please contact us immediately to discuss your concerns.

Makes/Models/Model Years: HONDA/FIT/2007-2008

NHTSA Campaign Number: 07V-549

Mfg's Report Date: November 28, 2007

Components: AIR BAGS: FRONTAL

Potential Number of Units Affected: 34,300

Summary:

ON CERTAIN VEHICLES ORIGINALLY SOLD IN OR CURRENTLY REGISTERED IN THE STATES OF CONNECTICUT, DELAWARE, ILLINOIS, INDIANA, IOWA, KENTUCKY, MAINE, MARYLAND, MASSACHUSETTS, MICHIGAN, MINNESOTA, MISSOURI, NEW HAMPSHIRE, NEW JERSEY, NEW YORK, OHIO, PENNSYLVANIA, RHODE ISLAND, VERMONT, VIRGINIA, WEST VIRGINIA, WISCONSIN AND THE DISTRICT OF COLUMBIA. THE WIRE HARNESS FOR THE OCCUPANT DETECTION SYSTEM (ODS) AND THE OCCUPANT POSITION DETECTION SYSTEM (OPDS) IS ROUTED UNDERNEATH THE CARPET ON THE DRIVER'S SIDE FLOORBOARD. IN AREAS WHERE ROAD SALT IS USED, SALT FROM THE SNOW ON THE DRIVER'S SHOES WILL MELT AND MAY PENETRATE THE CARPET AND LEAK INTO THE WIRE HARNESS. IF THE HARNESS IS EXPOSED TO SALT BRINE, CORROSION MAY OCCUR AND THE WIRE MAY BREAK CAUSING THE SRS INDICATOR LIGHT TO ILLUMINATE. A FAILURE OF THE ODS AND OPDS MAY NOT DETECT THE PRESENCE OF A CHILD SEAT OR AN OUT-OF-POSITION PASSENGER AND DEPLOYMENT OF BOTH THE FRONT SEAT PASSENGER'S FRONTAL AND SIDE AIR BAGS WILL NOT BE SUPPRESSED.

Consequence:

IN THE EVENT OF A CRASH, A DEPLOYING FRONT PASSENGER AIR BAG OR FRONT PASSENGER'S SIDE AIR BAG WILL INCREASE THE RISK OF INJURY TO SMALL OR OUT-OF-POSITION OCCUPANTS.

Remedy:

DEALERS WILL INSPECT AND REPLACE THE WIRE HARNESS. THE RECALL IS EXPECTED TO BEGIN ON OR ABOUT DECEMBER 17, 2007. OWNERS MAY CONTACT HONDA AT 800-999-1009.

Notes:

CUSTOMERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO <u>HTTP://WWW.SAFERCAR.GOV</u>.

Please provide the following additional information and be reminded of the following requirements:

Copies of all notices, bulletins, dealer notifications, and other communications that relate to this recall, including a copy of the final owner notification letter and any subsequent owner follow-up notification letter(s), are required to be submitted to this office no later than 5 days after they are originally sent (if they are sent to more than one manufacturer, distributor, dealer, or purchaser/owner).

As stated in Part 573.7, submission of the first of six consecutive quarterly status reports is required within one month after the close of the calendar quarter in which notification to purchasers occurs. Therefore, the first quarterly report will be due on or before 30 days after the close of the calendar quarter.

Your contacts for this recall will be Pat Wallace or Delia Lopez, who may be reached by phone at 202-366-5232 or 202-366-9525 or by email at <u>Patricia.wallace@dot.gov</u>, <u>Delia.lopez@dot.gov</u>, or though the office email at <u>RMD.ODI@dot.gov</u>. We look forward to working with you for successful completion of this recall campaign.

Sincerely,

isn

George H. Person Chief, Recall Management Division Office of Defects Investigation Enforcement