



Mr. George Person
Chief, Recall Management Office
National Highway Traffic Safety Adm.
400 7th Street, S.W.
Washington, D.C. 20590

June 04, 2007

Dear Mr. Person:


Country Coach, LLC has decided that a non-compliance exists in 1,051 Model Years 2004 - 2007 Inspire motor homes manufactured between March 2003 and May 2007. Country Coach has determined that certain Inspire motor homes manufactured between March 2003 and May 2007 do not meet FMVSS No. 108, side marker lighting requirements. The side marker lights in the combination headlight and tail light assemblies do not meet the minimum photometric value at 45 degrees as specified in FMVSS No. 108.

The inadequacy of the front and rear side marker lights could affect visibility of the motor home during hours of darkness that could potentially result in a motor vehicle accident.

To date, there have been no reports of accidents caused by the conditions as stated above in any of the identified motor homes included in this proposed recall. To correct the situation as described above, the marker lights will be installed on the side of each motor home as close as reasonable to the front and rear corners and wired into the park light system. This work will be performed at no cost to the owner.

If you should have any questions, please feel free to contact me at 541-998-3720 x8382.

Sincerely,

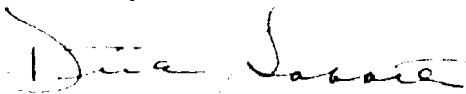

Dick Sabath
Senior Manager
Compliance Administration
Country Coach, LLC

Enclosures (1) Noncompliance Information Report, 573

National Highway Transportation Safety Administration

Non Compliance Information Report Pursuant to 49 CFR part 573

Country Coach, Inc. has decided that certain motor homes it manufactured have a non-compliance with FMVSS 108. Country Coach is hereby providing notification to your office in accordance with 49 CFR Part 573.

The information required by your regulations follows.

1. 573.5 (c) (1) Manufacturer's name and address.

Country Coach, LLC
135 East First Ave.
P.O. Box 400
Junction City, OR 97448

2. 573.5 (c) (2) Equipment involved in this notification:

Model Year: 2004 Inspire motor homes manufactured from March 2003 through March 2004

VIN Range: 4U7K5EK151103318 – 4U7K6EK1241103919

Vehicle Type: MPV

Bodystyle: Motor Home

Model Year: 2005 Inspire motor homes manufactured from March 2004 through February 2005

VIN Range: 4U7K6ES1751103920 – 4U7K6ES1551104712

Vehicle Type: MPV

Bodystyle: Motor Home

Model Year: 2006 Inspire motor homes manufactured from February 2005 through July 2006

VIN Range: 4U7K6ES1561104713 – 4U7K6ES1161061089

Vehicle Type: MPV

Bodystyle: Motor Home

Model Year: 2007 Inspire motor homes manufactured from July 2006 through May 2007

VIN Range: 4U7K6DS1371060198 – 4U7K6DB1271060312

Vehicle Type: MPV

Bodystyle: Motor Home

3. 573.5 (c) (3) Total number of items of equipment:

A total of 1051 motor homes are involved all of which are consumer owned.

Model Year 2004 – 172 Inspire motor homes

Model Year 2005 – 352 Inspire motor homes

Model Year 2006 – 431 Inspire motor homes

Model Year 2007 – 96 Inspire motor homes

4. 573.5 (c) (4) Approximate percentage of equipment estimated to actually contain the noncompliance:

100% of the motor homes identified in item 2, above, have the non compliance.

5. 573.5 (c) (5) Description of the non-compliance:

Country Coach has determined that certain Inspire motor homes manufactured between March 2003 and May 2007 do not meet FMVSS No. 108, lighting requirements. The side marker lights in the combination headlight and tail light assemblies do not meet the minimum photometric value at 45 degrees as specified in FMVSS No. 108.

The inadequacy of the front and rear side marker lights could affect visibility of the motor home during hours of darkness that could potentially result in a motor vehicle accident.

Detailed description of non-compliance:

Country Coach Inspire motor homes manufactured between March 2003 and May 2007 with side marker lights in the combination headlight and tail light assemblies do not meet the minimum photometric values at 45 degrees. Both side marker lights fail to comply with FMVSS 108.

6. Chronological summary of events leading to this determination:

On May 24, 2007, while reviewing photometric tests it was discovered the side marker light functions of the combination head and tail lights did not meet the minimum photometric values of FMVSS 108. A Country Coach investigation was opened and on May 29, 2007 it was determined that a noncompliance existed.

7. 573.5 (c)(8) Description of proposed remedy:

Country Coach has determined that the repair for this defect will require 1 1/2 hours of labor. Marker lights will be placed on the side of each motor home as close as reasonable to the front and rear corners and wired into the park light system. The repairs are to be performed at no cost to the owner.

8. Program for Remedy Campaign:

Country Coach will notify all owners of the affected motor homes and will offer to remedy the motor homes free of charge. Non compliance recall notices will be mailed to the owners of the affected motor homes and a Dealer Vehicle Non Compliance Service Bulletin will be mailed to all dealers on or before 21 June 2007. All mailings will be by Certified Mail, Return Receipt Requested, and First Class Mail.