

**GM SERVICE AND PARTS OPERATIONS
DCS1827
URGENT - DISTRIBUTE IMMEDIATELY**

Date: August 9, 2007

Subject: Upcoming Noncompliance Recall 07177
ABS Rear Wheel Brake Drag

Models: 2007 Chevrolet Express and GMC Savana

To: All Chevrolet and GMC Dealers

Attention: Dealer Operator, General Manager, Sales Manager, Service Manager,
Used Car Manager, Parts Manager and Warranty Administrator

Based on information from the National Highway Traffic Safety Administration (NHTSA) website, the media may report that General Motors will be announcing a noncompliance recall involving certain 2007 model year Chevrolet Express and GMC Savana vehicles.

These vehicles fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) 108, Lamps, Reflective Devices and Associated Equipment, requiring the illumination of the stop lamps whenever the brakes are applied. When the brakes are applied on these vehicles, the stop lamps will illuminate. When the brake pedal is released, the stop lamps are no longer illuminated but the rear brakes may still be applied. The brake may release after a few seconds or after the next firm brake pedal application. If the rear brakes are still applied after the release of the brake pedal, the driver may notice a substantial drag when driving and may need to depress the gas pedal further than usual to continue vehicle movement. A vehicle driven with the brakes applied can cause overheating of the brakes, resulting in increased stopping distance.

To correct this condition, dealers will be required to reprogram ABS module.

A total of 10,113 vehicles are involved. Dealers will be notified when customer notification letters are scheduled to be mailed.

GM Vehicle Inquiry System (GMVIS) information for this recall will not be available until the recall bulletin is released to dealers.

END OF MESSAGE
GM SERVICE AND PARTS OPERATIONS