



October 22, 2007

FedEx Ground
1000 FedEx Drive
Moon Township, PA 15108

Re: Safety Recall; Utilimaster 2007 Walk-In Delivery Vans; Campaign Number 07V-463
Equipped with Square Halogen or Incandescent Headlamp Assemblies

Dear Customer:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Utilimaster Corp. has decided that a defect that relates to motor vehicle safety exists in the above-referenced delivery vans that Utilimaster produced and supplied to you (Vehicle Identification and Asset Numbers attached).

Utilimaster, as a precautionary measure, is conducting this recall campaign with respect to the vehicle population with the headlight assemblies that were assembled onto Utilimaster Walk-In Delivery Vans between June 8, 2007 and August 22, 2007.

Description of Defect

The electrical connector that attaches to the headlamp is mis-wired. The condition results in the headlamps operating at reduced brightness. Poor lighting from the headlights could cause reduced road visibility, increasing the risk of a crash.

Remedy

Utilimaster will provide detailed instructions for the inspection of the wiring and, without charge, a replacement headlight assembly for those found to be defective. Utilimaster will also compensate you for the labor cost of this inspection, which should take 0.2 hr. to complete and for the labor cost of replacement and realignment of mis-wired headlight modules. The labor charges should be submitted through normal warranty channels to Utilimaster.

Attached is a technical service bulletin, which documents the remedy service. Utilimaster is prepared to proceed with the recall during the week of October 22, 2007, and the headlight assemblies will be available for shipment to you at that time.

Utilimaster regrets any inconvenience to you as a result of this recall, but knows that you share our interest in the safety and satisfactory performance of Utilimaster vehicles. We appreciate your assistance and cooperation. Please do not hesitate to telephone me if you have any questions.

If you believe that Utilimaster is unable to complete the necessary remedy without charge within a reasonable time, you may so advise the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

Sincerely,

A handwritten signature in black ink, appearing to read "Glen Garman", written over a horizontal line.

Glen Garman
Director of Quality
Utilimaster Corp.
Tel: 574/862-7606; fax: 574/862-3552

cc: C.H. Grigorian
Utilimaster counsel

Vehicle Identification Numbers/Asset Numbers Affected by This Safety Recall
#07V-463

VIN	Asset Number
5B4KPD25583428070	73376
5B4KPD25783428071	73377
5B4KPD25183428079	73385
5B4KPD25883428080	73386
5B4KPD25X83428081	73387
5B4KPD25383427077	744386
5B4KPD25X83427125	744395
4UZAARDU98CZ59003	85402
4UZAARDU68CZ59010	85409
4UZAARDU28CZ59022	85421
4UZAARDU28CZ59036	85435
4UZAARDU88CZ59039	85438

ATC Headlight Connector—Campaign Directive

Situation: Headlight bulb connectors potentially wired improperly, causing inadequate lighting performance.

Corrective Action Summary: Visually inspect the headlight connectors. Replace headlight bucket assemblies as needed.

Units Affected: Aeromaster walk-in vans produced between June 8, 2007 and August 22, 2007.

NOTE: Lighting units could be incandescent or halogen.

Parts Required: Halogen P/N-16513036 or Incandescent P/N-15206129

Tools Required:

- #2 Phillips screwdriver
- #3 Phillips screwdriver
- 7/16" Nut driver (power optional)
- Step stool

NOTE: Read and understand all instructions before starting work.

Inspection: Verify correct wiring of bulb connector.

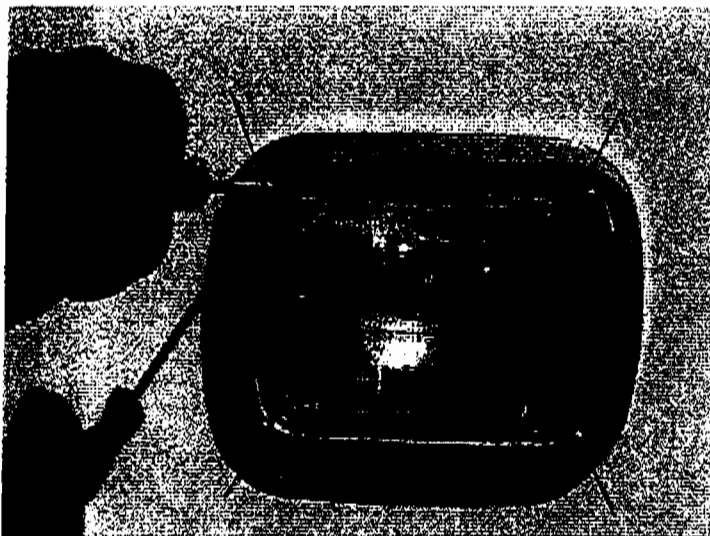


Figure 10. Remove headlight bezel.

CAUTION: Ignition and lights must be in the "OFF" position before disassembly.

ATC Headlight Connector—Campaign Directive

NOTE: Only one or both headlights may be affected.

1. Remove the headlight bezel held in place by (4) screws and set aside. Figure 10.

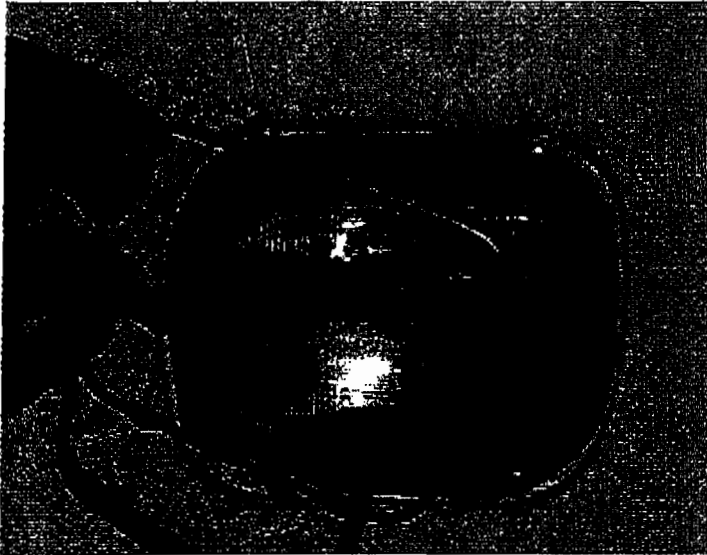


Figure 20. Remove retaining ring.

2. Remove the retaining ring held by (4) screws and set aside. Figure 20.
3. Remove the (sealed beam) headlamp unit and pull off the bulb connector.

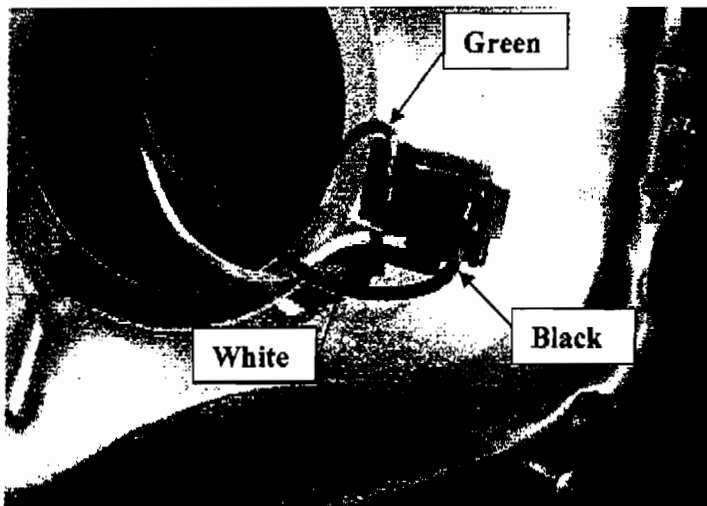


Figure 30. Correctly wired bulb connector. (Viewed from backside)

4. Look at the orientation of the connector and the positions of the green, white and black wires, and compare with Figure 30 for the CORRECT locations.

CAUTION: Should the wiring be INCORRECT, the headlight bucket needs to be REPLACED!

5. Reassemble and order replacement buckets as necessary.

ATC Headlight Connector—Campaign Directive

Replacement Procedure:

1. Remove the headlight bezel held in place by (4) screws using the #2 Phillips screwdriver and set aside.
2. Lift up the hood and unplug the harness.
3. Remove the (4) large head Phillips screws and nuts that hold the headlamp bucket and backer (steel) to the hood using the #3 Phillips screwdriver and 7/16" nutdriver and set aside.
4. Install the replacement bucket and backer.
5. Connect the harness.
6. Install the bezel.
7. Align headlight.
8. Return lamp to:

ATC Lighting and Plastics
ATTN: Dawn Stitt
101 Parker Dr
Andover, OH 44003

NOTE: Use UPS account #00V49R.

Order Parts and File Warranty:

Email: Warranty@Utilimaster.com

Phone: 800-237-7806

Fax: 574-862-3552

Mail or Express Service:

Utilimaster Corp.
Attn: Warranty Dept.
65528 State Road 19
Wakarusa, IN 46573-0585
U.S.A.

Labor Allowance:

Up to 0.20 hours for inspection (per side)

Up to 0.50 hours for replacement (per side)

Job Op Code: 13-84-18-F5 NHTSA Campaign Number: 07V-463

Document Part Number: 03102510-D006EN

Revision: A