

Federal Recall Information

707-H

Supplier

Peterbilt Motors

Description

Peterbilt Motors is issuing a recall for certain tie rod and brackets installed in Medium Duty vehicles.

Release Date

TBD

Introduction

Peterbilt Motors has determined that a defect which relates to motor vehicle safety exists in some Models 335 and 340 manufactured February 28, 2007 through March 8, 2007.

Situation

The suspect vehicles have insufficient clearance between the positive post on the alternator and the radiator tie rod and tie rod bracket.

The close proximity could enable an electrical arc which could ignite a fire in the engine compartment and may result in property damage or personal injury.

The picture below shows the tie rod and positive post of the alternator.



Resolution

Peterbilt Motors is issuing this recall to replace the tie rod and tie rod bracket.

The labor for this recall is 0.8 hours to replace these parts.

It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.

Warranty

The DWC system will indicate chassis involved in this recall with the designator of "707-H" in the campaign field.

Enter a standard warranty claim using the following codes:

Failure location	042-002-017 Radiator Tie Rod
Failure type	705 Federal Recall
Claim type	C
Campaign Number	707-H

Parts

Peterbilt will cover parts purchased through Paccar Parts (dealer net+ 30% parts mark up) according to the schedule below.

PARTS			
Qty	Part Number	Description	DealerNet(USD)
1	F65-6044-514094	RH Rail Tie Rod	26.47 ea
1	23-16447	RH Rail Tie Rod Bracket	tbd ea


Labor

Peterbilt will cover labor according to the schedule below.

Labor		
042-XXX	0.8 hr	R & R Radiator Tie Rod and Tie Rod Bracket

Parts return are not required.

Procedure

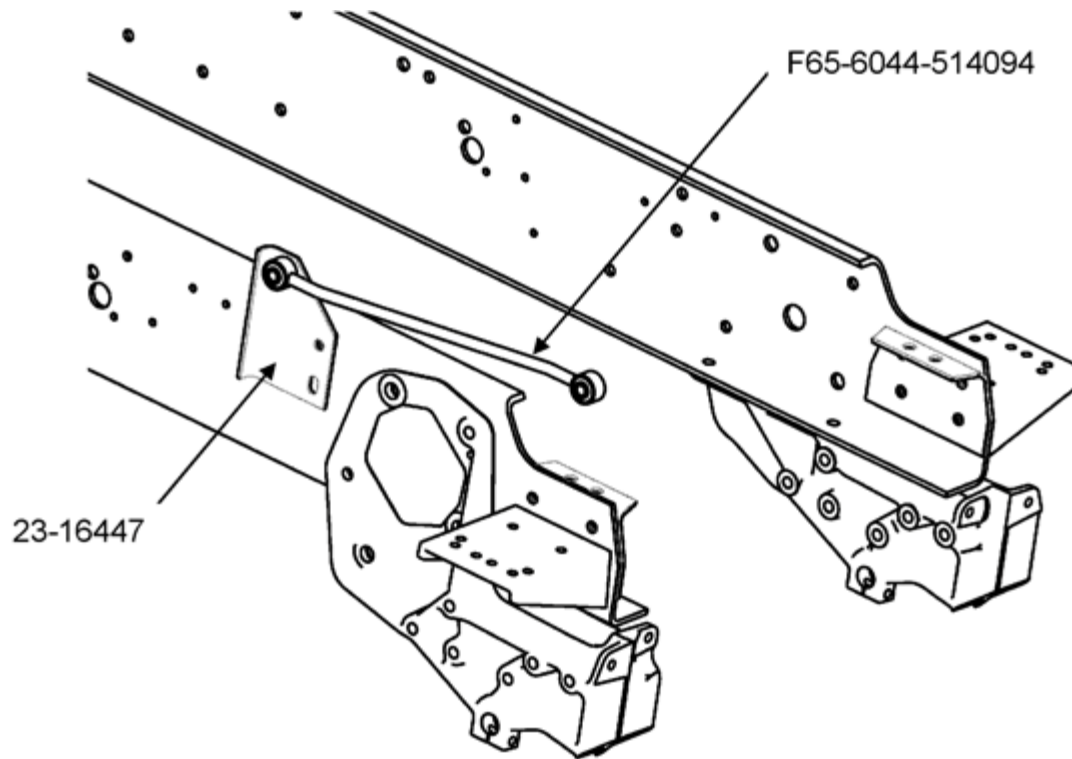

Remove old tie rod and tie rod bracket from the Right Hand frame rail. The new bracket mounts to the same holes of the existing bracket.

Please refer to drawing D97-6112S03 for installation purposes.



d976112s03.pdf

The image below shows the relative position of the new components to the alternator positive post.



Shipping

Freight

Contact

Attachments



707Hdealerchassislist.pdf

© Copyright 2007 PACCAR Inc, All Rights Reserved.