



SI M71 02 07
Tools and Accessories (Engine-Chassis)

January 2008
Technical Service

PERFORM THE PROCEDURE OUTLINED IN THIS SERVICE INFORMATION ON ALL AFFECTED VEHICLES BEFORE CUSTOMER DELIVERY OR THE NEXT TIME THEY ARE IN THE SHOP FOR MAINTENANCE OR REPAIRS.

Under the National Traffic and Motor Vehicle Safety Act of 1966, as amended, if there has been a recall campaign, dealers must assure that all new vehicles and new items of replacement equipment are free of safety defects and comply with all applicable Federal Motor Vehicle Safety Standards at the time of delivery to the consumer. This means that dealers may not deliver new motor vehicles or new items of replacement equipment to consumers unless the safety defect or noncompliance has been remedied before delivery.

SUBJECT

Recall Campaign 07V-533: Inspect Tire Information Placard

MODEL

Cooper S Convertible (R52)

SITUATION

Certain vehicles were produced with the incorrect Tire Information Label installed. The Tire Information Label may not reflect the actual tire size fitted on the vehicle. This Recall Campaign is being performed to inspect and correct the label as necessary.

Customers will receive notification letters, installation instructions and a Tire Information Label. Customers will be given the option of installing the label themselves or having an authorized MINI dealer perform the procedure. Copies of the Customer Letter and installation instructions are attached to this bulletin.

AFFECTED VEHICLES

This Recall Campaign involves Cooper S Convertible models which were produced from March 2nd 2007 to August 18th 2007.

In order to determine if a specific vehicle is affected by this Recall Campaign, it will be necessary to utilize the "Service Menu" of DCSnet (Dealer Communication System) or the Key Reader. Based on the response of the system, either proceed with the corrective action or take no further action.

The Chassis Number Ranges listed below are **only** for informational purposes and are not to be considered as the only deciding factor.

Model

Chassis Number Range

Cooper S Convertible with manual transmission TJ43548 – TJ45099

Cooper S Convertible with automatic transmission TL94294 – TL95910

PROCEDURE

Open the driver's door and inspect the Tire Information Label located on the B-pillar. The affected vehicles were produced with 205/45 R17 tires.


If the tire size listed on the label is 205/45 R17, no further action is necessary.

If the tire size listed on the label is not 205/45 R17, wipe off the label with a clean, lint-free cloth and apply a new label directly over the existing label.

PARTS INFORMATION

Part Number	Description	Quantity
71 24 6 765 840	Tire Information Label	1

LABEL INSTRUCTIONS

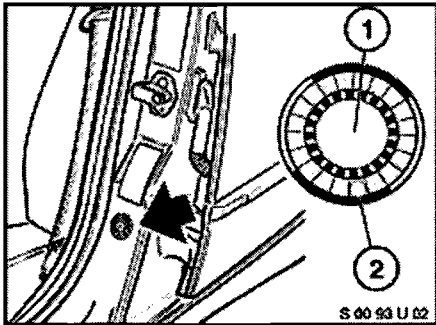

This Recall Campaign has been assigned code number 34. After the vehicle has been checked and corrected, obtain a label (MD 20-036), if necessary, and:

- a. Emboss your MINI dealer warranty number in the middle of the label (1);
- b. Punch out code number 34 (2), printed on the label; and
- c. Affix the label to the B-pillar as shown.

If the vehicle already has a label from a previous Service Action/Recall Campaign, affix the new label next to the old one. Do not affix one label on top of another one because a number from an underlying label could appear in the punched-out hole of the new label.

WARRANTY INFORMATION

Covered under the terms of the MINI New Vehicle Limited Warranty.

Defect Code 00 71 33 01 00

Labor Operation: 00 57 817 Checking/replacing tire information label

Labor Allowance: 1 FRU

ATTACHMENTS

view PDF attachment [M710207Instructions.](#)

view PDF attachment [M710207Letter.](#)

view PDF attachment [M710207TREAD.](#)

[MINI, a division of BMW of North America, LLC

Copyright © 2008 BMW of North America, LLC]