



AMERICAN SUZUKI MOTOR CORPORATION

June 2, 2008

Mr. Daniel Smith
Associate Administrator for Enforcement
National Highway Traffic Safety Administration
1200 New Jersey Avenue, SE
Washington, D.C. 20590

08V-249
(17 pages)

Dear Mr. Smith:

The following information is submitted in accordance with the defect reporting regulations in Title 49 of the Code of Federal Regulations, Part 573.

1. Name of Manufacturer and Importers

Manufacturer: Suzuki Motor Corporation

Importers:

Continental U.S.	- American Suzuki Motor Corporation
Hawaii	- Montgomery Motors, Inc.
Puerto Rico	- Suzuki Del Caribe, Inc.

2. Identification of Motor Vehicles Involved

Affected vehicles are all 2008 model year Suzuki GSX1300R motorcycles produced prior to March 19, 2008. Affected motorcycles have a Vehicle Identification Number in the following range:

JS1GX72A*82100020 - JS1GX72A*82112289

3. Total Number of Motor Vehicles Involved

9,109

4. Percentage of Motor Vehicles Estimated to Contain the Defect

Unknown

RECEIVED

2008 JUNE -3 A 10:35

DEFECTS INVESTIGATION
RECALL MGMT DIV.

5. Description of Defect

Improper routing of the ignition switch wiring harness can cause a bent portion of the wiring harness to flex rather than slide when the handlebar is moved from right to left or left to right. Repeated side-to-side movement of the handlebar, and flexing of the bent portion wiring harness, can eventually cause the ignition switch lead wires to become cut or broken. This can result in intermittent or complete loss of electrical power, which can result in loss of lighting and/or stalling of the engine. Attached is a draft Service Bulletin that describes this condition.

6. Chronology of Principal Events

March, 2008 - Suzuki Motor Corporation (SMC) received a report from a dealership in a foreign market concerning a motorcycle that experienced loss of electrical power when the handlebar was turned from right to left or left to right. SMC initiated an investigation to determine the cause and extent of the condition.

7. Description of Corrective Action

ASMC, Montgomery Motors, Inc., and Suzuki del Caribe, Inc. will conduct a safety-related recall campaign to inspect all affected motorcycles. Unsold motorcycles in dealer inventory that have misrouted wiring harnesses will have the wiring harnesses re-routed. For motorcycles which have been sold to customers and are found to have misrouted wiring harnesses, Suzuki dealers will replace the lower portion of the ignition switch (which contains the ignition switch lead wires) and will make sure that the wiring harness is properly routed.

ASMC is planning to notify dealers about the recall on June 6, 2008, and currently expects to notify owners about the recall on June 10, 2008. We expect that Suzuki distributors in Hawaii and Puerto Rico will follow a similar schedule.

Since the cost of any pre-notification repairs would have been covered under warranty, we understand that it is not necessary to specify a reimbursement plan or notify owners about the eligibility for reimbursement of the cost of pre-notification repairs.

8. Copy of Notices


Enclosed is a copy of the initial notification letter that Suzuki Motor Corporation sent to ASMC, and a copy of ASMC's draft Service Bulletin and draft owner notification letter for the recall campaign that will be conducted.

9. Suzuki Campaign Number

2A05

Sincerely,

AMERICAN SUZUKI MOTOR CORPORATION

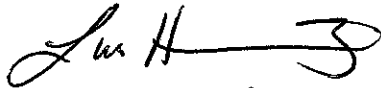

On behalf of,
Kenneth M. Bush
Associate Director, Government Relations



Service Bulletin

MOTORCYCLE / ATV DIVISION

4 - STROKE
GS/GSX/GSX-R BULLETIN NO. 183
DATE: 6/6/2008

**SAFETY RECALL CAMPAIGN #2A05
CERTAIN 2008 GSX1300RK8 MOTORCYCLES
IGNITION SWITCH INSPECTION/REPLACEMENT**

**SUBJECT: RECALL CAMPAIGN - IGNITION SWITCH INSPECTION/
REPLACEMENT**

AFFECTED UNITS: CERTAIN 2008 GSX1300RK8 MOTORCYCLES

REFERENCE: GSX1300R SERVICE MANUAL (PN 99500-39350-03E)

ATTACHMENT: CUSTOMER LETTER

WHAT IS THE PROBLEM?

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Suzuki Motor Corporation has determined that certain GSX1300RK8 motorcycles may have the ignition switch lead wire improperly routed. Handlebar movement can result in abnormal flexing and damage to the ignition switch lead wire. Damage to the ignition switch lead wire can result in intermittent or complete loss of electrical power, which can result in loss of lighting and/or stalling of the engine. This could result in a crash.

STOP DELIVERY OF 2008 GSX1300RK8 MOTORCYCLES IMMEDIATELY

DO NOT DELIVER an affected **NEW** or **USED** 2008 GSX1300RK8 motorcycle to a customer until you have completed, or verified completion of, the procedures in this bulletin.

It is a violation of Federal law to deliver any new vehicle subject to a safety recall campaign under a sale or lease until the defect or noncompliance has been corrected. You must verify this on the Suzuki "Certificate of Vehicle Pre-Delivery" form, which is to be completed for all new and used vehicle sales.

WHAT WILL SUZUKI DO?

Suzuki is recalling affected units for inspection of the ignition switch lead wire routing. You will correctly reroute or replace the ignition switch lead wire portion of the ignition switch assembly. Instructions are provided in this bulletin for correct routing and replacement of the ignition switch lead wire to prevent failure.

AFFECTED UNIT VIN RANGES:


The VIN ranges of the affected GSX1300RK8 models are listed below. Confirmation of an affected unit can be checked on Suzuki Connect.

Starting VIN	Ending VIN
JS1GX72A*82100020	JS1GX72A*82111031
JS1GX72A*82111267	n/a
JS1GX72A*82111546	JS1GX72A*82111605
JS1GX72A*82111700	n/a
JS1GX72A*82111726	JS1GX72A*82111753
JS1GX72A*82111755	JS1GX72A*82111756
JS1GX72A*82111759	n/a
JS1GX72A*82111766	JS1GX72A*82111773
JS1GX72A*82111775	n/a
JS1GX72A*82111785	JS1GX72A*82111943
JS1GX72A*82111945	JS1GX72A*82112167
JS1GX72A*82112169	n/a
JS1GX72A*82112171	JS1GX72A*82112289

VERIFY THE UNIT REQUIRES THE RECALL REPAIR:

Before performing the recall inspection to a unit, verify that the inspection needs to be done. There are two ways to identify a unit that has already been repaired.

 1. Check the repair status by checking the Vehicle History in the Suzuki Connect Service Menu. If the repair needs to be performed to the motorcycle, you will see the message "CAMPAIGN NOT YET PERFORMED" displayed and the ignition switch lead wire routing will need to be inspected. Refer to the inspection procedure in this bulletin.
2. Inspect the right side of the frame head tube for an identification punch mark located **at the beginning** of the Vehicle Identification Number. If a punch mark is present the recall repair has already been performed.



WHAT YOUR DEALERSHIP WILL DO:

Notify your staff.

Contact your customers; please telephone all of your customers and inform them of the need to stop riding their motorcycles until the ignition switch lead wire inspection/replacement has been completed.

NOTE:

If your dealership has sold an affected GSX1300RK8 to a customer, but you have not yet submitted sales registration entry, send the sales information to American Suzuki AT ONCE. We will send the customer an owner notification letter when we receive the sales information from your dealership.

Since only you know the identity of these customers, you must immediately notify these customers of the recall campaign.

CUSTOMER NOTIFICATION:

In the Safety Recall Campaign letter that will be mailed on June 10, 2008 (see attachment), customers are being advised to contact the Suzuki dealer where they purchased their affected unit to schedule an appointment to have the ignition switch lead wire inspected. As some customers may have moved to other communities since their motorcycle purchase, you may also receive calls from customers who purchased their Suzuki elsewhere. Once you are contacted by the owner of an affected unit, please arrange an appointment for a recall inspection. Also, advise your customers that the Safety Recall Campaign service will be performed at no cost to them for parts and labor.

IMPORTANT:

Successful completion of this safety recall campaign depends on your efforts. It is your responsibility to repair any affected GSX1300RK8 within the VIN range at no cost to the customer for recall service parts and labor. Incidental costs your customers may incur are not normally covered. However, if you have a customer with special needs, contact your Technical Service Manager (800/756-3251) to discuss possible solutions.

ORDERING PARTS FOR THE SAFETY RECALL CAMPAIGN:

You will be responsible for ordering the ignition switch kit for any customer's motorcycle which had an incorrectly routed ignition switch lead wire. Order the switch kit using your normal parts ordering methods. New, unsold units at your dealership will not require a replacement ignition switch kit. Parts are currently available for this campaign.


Ignition Switch Set		PN 99103-11237	Dealer Cost-\$85.03
	Description	Qty	Note
1	Ignition Switch	1	
2	Screws	2	Mounted on Ignition Switch
3	Bolt, M8	2	Torx head, Pre-coated bolt
4	Cap	2	

SPECIAL TOOL AUTO-SHIPMENT


The special tool needed to disassemble the lock cylinder assembly will be auto-shipped separately at no cost to your dealership during the week of June 9, 2008.

IGNITION SWITCH LEAD WIRE INSPECTION, REROUTING OR REPLACEMENT STEPS

New Unsold Unit (Dealer Inventory)

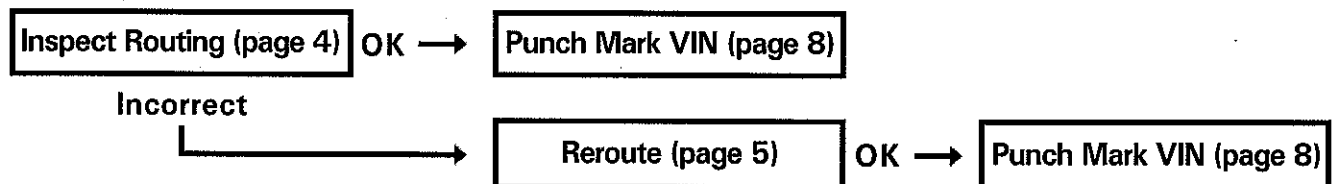

Customer Unit (Sold) / Dealer Demo Unit

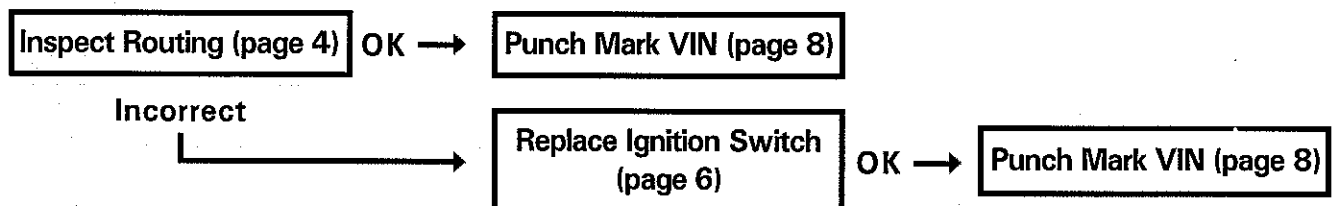

INSPECT ROUTING

1. Remove the upper and lower meter panels (refer to Service Manual page 9D-15).
2. Check if the ignition switch lead wire is clamped and routed correctly. Incorrect positions are shown in Figures 1 and 2. Correct routing and clamping is shown in Figures 3 and 4 on page 5.






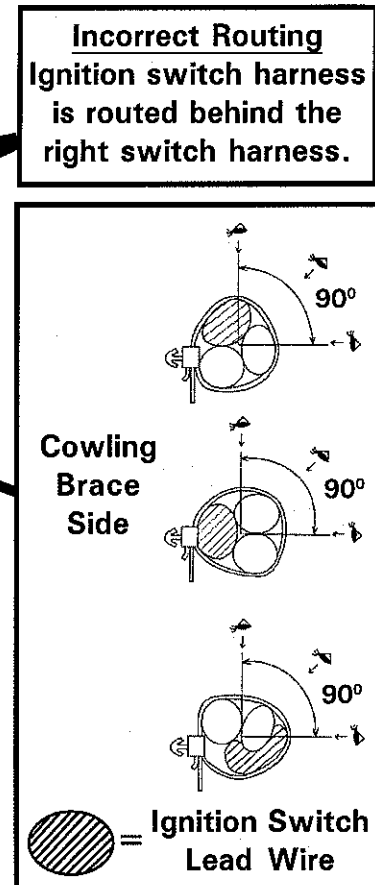


Figure 3


Correct

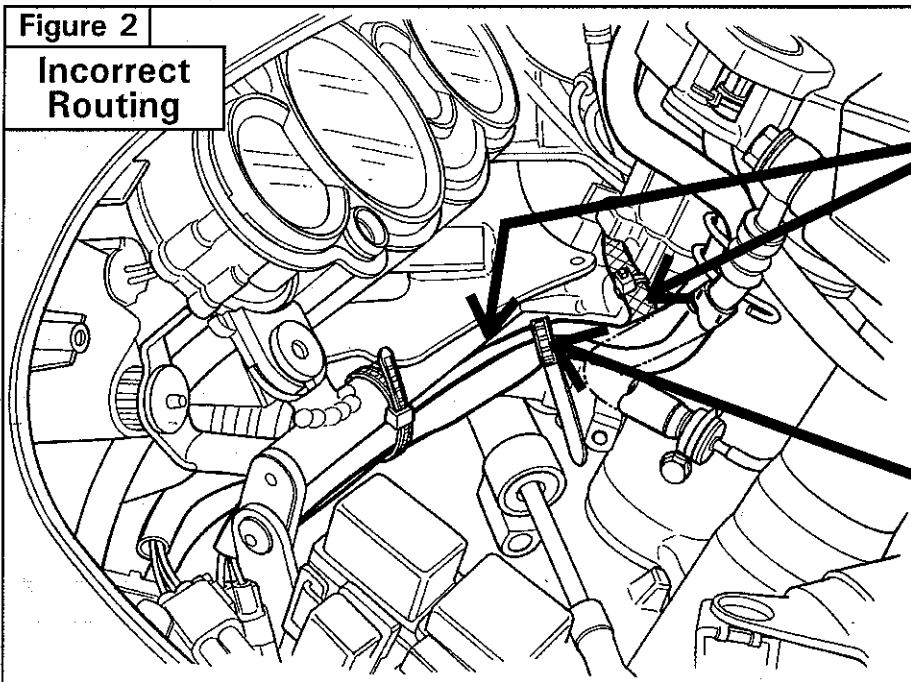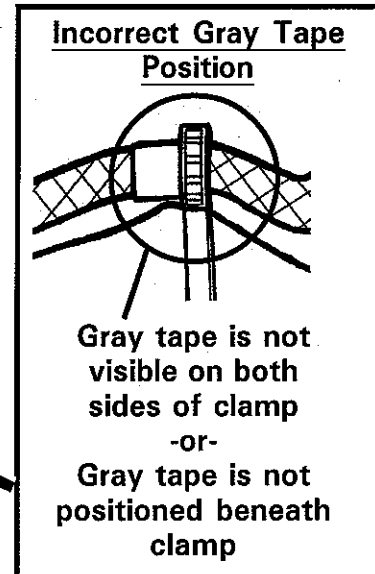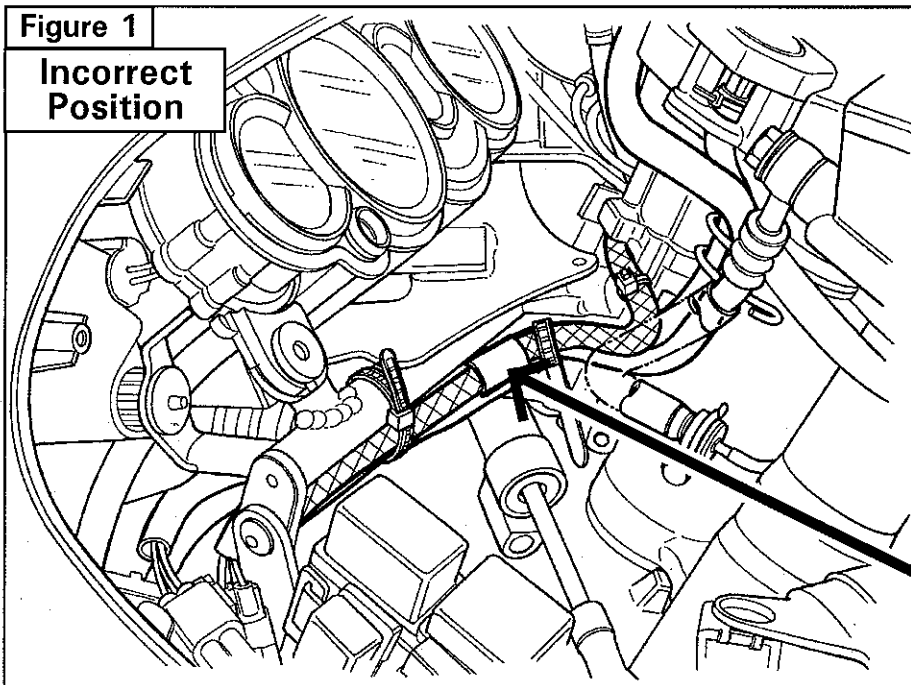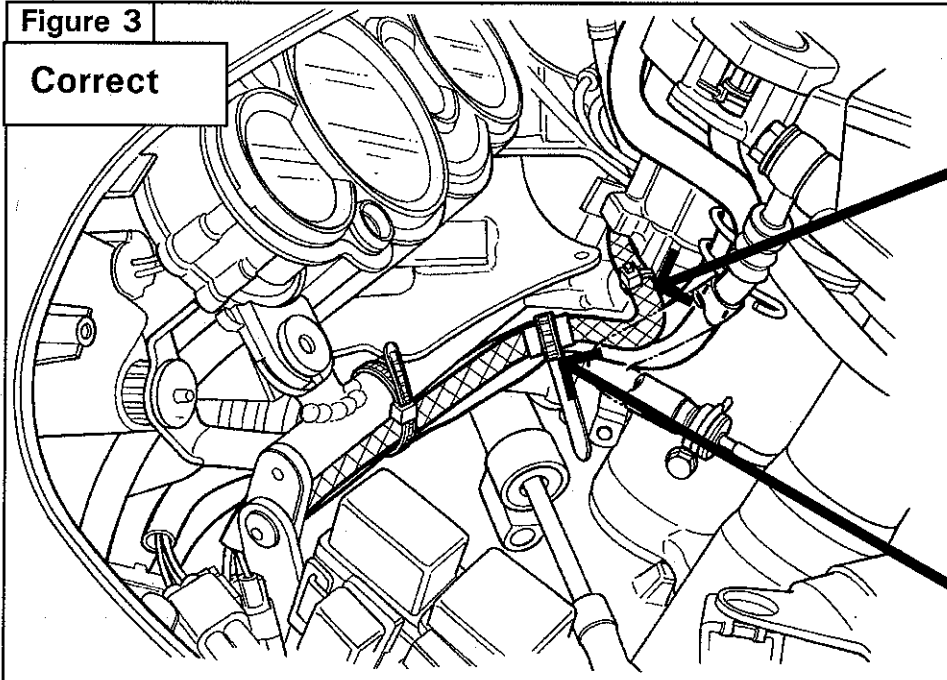

Correct Routing
The ignition switch lead wire is routed in front of the right switch lead wire.

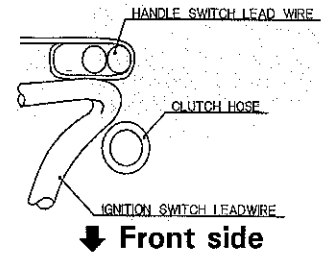


Correct Gray Tape Location

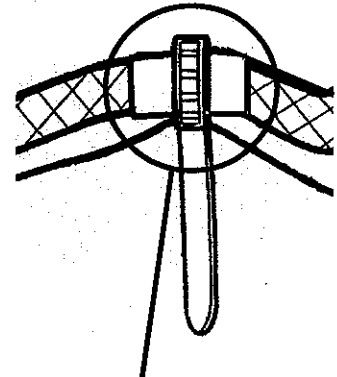

Gray tape is visible on both sides of clamp.

Correct

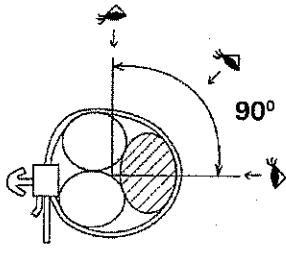

Correct

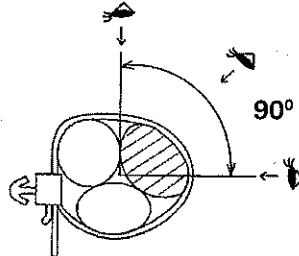


Figure 4

REROUTING

1. Reroute the ignition switch lead wire correctly (Figure 3 and Figure 4). The ignition switch lead wire should not be covered by the other wire harnesses.
2. Turn the handlebars back and forth to verify that the steering operates smoothly and the wiring harness does not become kinked or pinched.
3. Proceed to PUNCH MARK AT VIN on page 8.

REPLACEMENT OF IGNITION SWITCH (Customer Sold Units/Dealer Demo Units- Only If Inspection Shows Incorrect Routing And Unit Has Been Ridden)

New Ignition Switch Disassembly

1. Remove the ignition switch assembly from the motorcycle (refer to Service Manual page 1H-12).
2. Remove the two black plastic covers to access the cylinder cap mounting bolts (Figure 5).
Note: The black plastic covers will not be reused.
3. Secure the mount area (bottom) of the ignition switch in a vise (Figure 6).

NOTE:

Turn the ignition switch to the OFF position and remove the key from the ignition switch before disassembling the switch.

TOOL Remove the two "break-off" screws from the ignition switch using the special screwdriver. Set the stepped end of the sleeve on the special screwdriver facing toward the "break-off" screws (Figure 7). Strike the special screwdriver 5 to 7 times with a hammer to produce a deep enough groove on the screw head for the screwdriver to work properly (Figure 6). Pay attention not to hit other parts with the hammer. Turn to remove the "break-off" screws in a counter-clockwise direction. If the groove becomes damaged, make another groove at a 90° angle to the original groove.

▲ CAUTION

When striking an object with a hammer parts can fly up, hitting you in the eyes and cause blindness or injury.

Always wear eye protection when using a hammer.

4. Remove the ignition switch from the vise and hold it upright over the workbench and carefully remove the cylinder cap (Figure 8).

NOTE:

Pay close attention to the order and orientation of the ignition switch parts during disassembly.

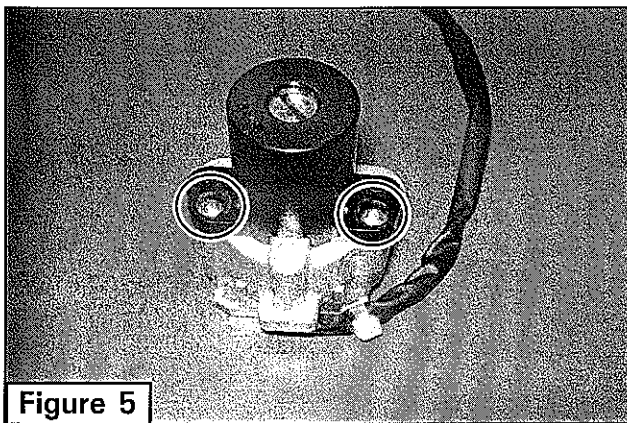


Figure 5

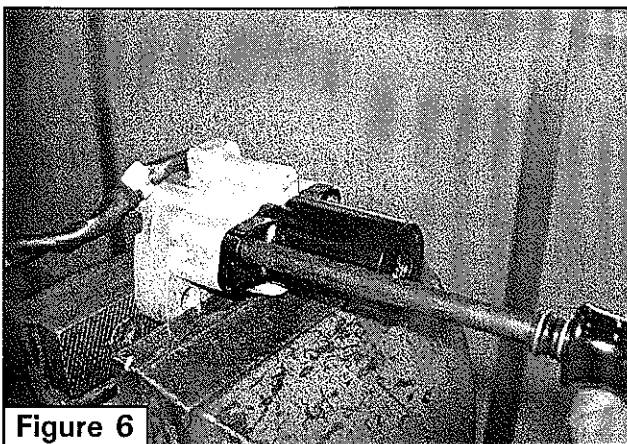


Figure 6

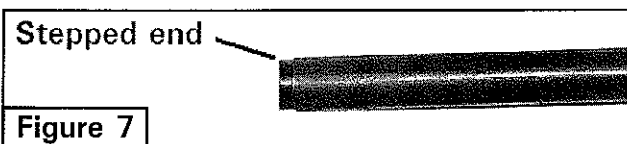


Figure 7

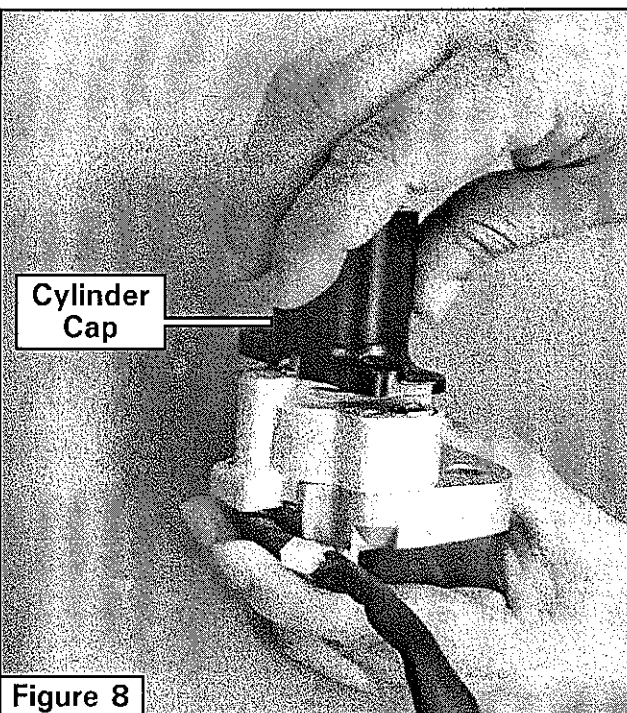


Figure 8





- Remove the shutter. The shutter may come off the ignition switch in the cylinder cap, but is not secured to the cap. Remove the rotor and spring from the ignition switch. When the rotor is removed, the spring may be attached to the rotor, but it will not be secured. The cylinder cap, shutter, rotor, and spring will be used for reassembly of the new switch. Keep these parts in a safe, clean location. Discard the ignition switch body and harness assembly.

New Ignition Switch Disassembly

- Using a philips screwdriver, carefully remove the "break-off" screws from the new ignition switch (these screws are hand-tightened) and keep them for reassembly of the new ignition switch.
- Remove the cylinder cap, shutter, rotor, and spring. These parts will not be reused for reassembly of the new switch.

New Ignition Switch Reassembly

- Begin reassembly using the main body of the new ignition switch. The new (recall kit) ignition switch body can be identified by the letter "A" at the end of the lot number (Figure 10).
- Set the spring from the original ignition switch onto the projection in the new ignition switch body (Figure 11).
 - Install the rotor from the original ignition switch into the new ignition switch body. There is only one correct position (Figure 12) to install the rotor into the ignition switch body. Note the position of the tumbler plates when the rotor is installed. When installed in the correct position, the rotor will drop into the new ignition switch body smoothly and easily. Do not force or push the rotor into the ignition switch or damage may occur.

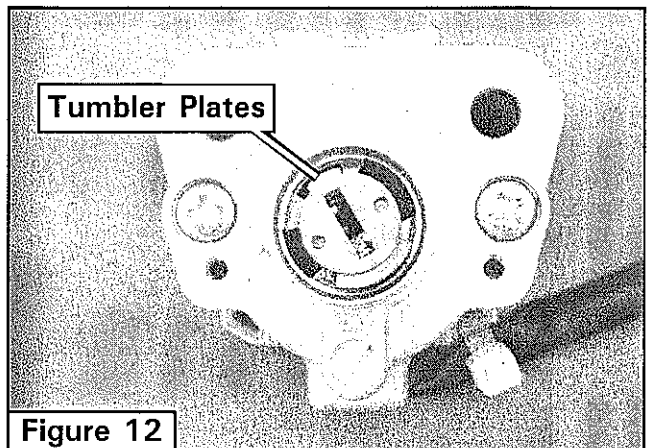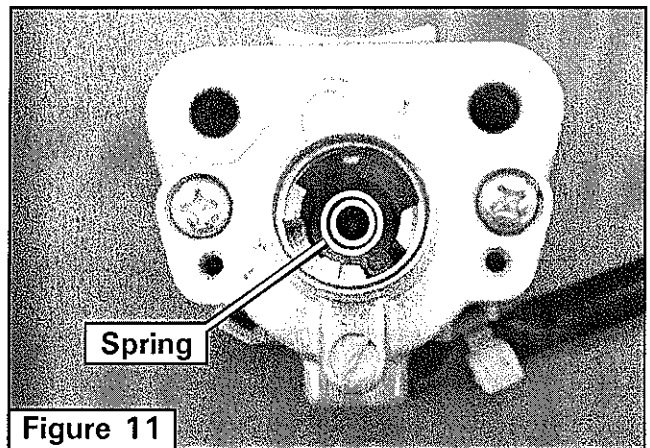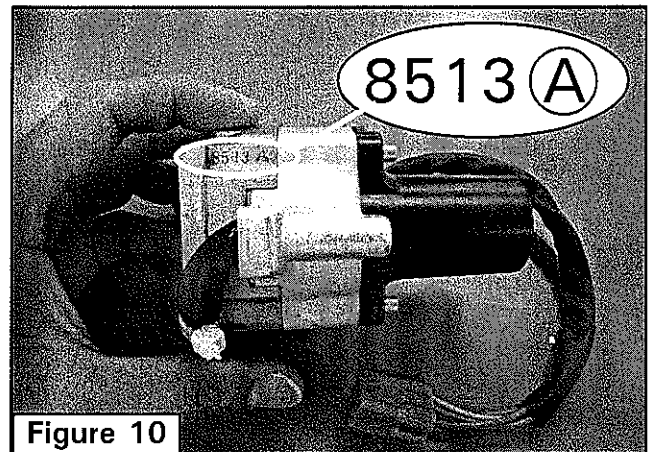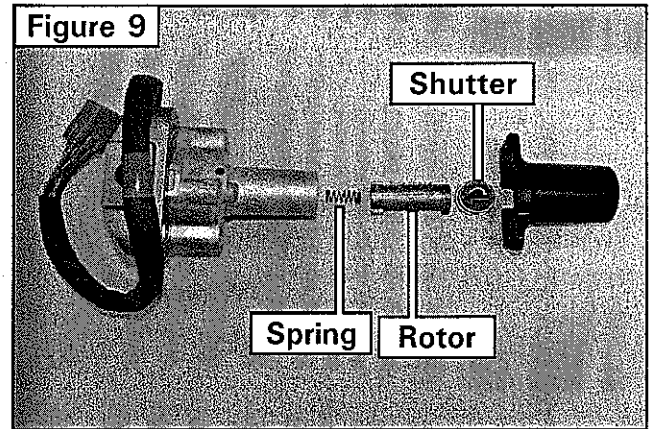

10. Place the shutter from the original ignition switch on the rotor, aligning and placing the projections into the hollows (Figure 13). The shutter can be aligned one of two ways 180° apart. Either way is correct.
11. Place the cylinder cap over the key cylinder and hold it firmly in position. Insert the ignition key and test the rotation of the rotor. If the rotor does not turn smoothly, remove the cap and check the assembly, making any necessary corrections. Repeat the procedure until the rotor turns smoothly when using the key.

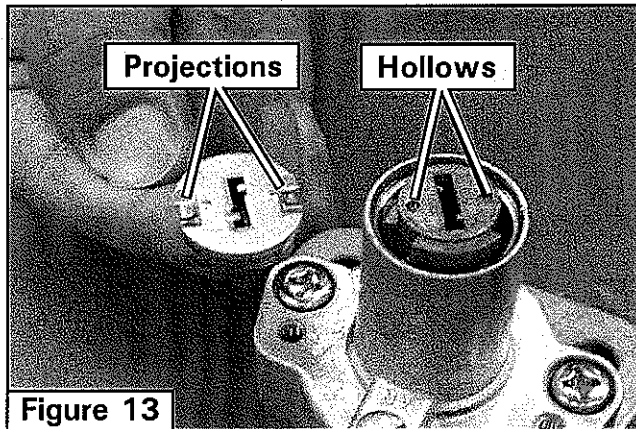


Figure 13

12. Secure the cylinder cap with the break-off screws. Tighten the screws evenly until the screw heads break off (Figure 14). Install the plastic caps (provided in the kit) on the cylinder cap over the break-off screws. Install the ignition switch assembly (refer to Service Manual page 1H-12). Be certain to use the pre-coated bolts provided in the recall kit when installing the new ignition switch.

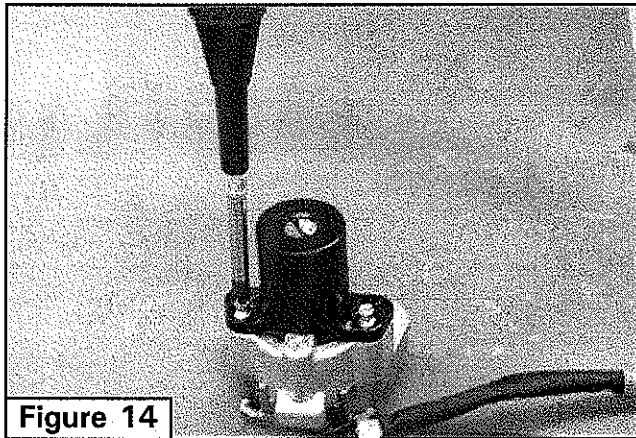


Figure 14

Ignition Switch Mount Bolt:

13 N·m (1.3 kgf-m, 9.5 lb-ft)

Refer to Figure 3 and 4 on page 5 for correct routing of the ignition switch lead wire.

13. Turn the handlebars back and forth to verify that the steering operates smoothly and the wiring harness does not get kinked or pinched.

PUNCH MARK AT VIN

1. After the inspection, rerouting, or replacement procedure is complete be certain to place an identification punch mark on the frame at the beginning of the Vehicle Identification Number (located at the right side of the frame head tube) as illustrated on page 2.

WARRANTY REIMBURSEMENT & CLAIM INFORMATION:

Submit a warranty claim for each recall campaign service immediately upon completion of the repair. This campaign requires you to file a warranty claim using the following information.

Short Form Claim:

Use the Short Form Claim for new, and customer owned units that require ignition switch lead wire inspection and/or re-routing. Labor time is 0.3 hours.

RECALL CAMPAIGN	
IGNITION SWITCH LEAD WIRE INSPECTION, REROUTE	
Short Form Instructions	
GENERAL	
CLAIM NUMBER:	XXXXX,X (Dealer enters number)
ENTRY TYPE: (Dealer Chooses)	Model, Frame or Control Sequence
MODEL:	GSX1300RK8
FRAME:	X821XXXXX
REPAIR DATE:	Enter date of repair
MILEAGE:	Enter mileage on unit
CAMPAIGN NUMBER:	2A05

Long Form Claim:

Use the Long Form Claim for customer owned units requiring ignition switch assembly replacement or for units with additional time or parts required as approved by Tech-Line. Labor time is 1.3 hours.

RECALL CAMPAIGN	
IGNITION SWITCH LEAD WIRE INSPECTION, REROUTE	
Long Form Instructions	
GENERAL	
CLAIM NUMBER:	XXXXX,X (Dealer enters number)
ENTRY TYPE: (Dealer Chooses)	Model, Frame or Control Sequence
MODEL:	GSX1300RK8
FRAME:	X821XXXXX
REPAIR DATE:	Enter date of repair
MILEAGE:	Enter mileage on unit
CAMPAIGN NUMBER:	2A05
LABOR HOURS:	1.3 hrs
SUZUKI AUTH. NUMBER:	As approved by TECH-LINE
PARTS	
REPLACEMENT PART NUMBER:	99103-11237
FAILURE DESCRIPTION	
DESCRIPTION OF FAILURE:	Replace Ignition Switch Assembly per Service Bulletin GS-GSX-GSXR-GSF 183
SUBLET	
SUBLET AMOUNT:	as approved by TECH-LINE
<i>NOTE: Do not use the "\$" when entering an amount</i>	
SUBLET REFERENCE NUMBER:	2A05
SUBLET REPAIR DESCRIPTION:	

Suzuki Connect Long Form warranty claim entries with additional parts or labor require a prior authorization (PAS) code from TECH-LINE or your Technical Service Manager, or the Suzuki Connect system will not accept the claim.

CUSTOMER SATISFACTION:

We understand and apologize for any inconvenience this recall campaign may cause you or your customers.

Thank you for your cooperation in conducting this very important campaign for your customers' safety and satisfaction.

Only your conscientious action at the dealership level can lead to a successful campaign conclusion. Please remind your staff to be sympathetic and sensitive to your customers' feelings. Please extend Suzuki's apologies for any inconvenience this recall campaign may cause them.

AFFECTED DEPARTMENTS:

The following departments in your dealership should be notified of this information:

Management Service Warranty Sales Parts Accessories

American Suzuki Motor Corporation
Technical Service Department
Motorcycle / ATV



AMERICAN SUZUKI MOTOR CORPORATION
MOTORCYCLE

June 10, 2008

**SAFETY RECALL CAMPAIGN #2A05
CERTAIN 2008 GSX1300RK8 (HAYABUSA) MOTORCYCLES
IGNITION SWITCH INSPECTION/REPLACEMENT**

Dear Suzuki Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

What is the reason for this notice?

Suzuki Motor Corporation has decided that a defect which relates to motor vehicle safety exists in certain 2008 model year GSX1300RK8 motorcycles. Suzuki Motor Corporation is conducting a voluntary Safety Recall Campaign. According to our records, you are the owner of one of these motorcycles.

What is the problem?

Suzuki Motor Corporation has determined that certain GSX1300RK8 motorcycles may have the ignition switch lead wire improperly routed. Handlebar movement can result in abnormal flexing and damage to the ignition switch lead wire. Damage to the ignition switch lead wire can result in intermittent or complete loss of electrical power, which can result in loss of lighting and/or stalling of the engine. This could result in a crash.

▲ WARNING

To minimize the risk of injury or death, we recommend that you do not ride, or allow anyone else to ride, your 2008 model year GSX1300RK8 (Hayabusa) until your motorcycle has been repaired by your Suzuki dealer.

Suzuki strongly recommends that you do not ride your affected 2008 GSX1300RK8 (Hayabusa) motorcycle until the ignition switch inspection/replacement has been completed

What is Suzuki doing to solve the problem?

The repair consists of thoroughly inspecting the ignition switch lead wire routing. If the ignition switch lead wire is not routed or clamped properly, Suzuki will replace the ignition switch/lead wire assembly. Your original lock set will be installed onto the new ignition switch/lead wire assembly so that your original key will operate the ignition switch. Repair time is approximately 1.3 hours and will be performed at no cost to you for parts or labor.

How do I receive the fastest possible service?

Suzuki understands that your riding time is precious. Our suggestion is to work closely with your authorized dealer to get the recall service scheduled and performed on your motorcycle as quickly as possible. Schedule an appointment for the recall service to be performed. Parts are currently available. It will be necessary for your dealer to order the parts. It may be necessary to leave your motorcycle with the dealer overnight, so check with your dealer.

CUSTOMER NOTIFICATION LETTER - Page Two of Two

How do I receive the fastest possible service (cont.)

When you pick up your repaired motorcycle, please allow a few extra minutes for your dealer to prepare and complete the necessary warranty paperwork with you. If you have special circumstances, discuss them with your Suzuki dealer. Suzuki understands that some customers may have difficult circumstances to overcome in bringing their motorcycle to the dealership for repair. We have asked your Suzuki dealer to work closely and flexibly with you to arrange alternative, but reasonable solutions for your special requests. Please remember however, that each dealership has its own limitations in providing special assistance due to staff size, available time and dealership location. Your dealer can also consult with Suzuki on other alternatives.

Questions & Answers

Your Suzuki dealer has been provided specific and complete instructions regarding this recall service. Please call your dealer if you have any questions. Your local Suzuki dealer can provide the fastest responses to your questions or concerns about the recall service. Your dealer can also contact Suzuki on your behalf if you have a unique question or concern.

If you have difficulty having the recall service performed on your motorcycle you may contact the American Suzuki Customer Service Department for assistance at 1-714-572-1490. You will need to have your Vehicle Identification Number ready when calling.

If you believe that (1) Suzuki or your Suzuki dealer has failed to or is unable to perform the recall service without charge, or (2) you believe Suzuki has failed to or is unable to perform the recall procedure to your vehicle within 60 days after you first brought your vehicle to your Suzuki dealer after June 10, 2008 you may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave, S.E., West Building, Washington, D.C. 20590 or call the toll free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

Locating an alternate dealer

Suzuki dealers can be located on the internet at www.suzukicycles.com or by calling 1-800-828-7433.

Customer Reimbursement

If your motorcycle is included in the recall and you have paid for the repair or replacement of the ignition switch, you may be eligible for full or partial reimbursement. Please note the following for which Suzuki may exclude reimbursement:

- Only repairs that are the subject of the safety recall are reimbursable. Additional expenses such as towing, rental, accommodations, damage repairs, etc will not be reimbursed.
- Reimbursement may be limited to suggested list price on parts and the Suzuki published flat rate time allowance.
- An owner will not be eligible for reimbursement if the expenses for repairs are incurred more than 10 days after the date of the last owner notification letter sent by Suzuki.
- Reimbursement claims may also be excluded when you do not submit adequate documentation. Your authorized Suzuki dealer will request an original or copy of your receipt for the recall repair or replacement, and your owner notification letter.

To obtain information or request reimbursement, contact your Suzuki dealer or the American Suzuki Motor Corporation, Motorcycle Customer Service Department, PO Box 1100, Brea, CA 92822-1100, or call 1-714- 572-1490. You will need to have your Vehicle Identification Number ready when calling.

We thank you for your prompt attention to completing this recall service on your Suzuki motorcycle. We apologize for any inconvenience this campaign causes you. Your safety, satisfaction and riding enjoyment are priorities for Suzuki.

Sincerely,

American Suzuki Motor Corporation



SUZUKI MOTOR CORPORATION
MOTORCYCLE SERVICE DEPARTMENT

Page: 1 / 2
Date: May 27, 2008

TO : American Suzuki Motor Corporation
ATTN: Mr. Masaaki Kato, President (加藤社長殿)
Mr. Yasuhiro Kawai, Executive Director (川井 ED 殿)

RE: GSX1300RK8 Ignition switch lead wire routing inspection recall Campaign

This is to notify you of the RECALL CAMPAIGN for ignition switch lead wire of GSX1300RK8 model.

We have received market information that electric power supply shutting off when moving the handlebar.

Our investigation identified that there is a possibility that ignition switch lead wire may be assembled in improper routing condition and it may cause break the lead wire by repeated movement of handlebar in worst case. In the case of lead wire break, electric power supply will shut off and engine stall.

In view of the nature of the problem, we decided to carry out the recall campaign to inspect the ignition switch lead wire routing. In the case that the lead wire is misrouted on a motorcycle unit in service, the lower portion of ignition switch containing the lead wire is need to be replaced.

The numbers of the affected units in your market is shown below.
Please refer to the attached sheet for details.

Affected units: 8,671 units

We apologize for any inconvenience this may cause to you and thank you in advance for your kind understanding and cooperation.

Best regards,

Shiroh Kimura, General Manager
Service Department



Affected Model and VIN range

	VIN Range		Qty
	Start	End	
GSX1300K8	JS1GX72A*82100020	JS1GX72A*82112289	8,671

Campaign Parts

Necessary quantity of the campaign parts will be sent to you.
The shipping schedule will be informed as soon as it is fixed.

Warranty Handling Information

This is a recall campaign that is acceptable only one time for one unit.
The labor cost will be reimbursed upon your warranty application.

Claim category	2 (Campaign)
Trouble Code	99-LM
Causal Part	IGNITION SWITCH SET
Causal Part No.	37100-15H30-X00
Quantity	0
Basic code	SF9999
Flat Rate	0.3 Hr (Inspection & correction) 1.3 Hr (Inspection, replacing IG SW base and correction)

END