



903 South Main Street • P.O. Box 460 • Middlebury, IN 46540 • (574) 825-0608 • Fax (574) 825-0572

August 4, 2008

Associate Administrator for Enforcement  
National Highway Traffic Safety Administration  
U.S. Department of Transportation  
1200 New Jersey Avenue, SE  
Washington, DC 20590

**08V-407**  
**(2 pages)**

Dear Sir or Madam:

Pursuant to 49 CFR Part 573, Jayco, Inc. (“Jayco” or the “Company”) is submitting this report to NHTSA concerning a recall campaign, which is being voluntarily initiated. Specific information is as follows:

573.5(c)(2)

Affected vehicles are Model Year 2007 - 2008 Jayco Jay Feather EXP “26L” travel trailer models manufactured between May 19, 2006 and August 14, 2007.

The recall population was determined from the manufacturing records for the Company’s manufacturing plant in Middlebury, Indiana, which produced the affected recreational vehicles.

573.5(c)(3)

A total of Two hundred sixty five - (265) travel trailers are subject to this recall. Specific Vehicle Identification Numbers (VIN) are as follows:

–2007 – 2008 Jay Feather EXP Travel Trailers with a starting VIN of 1UJBJ02M471JL0051 and ending with 1UJBJ02MX81JL0086.

573.5(c)(4)

Jayco is recalling 100 percent of the affected models of Jay Feather EXP Travel Trailers identified in the scope.

573.5(c)(5)

Jayco has identified that there may be a p-clamp which was not installed during production that was intended to prevent the rubber L/P line from contacting the slide-out mechanism. If the p-clamp was not installed, the L/P line may come in contact with the slide-out assembly and chafe. If this condition is not addressed, it may result in a fire, injury or death.

573.5(c)(6)

Jayco decided to conduct this recall following an internal investigation. Jayco is not aware of any injuries or accidents related to this issue.

RECEIVED

2008 AUG 15 A 10:35

DEFECTS INVESTIGATION  
RECALL MGMT DIV.

573.5(c)(8)

The remedy for the affected travel trailers is to inspect for p-clamp installation, add the p-clamp if it is missing, and replace and route correctly any chafed rubber L/P line, if required.

Copies of the repair instructions, dealer notification letters, and owner letters will be provided to the agency within 10 business days. Jayco is contacting all dealers and retail owners of the affected vehicles. Upon notification Jayco is prepared to begin dealer notification within 5 business days after approval, and to owner's ten business days subsequent to dealer notification.

Thank you for your assistance,

Sincerely,

A handwritten signature in black ink that reads "David C. VanderMolen". The signature is written in a cursive, flowing style.

David C. VanderMolen  
Jayco After Market Services  
Technical Research Liaison