



RECEIVED
2008 SEPTEMBER 3 – 11:30 AM
OFFICE OF RECALL
MANAGEMENT DIVISION

Polaris Industries Inc.
Product Development Center
7290 Viking Blvd E
Wyoming, MN 55092
T: 651-408-7579
F: 651-408-7605

08V-446
(16 Pages)

September 2, 2008

National Highway Traffic Safety Administration
Patricia Wallace, Office of Defects Investigation
1200 New Jersey Avenue, SE
Washington, D.C. 20590
T: (202) 366-5232
F: (202) 366-7882

Dear Ms. Wallace:

573.6 Defect Information Report

573.6.c.1.

Vehicle manufacturer's full name:

Polaris Industries Inc., Victory Motorcycle Division

Address:

2100 Highway 55
Medina, MN 55340-9800

573.6.c.2.

Vehicles potentially containing defect:

MY 2008 Victory Vision motorcycles.

Vehicle Identification Numbers:

A list of affected VINs is attached separately as Attachment c.2.

Inclusive dates of manufacture:

May 14, 2007 through May 7, 2008.

Basis for recall population:

All MY 2008 Victory Vision motorcycle models that have been produced.

573.6.c.3.

Total number of vehicles potentially containing defect:

A total of 2444 vehicles may contain this defect.

573.6.c.4.

Percentage of vehicles estimated to actually contain defect:

Victory estimates that approximately two to five percent of the manufactured units may have one of the defects being reported.

573.6.c.5.

Brief Summary:

Victory has determined that a defect may exist in the assembly of the 40-amp main circuit breaker which may cause an intermittent or nonexistent connection during vehicle operation. A poor connection at the 40-amp main circuit breaker could cause a lack of battery voltage to reach the Engine Control Module (ECM) and other electrically controlled components of the motorcycle.

Additionally, it has been determined that the ECM programming can be sensitive to unusual rider input (such as frequent throttle movement at stop-lights or sustained coasting with the clutch disengaged) and can cause the vehicle to die unexpectedly. The vehicle will immediately restart with the starter or by releasing the clutch (in the case of sustained coasting with the clutch disengaged).

Detailed description:

Victory has determined that some inconsistencies in proper torquing of the terminal nuts for the 40-amp main circuit breaker may have occurred during the manufacturing process. The improper assembly of the 40-amp main circuit breaker terminals can intermittently cause a loss of battery voltage at the ECM and other electrically controlled components. Assembly line procedures have been changed to eliminate this issue going forward.

If a poor terminal connection were to exist, the machine might exhibit an intermittent misfire or the engine may unexpectedly shut off. The lighting system of the vehicle may also display intermittent or no operation if this condition were to exist.

In the case of the ECM programming, Victory has determined that under unusual and specific rider inputs that the vehicle may die unexpectedly. This issue was not observed during pre-production testing since the rider inputs necessary to induce the issue are not part of normal driving habits. Our test riders did not operate the vehicles in the manner which could cause the issue.

573.6.c.6.

Chronology:

Victory is aware of twenty field reports involving a loose connection at the 40-amp main circuit breaker. The first field report was received in January of 2008, the second was received in February of 2008, the third report was received in March of 2008 and no reports were received in April of 2008 for this issue. Four reports were received in June of 2008, six in July of 2008 and three reports were received in August of 2008.

Victory has now determined that these twenty complaints are related and due to the main 40-amp circuit breaker. It was not apparent that these complaints were related and it was difficult to determine the root cause when the early reports came in for a variety of reasons.

First, existing Safety Recalls (Voltage Regulator Replacement and Ignition Switch Repair) are in place for some of the affected population. The symptoms associated with these recalls are similar to those resulting from the subject defect and were initially thought to be related to these original recalls.

Second, the failure can be very random and infrequent in nature in that a problem might be experienced one day and may not be able to be duplicated by the dealership technician and the customer may not experience the problem again for several weeks. In some instances the problem was reported to be repaired by replacing some component or completing one or both of the outstanding recalls, but the owner would experience the same problem at a later date.

Lastly, Victory received fifteen reports of the engine either dying at a stoplight where it was reported that the operator was frequently moving the throttle or during sustained deceleration with the clutch disengaged. These reports were received beginning in November of 2007 through July of 2008. This issue proved to be very difficult to isolate as it is dependent upon the rider's driving habits which are unusual. As specific rider inputs are needed to duplicate and understand the issue; the issue is very random in nature and tends to occur sporadically.

573.6. c.8.

Remedy program:

Victory will conduct a safety recall by which we will require our dealer network to properly torque the terminal lug nuts at the 40-amp main circuit breaker and to download new programming into the ECM.

All of the affected machines have been delivered to Victory's dealer network. For those machines that are still at dealers, those dealers will be required to perform the repairs prior to delivery to consumers.

Victory will contact consumers who have purchased one of the affected vehicles and instruct them to present their machines to an authorized Victory dealer so that the repairs can be made.

Estimated date on which notifications to Owners will begin:

September 15, 2008.

Estimated date on which notification will be completed:

September 22, 2008.

573.6.c.10.

 
Owner letter:

See attached Owner Notification letter.

573.6.c.11.

Manufacturer's campaign number:

V-08-03

Signed:  Date: 9-2-2008
Don L. Good
Product Compliance Specialist
Polaris Industries Inc.

Attachments

Proposed Safety Recall Bulletin	Page(s)	5 through 9
Proposed Consumer Notification	Page	10
Affected VINs	Page(s)	11 through 16



THE NEW AMERICAN MOTORCYCLE™

Date: 09/8/2008

TECHNICAL SERVICE BULLETIN

Victory Motorcycle

Bulletin Number: **V-08-03**

Model Years: **2008**

☐ Safety Bulletin ☒ **Safety Recall** ☐ Service Bulletin ☐ Service Alert Fax ☐ Production Update Kit

Distribution: ☐ Owner / Principal ☐ Service Manager ☐ Sales Manager ☐ Parts Manager ☐ Technicians

This Service Bulletin is located at www.polarisdealers.com



-Confidential and Proprietary-

SUBJECT: Loose Circuit Breaker Terminal Nuts and ECM Reprogramming

PURPOSE: Victory has decided that two possible defects exist on affected vehicles that could cause the engine to stall:

- 1) The terminal nuts that secure the main power supply wires could be loose at the circuit breaker, which can cause an unexpected loss of electrical power to the vehicle.
- 2) The current fuel / ignition map (pre-programmed into the Electronic Control Module or "ECM") can cause engine stalling under unusual and specific rider inputs.

Either of the defects listed above could cause the vehicle to stall, increasing the risk of a loss of control and a vehicle crash.

AFFECTED MODEL(S):

Model	Model Number(s)	Vehicle Identification Numbers (VIN)
2008 Victory Vision Street™	V08S136; V08SB36CAP, CCP, CD, CDP V08SB36DA, DAP, DC, DCP, DD, DDP V08SB36LAP, LC, LCP, LD, LDP	Enter the VIN number in "Unit Inquiry" on the dealer web site to determine if this bulletin applies before performing this repair.
2008 Victory Vision Tour™	V08S236; V08SD36CA, CAP, CAT, CC, CCP, CCT, CD, CDP, CDT V08SD36DA, DAP, DAT, DC, DCP, DCT, DD, DDP, DDT V08SD36LA, LAP, LAT, LC, LCP, LCT, LDP, LDT	Enter the VIN number in "Unit Inquiry" on the dealer web site to determine if this bulletin applies before performing this repair.

WHAT YOUR DEALERSHIP SHOULD DO:

Note: It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by the notification under a sale or lease until the defect or noncompliance is remedied.

1. Enter the Vehicle Identification Number in unit inquiry to see if this bulletin applies.
2. If the vehicle is affected, follow instructions on page 4 to inspect and torque the circuit breaker nuts.
3. Tighten both circuit breaker terminal nuts to specified torque as outlined on page 4.
4. Reprogram the ECM with new calibration as outlined on page 5. You must have Digital Wrench™ Version 3.1 installed on your laptop computer to complete this bulletin procedure.
5. File a warranty claim immediately after completion of this bulletin. Follow warranty claim filing procedures on page 2.

The information contained within this bulletin is confidential and protected by U.S. and international copyright laws, and is the property of Polaris Industries Inc. This service bulletin is provided for the sole use of authorized Polaris dealers and distributors. This service bulletin is not to be distributed, duplicated, or copied, digitally or otherwise, without the written consent of Polaris Industries Inc. © 2008 Polaris Sales Inc.

CUSTOMER NOTIFICATION:

A customer Notification letter 08V-xxx (08-xxx in Canada) will be sent to registered owners of motorcycles affected by this bulletin. An example of the US Consumer letter is shown on page 3.

In addition to the notification letter sent by Victory, dealers are required to notify owners of motorcycles sold by their dealership, and to make arrangements to perform this bulletin repair immediately.

PARTS INFORMATION:

PART NUMBER / DESCRIPTION	7170107
QUANTITY	1 completion decal required per affected unit
DIRECT SHIP FROM VICTORY?	NO
TO BE ORDERED BY DEALERS?	NO
AVAILABLE TO ORDER	NO

WARRANTY CLAIM INFORMATION:

A single group claim may be submitted listing the complete 17-digit VIN for machines WITH THE SAME MODEL NUMBER. File claim type **SB (Service Bulletin)**. DO NOT ENTER MORE THAN ONE MODEL NUMBER ON A WARRANTY CLAIM. All warranty claims must be submitted within 10 days of the repair. Never submit a warranty claim before completing the work. It is in violation of your dealer agreement to submit a warranty claim prior to the work being completed. Removed components are to be retained according to the Polaris Warranty Policy for possible return to the Warranty Department

Service Bulletin Number	V-08-03
Claim Type	SB
Labor Allowance	:18 Minutes
Claim Part Numbers	Automatically entered by warranty system

SERVICE BULLETIN COMPLETION DECAL:

- 1) Fill out a Service Bulletin Completion Decal, PN 7170107.
- 2) Clean the surface of the inside of the rear console cover.
- 3) Remove the decal from the sheet and apply as shown.
- 4) Peel adhesive backing off of the *clear* protective outer film of decal.
- 5) Press the clear film firmly over the decal.

If you require more decals, order them through normal parts ordering channels.



Fill out Decal with all required information.



Remove rear console cover and apply to underside.

Sincerely,

Laurie Rengel
Manager, Service Dealer Development and Warranty

EXAMPLE OF CONSUMER LETTER 08V-xxx



Victory Motorcycle Division
of Polaris Industries Inc.
2100 Highway 55
Medina, MN 55340

September xx, 2008

SAFETY RECALL NOTICE

Recall Campaign: 08V-xxx

Subject: Circuit Breaker Terminal Nuts and ECU Reprogram

Reference: Safety Recall Bulletin V-08-03

PLEASE READ IMMEDIATELY

Dear Victory Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. The Victory Motorcycle Division of Polaris Industries Inc. has decided that a defect which relates to motor vehicle safety exists in some 2008 Victory Vision™ motorcycles. Our records indicate that you have purchased a potentially affected vehicle.

The reason for this recall:

Victory has decided that two possible defects exist on affected vehicles that could cause the engine to stall. 1) The terminal nuts that secure the main power supply wires could be loose at the circuit breaker, which can cause an unexpected loss of electrical power to the vehicle. 2) The current fuel / ignition map (pre-programmed into the Electronic Control Module or "ECM") can cause engine stalling under unusual and specific rider inputs.

Either of the defects listed above could cause the vehicle to stall, increasing the risk of a loss of control and a vehicle crash.

What Victory and your dealer will do:

Victory has issued *Safety Recall Bulletin V-08-03* to all Victory dealers, with instructions required to inspect and tighten the circuit breaker terminal nuts and re-program the ECU on all affected vehicles. Repairs will be made by any authorized Victory motorcycle dealer at no cost to you. The actual repair will take approximately 45 minutes to perform; however, it may take longer due to service scheduling requirements.

What you should do:

Please call your authorized Victory motorcycle dealer to schedule an appointment to have the bulletin repair performed. Do not attempt repairs yourself. Repairs must be done only by an authorized Victory motorcycle dealer.

DO NOT OPERATE YOUR MOTORCYCLE UNTIL ALL REPAIRS HAVE BEEN COMPLETED!

If you have questions or if you need more information:

While your Victory dealer is in the best position to answer your questions, if you have any questions that your dealer cannot address, if you are having difficulty obtaining the recall repair outlined in this letter, or if you need assistance finding a Victory Dealer, please contact our Victory Consumer Service Department by calling 1-888-704-5290 or visit the Polaris/Victory Motorcycle web site at www.polarisindustries.com.

This notice was mailed to you according to our most current registration information. If you no longer own your Victory motorcycle, please contact your local Victory dealer to have the ownership information changed. The Consumer Service Department cannot change ownership information without identification. Federal law requires that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessee within 10 days.

If you have had this repair performed before you received this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy of the problem associated with this recall. For more information regarding obtaining reimbursement please contact the Victory Consumer Service Department using the contact information above.

If you believe that the Victory Motorcycle Division of Polaris Industries Inc. has failed to remedy this defect without charge or is unable to do so within a reasonable time, you may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue SE., Washington, D.C. 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or on the web go to <http://www.safercar.gov>.

Please accept our apologies for any inconvenience this may cause you. Your safety and continued satisfaction with your Victory motorcycle is our primary concern. Thank you for your prompt attention to this matter.

Sincerely,





Laurie Rengel
Manager, Service Dealer Development & Warranty

INSTRUCTIONS

Overview: Tighten *both* circuit breaker terminal nuts to specified torque on all affected vehicles. Use a thin wall socket to ensure full engagement with the nut. Keep the socket at a 90 degree angle to the terminal stud when torquing the nuts.


Circuit Breaker Terminal Nut Torque

1. Remove battery negative (-) cable (A). (Fig. 1)
2. Remove screw (B) from electrical cover (4mm internal hex). (Fig. 1)
3. Loosen screw (C).
4. Place a protective cloth between cover and lower leg fairing. Prop cover for access to circuit breaker (D). (Fig. 2)
5. Lift protective cover off circuit breaker.
6. Using a thin wall 3/8 inch deep socket, torque *BOTH* nuts to 25 lb-in (2.8 Nm). (Fig. 3)
7. Re-install protective cover securely over circuit breaker, pushing it firmly onto the studs. (Fig. 4)
8. Set electrical cover back in place and remove protective cloth.
9. Install screw. Torque both screws to x.x Nm (xx lb-in).
10. Install battery negative cable. Torque terminal bolt to 4.5 Nm (40 lb-in).
11. Perform reflash procedure following basic procedure outlined on page 5, and instructions within Digital Wrench.

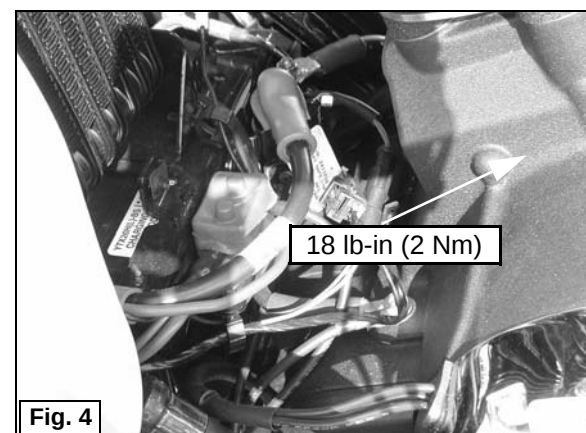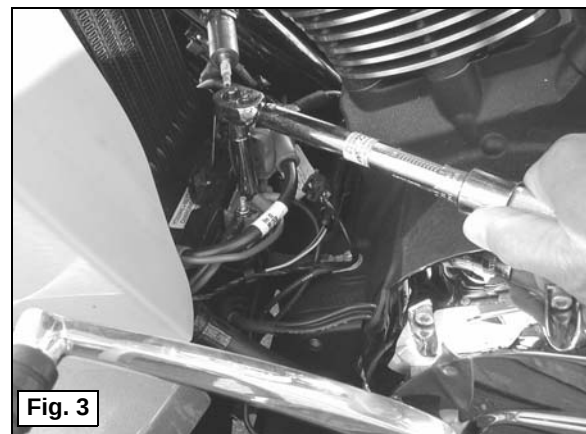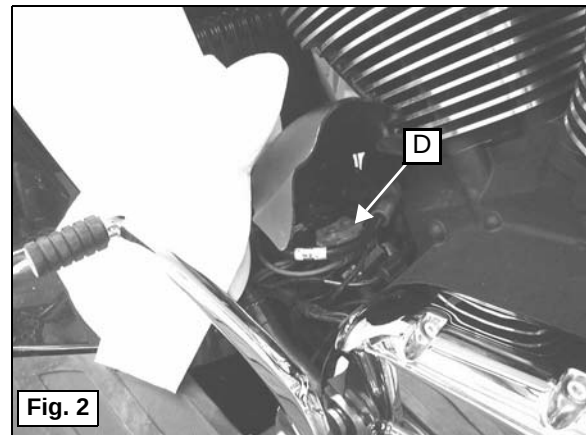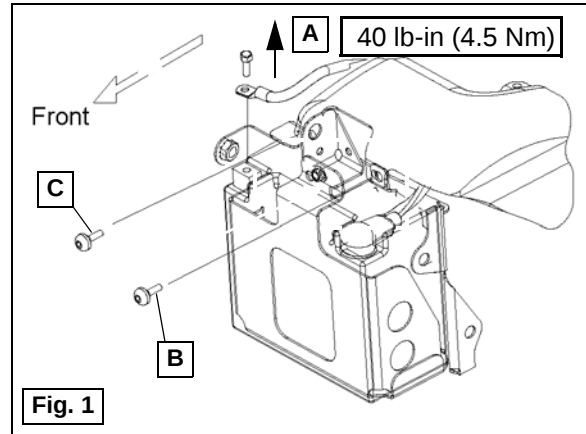

ECM Reprogramming

 1. Open left saddlebag door and remove protective cap from diagnostic connector.
2. Connect interface cable (PV-xxxx) to laptop computer and diagnostic connector on vehicle.
3. Turn ignition key on and start Digital Wrench.
4. Open *Special Tests* menu and select *Reprogramming*.
5. Follow the directions within Digital Wrench to install programming file xxxxxxxx.



Attachment c.2 (Vehicles Potentially Containing the Defect)					
VIN	VIN	VIN	VIN	VIN	VIN
5VPSD36D683	5VPSD36D483	5VPSB36L483	5VPSD36D883	5VPSD36DX83	5VPSB36D983
5VPSD36L283	5VPSB36L083	5VPSB36L483	5VPSD36D683	5VPSD36D583	5VPSD36D383
5VPS236D183	5VPSD36D283	5VPSB36L383	5VPSD36DX83	5VPSD36D383	5VPSB36D083
5VPS236D383	5VPSD36D083	5VPSB36L883	5VPSD36D783	5VPSD36D883	5VPSB36D783
5VPS236D283	5VPSD36D183	5VPSD36D183	5VPSD36D183	5VPSD36D183	5VPSB36D883
5VPS236D583	5VPSD36D683	5VPSD36D283	5VPSD36D383	5VPSD36D483	5VPSB36D083
5VPS236D683	5VPSD36D683	5VPSD36D083	5VPSD36D683	5VPSD36D283	5VPSB36D483
5VPSD36D583	5VPSD36D983	5VPSD36D583	5VPSD36D083	5VPSD36D083	5VPSD36D983
5VPSD36D683	5VPSD36D183	5VPSD36D083	5VPSD36D883	5VPSD36D783	5VPSD36D083
5VPSD36D983	5VPSD36D783	5VPSD36D183	5VPSD36D083	5VPSD36D483	5VPSB36D783
5VPSB36D683	5VPSD36D383	5VPSD36D983	5VPSD36D483	5VPSD36D783	5VPSB36D283
5VPS136D783	5VPSD36D683	5VPSD36D483	5VPSD36D583	5VPSD36D583	5VPSD36D783
5VPS136D983	5VPSD36D683	5VPSD36D483	5VPSD36D183	5VPSD36L283	5VPSB36D983
5VPS236DX83	5VPSD36D583	5VPSD36D183	5VPSD36D083	5VPSD36L683	5VPSB36D683
5VPSB36D583	5VPSB36D583	5VPSD36D383	5VPSD36D283	5VPSD36D083	5VPSB36D583
5VPSB36D883	5VPSD36DX83	5VPSD36D483	5VPSD36D283	5VPSD36L783	5VPSD36D383
5VPS136D883	5VPSD36D483	5VPSD36D383	5VPSD36D383	5VPSD36L383	5VPSD36D583
5VPSD36D783	5VPSD36D483	5VPSD36D283	5VPSD36D483	5VPSD36L983	5VPSD36D283
5VPS136D083	5VPSD36D483	5VPSD36D683	5VPSD36D583	5VPSD36L883	5VPSD36D383
5VPS136D183	5VPSD36D083	5VPSD36D783	5VPSD36D783	5VPSD36D683	5VPSD36D783
5VPS136D283	5VPSD36D383	5VPSD36DX83	5VPSD36D883	5VPSD36L083	5VPSD36D683
5VPS136DX83	5VPSD36D183	5VPSD36L083	5VPSD36D983	5VPSD36L183	5VPSD36D483
5VPS236D083	5VPSB36D083	5VPSD36L083	5VPSD36D983	5VPSD36L283	5VPSD36D683
5VPS236D183	5VPSB36D183	5VPSD36L583	5VPSD36D783	5VPSD36L783	5VPSD36DX83
5VPS236D283	5VPSB36DX83	5VPSD36D883	5VPSD36D483	5VPSD36L383	5VPSD36D383
5VPS236D783	5VPSB36DX83	5VPSD36LX83	5VPSD36D183	5VPSD36L483	5VPSD36D483
5VPS236D883	5VPSD36D383	5VPSB36D383	5VPSD36D283	5VPSD36L083	5VPSD36D483
5VPS236D983	5VPSD36D583	5VPSB36D383	5VPSD36D683	5VPSD36L183	5VPSD36D683
5VPS136D183	5VPSD36DX83	5VPSB36D983	5VPSD36D683	5VPSD36L983	5VPSD36D883
5VPS136D983	5VPSD36D983	5VPSB36D83	5VPSD36D783	5VPSD36L783	5VPSD36D383
5VPS236D783	5VPSB36D483	5VPSB36L183	5VPSD36D083	5VPSD36L283	5VPSD36D083
5VPS236DX83	5VPSD36D083	5VPSB36L883	5VPSD36D983	5VPSD36L583	5VPSD36D083
5VPSD36L783	5VPSD36D183	5VPSD36LX83	5VPSD36DX83	5VPSD36L683	5VPSD36D883
5VPSD36D083	5VPSD36D183	5VPSD36L383	5VPSD36D183	5VPSD36L683	5VPSD36DX83
5VPS236L783	5VPSD36D283	5VPSD36L983	5VPSD36D283	5VPSD36L883	5VPSD36D083
5VPS136D483	5VPSD36D083	5VPSD36L283	5VPSD36D383	5VPSD36L983	5VPSD36D783
5VPS136D783	5VPSD36D183	5VPSD36L383	5VPSD36D883	5VPSD36LX83	5VPSD36D783
5VPSB36D183	5VPSB36D883	5VPSD36L483	5VPSD36DX83	5VPSD36LX83	5VPSD36D783
5VPSB36D283	5VPSD36D783	5VPSD36L883	5VPSD36D583	5VPSD36D383	5VPSD36D983
5VPSD36D183	5VPSB36D983	5VPSB36L383	5VPSD36D083	5VPSD36D583	5VPSD36DX83
5VPSD36D283	5VPSD36D583	5VPSD36L683	5VPSD36D383	5VPSD36D983	5VPSD36D583
5VPSD36D583	5VPSB36D783	5VPSD36DX83	5VPSD36D583	5VPSD36D283	5VPSD36D983
5VPS136D483	5VPSB36D983	5VPSD36L783	5VPSD36D683	5VPSD36D383	5VPSD36D083
5VPSD36D083	5VPSD36D383	5VPSD36D983	5VPSD36D983	5VPSD36D483	5VPSD36D183
5VPSB36D083	5VPSD36D483	5VPSD36L283	5VPSD36D983	5VPSD36D783	5VPSD36D483
5VPSB36D183	5VPSB36D283	5VPSD36D483	5VPSD36D983	5VPSD36D183	5VPSD36D383
5VPSB36D583	5VPSD36D183	5VPSD36L483	5VPSD36D383	5VPSD36D883	5VPSD36D183
5VPSB36D583	5VPSD36D283	5VPSD36L683	5VPSD36D083	5VPSD36D283	5VPSD36D383
5VPSB36D683	5VPSD36D883	5VPSD36L183	5VPSD36D583	5VPSD36DX83	5VPSD36D483
5VPSB36D183	5VPSD36D983	5VPSD36D583	5VPSD36D483	5VPSD36D883	5VPSD36DX83
5VPS136D483	5VPSD36D083	5VPSB36L583	5VPSD36D383	5VPSD36D783	5VPSD36D283
5VPSB36D283	5VPSB36D283	5VPSB36LX83	5VPSD36D483	5VPSD36D883	5VPSD36D783
5VPSB36D383	5VPSB36D883	5VPSB36L383	5VPSD36DX83	5VPSD36D483	5VPSD36D183
5VPSB36D783	5VPSD36D683	5VPSB36L483	5VPSD36D283	5VPSD36D783	5VPSD36D783
5VPSB36D383	5VPSD36D083	5VPSD36D283	5VPSD36D883	5VPSD36C083	5VPSD36D983
5VPSB36D683	5VPSD36D983	5VPSD36D683	5VPSD36D483	5VPSD36D483	5VPSD36D083
5VPS136D983	5VPSD36D383	5VPSD36D183	5VPSD36D983	5VPSD36D983	5VPSD36D283
5VPS136D583	5VPSD36D783	5VPSD36D183	5VPSD36D183	5VPSD36D383	5VPSD36D583
5VPSB36D183	5VPSD36D483	5VPSD36D083	5VPSD36D283	5VPSD36L983	5VPSD36D683
5VPSB36D383	5VPSD36D283	5VPSD36D183	5VPSD36D483	5VPSD36DX83	5VPSD36D683
5VPSB36D483	5VPSB36L483	5VPSD36D983	5VPSD36D583	5VPSD36L383	5VPSD36D883
5VPSB36D283	5VPSD36D183	5VPSB36L983	5VPSD36D883	5VPSD36D383	5VPSD36D883
5VPSB36D283	5VPSD36D783	5VPSD36D083	5VPSD36D983	5VPSD36D883	5VPSD36D983
5VPSB36D383	5VPSD36D883	5VPSD36D783	5VPSD36D483	5VPSD36DX83	5VPSD36DX83
5VPSB36D783	5VPSD36D883	5VPSB36L783	5VPSD36D383	5VPSD36L183	5VPSD36D983
5VPSB36D883	5VPSD36D983	5VPSD36D983	5VPSD36D083	5VPSD36L683	5VPSD36D183
5VPSB36D383	5VPSD36D583	5VPSD36D483	5VPSD36D083	5VPSD36L883	5VPSD36D783
5VPSB36D983	5VPSD36D383	5VPSD36DX83	5VPSD36D183	5VPSD36DX83	5VPSD36D383
5VPSB36D883	5VPSD36D283	5VPSD36L183	5VPSD36D783	5VPSD36D583	5VPSD36D483
5VPSB36D283	5VPSD36DX83	5VPSB36L383	5VPSD36D183	5VPSD36LX83	5VPSD36D283
5VPSB36D883	5VPSD36D383	5VPSD36L683	5VPSD36D783	5VPSD36D483	5VPSD36D283

Attachment c.2 (Vehicles Potentially Containing the Defect)

VIN	VIN	VIN	VIN	VIN	VIN
5VPSB36D083	5VPSD36D083	5VPSB36L883	5VPSD36D983	5VPSD36D483	5VPSD36D883
5VPSB36D083	5VPSD36D083	5VPSD36D483	5VPSD36D383	5VPSD36L083	5VPSD36D983
5VPSB36D783	5VPSD36D583	5VPSD36L183	5VPSD36D483	5VPSD36L483	5VPSD36D883
5VPSB36D983	5VPSD36D683	5VPSB36L183	5VPSD36D583	5VPSB36D383	5VPSD36D583
5VPSB36DX83	5VPSD36D083	5VPSB36L283	5VPSD36D683	5VPSB36D483	5VPSB36DX83
5VPSB36D583	5VPSD36D483	5VPSD36L783	5VPSD36D883	5VPSB36D583	5VPSD36D083
5VPSB36D083	5VPSD36D583	5VPSB36L283	5VPSD36DX83	5VPSB36D783	5VPSD36D083
5VPSB36DX83	5VPSD36D883	5VPSB36L783	5VPSD36DX83	5VPSB36D483	5VPSD36D183
5VPSB36D383	5VPSD36D983	5VPSB36L983	5VPSD36D583	5VPSB36D083	5VPSD36D183
5VPSB36D183	5VPSD36D483	5VPSD36L483	5VPSD36D183	5VPSB36D183	5VPSD36D483
5VPSB36D683	5VPSD36D483	5VPSD36L783	5VPSD36D783	5VPSB36D283	5VPSD36D483
5VPSB36D783	5VPSD36D383	5VPSD36L083	5VPSD36D483	5VPSB36D383	5VPSD36D583
5VPSB36D083	5VPSD36D883	5VPSD36L183	5VPSD36D083	5VPSB36D583	5VPSD36D683
5VPSB36D483	5VPSD36D383	5VPSD36L083	5VPSD36D883	5VPSB36D683	5VPSD36D683
5VPSB36D783	5VPSD36D283	5VPSD36L383	5VPSD36D683	5VPSB36D683	5VPSD36D883
5VPSB36DX83	5VPSD36D183	5VPSD36L883	5VPSD36D583	5VPSB36D783	5VPSD36D983
5VPSB36D983	5VPSD36D083	5VPSD36L383	5VPSD36D983	5VPSB36D883	5VPSD36D183
5VPSB36D783	5VPSD36D183	5VPSD36L983	5VPSD36D183	5VPSB36D983	5VPSD36D283
5VPSB36D583	5VPSD36D583	5VPSD36L583	5VPSD36D883	5VPSB36DX83	5VPSD36D683
5VPSB36D483	5VPSD36DX83	5VPSD36D183	5VPSD36D383	5VPSD36D283	5VPSD36D483
5VPSB36D783	5VPSD36L183	5VPSD36L783	5VPSD36D383	5VPSD36D583	5VPSD36D983
5VPSB36D983	5VPSD36L783	5VPSD36L083	5VPSD36D283	5VPSD36D583	5VPSD36D283
5VPSB36D483	5VPSD36D683	5VPSD36L283	5VPSD36D083	5VPSD36DX83	5VPSD36D783
5VPSB36D783	5VPSD36D83	5VPSD36LX83	5VPSD36D483	5VPSD36D083	5VPSD36DX83
5VPSB36D183	5VPSD36D383	5VPSD36L483	5VPSD36D783	5VPSD36D183	5VPSD36D683
5VPSB36D283	5VPSD36D983	5VPSD36L883	5VPSD36D883	5VPSD36D183	5VPSD36D583
5VPSB36D383	5VPSD36D483	5VPSD36D583	5VPSD36D983	5VPSD36D783	5VPSB36D383
5VPSB36D483	5VPSD36D383	5VPSD36L683	5VPSD36L583	5VPSD36D483	5VPSD36D083
5VPSB36D583	5VPSD36D883	5VPSD36D983	5VPSD36L183	5VPSD36D883	5VPSD36D183
5VPSB36D683	5VPSD36D183	5VPSD36D983	5VPSD36D083	5VPSD36D983	5VPSD36D283
5VPSB36D383	5VPSD36D283	5VPSD36D983	5VPSD36L683	5VPSD36D283	5VPSD36D383
5VPSB36D983	5VPSD36D083	5VPSD36D083	5VPSD36L483	5VPSD36D683	5VPSD36D383
5VPSB36D283	5VPSD36D583	5VPSD36D483	5VPSD36L283	5VPSD36D683	5VPSD36D483
5VPSB36D783	5VPSD36D583	5VPSD36D383	5VPSD36L983	5VPSD36D783	5VPSD36D583
5VPSB36D083	5VPSD36D783	5VPSD36C283	5VPSD36L983	5VPSD36D783	5VPSD36D583
5VPSB36D483	5VPSD36D783	5VPSD36D283	5VPSD36L883	5VPSD36D283	5VPSD36D883
5VPSB36D783	5VPSD36D383	5VPSD36DX83	5VPSD36D983	5VPSD36D983	5VPSD36D883
5VPSB36D883	5VPSD36D683	5VPSD36D083	5VPSD36L783	5VPSD36D483	5VPSD36D983
5VPSB36DX83	5VPSD36D983	5VPSD36D583	5VPSD36D283	5VPSD36D683	5VPSD36DX83
5VPSB36DX83	5VPSD36D183	5VPSD36D683	5VPSD36D083	5VPSD36D483	5VPSD36D083
5VPSB36D583	5VPSD36D183	5VPSD36D983	5VPSD36D383	5VPSD36D383	5VPSD36D483
5VPSB36D283	5VPSD36D283	5VPSD36D883	5VPSD36D483	5VPSD36D083	5VPSD36D683
5VPSB36D183	5VPSD36D283	5VPSD36D583	5VPSD36D783	5VPSD36D583	5VPSD36D083
5VPSB36D383	5VPSD36D383	5VPSD36DX83	5VPSD36L083	5VPSD36D583	5VPSD36D783
5VPSB36D683	5VPSD36D483	5VPSD36DX83	5VPSD36D483	5VPSD36D883	5VPSD36D783
5VPSB36D883	5VPSD36D783	5VPSD36D783	5VPSD36D783	5VPSB36D183	5VPSD36D883
5VPSB36D683	5VPSD36D883	5VPSD36D283	5VPSD36D483	5VPSB36D683	5VPSD36D083
5VPSB36D183	5VPSD36D983	5VPSD36D783	5VPSD36DX83	5VPSB36D683	5VPSD36D383
5VPSB36D783	5VPSD36L583	5VPSD36D683	5VPSD36D683	5VPSD36D183	5VPSD36D883
5VPSB36D583	5VPSD36L683	5VPSD36D183	5VPSD36D183	5VPSD36D183	5VPSB36D283
5VPSB36D483	5VPSD36L083	5VPSD36D383	5VPSD36D183	5VPSD36D283	5VPSB36D683
5VPSB36DX83	5VPSD36D083	5VPSD36D483	5VPSD36D583	5VPSD36D383	5VPSD36D183
5VPSB36D683	5VPSD36L683	5VPSD36D883	5VPSD36D083	5VPSD36D783	5VPSD36D283
5VPSB36D883	5VPSD36D383	5VPSD36D983	5VPSD36D283	5VPSD36DX83	5VPSD36D383
5VPSB36D383	5VPSD36L183	5VPSD36D183	5VPSD36D583	5VPSD36D583	5VPSD36D483
5VPSB36D083	5VPSD36L583	5VPSD36D583	5VPSD36D583	5VPSD36D483	5VPSD36D583
5VPSB36D483	5VPSD36D883	5VPSD36D283	5VPSD36D883	5VPSD36D583	5VPSD36D583
5VPSB36D683	5VPSD36D183	5VPSD36D683	5VPSD36D683	5VPSB36D583	5VPSD36D683
5VPSB36D783	5VPSD36D083	5VPSD36D183	5VPSD36DX83	5VPSD36D883	5VPSD36D983
5VPSB36D783	5VPSD36L583	5VPSD36D083	5VPSD36D783	5VPSB36D783	5VPSD36D983
5VPSB36D383	5VPSD36L283	5VPSD36D983	5VPSD36D383	5VPSB36D083	5VPSD36DX83
5VPSB36D783	5VPSD36L983	5VPSD36D383	5VPSD36D683	5VPSB36D183	5VPSD36D783
5VPSB36D683	5VPSD36L683	5VPSD36D683	5VPSD36D883	5VPSB36D283	5VPSD36D983
5VPSB36D883	5VPSD36L383	5VPSD36D783	5VPSD36D883	5VPSB36D683	5VPSD36DX83
5VPSB36DX83	5VPSD36L483	5VPSD36D783	5VPSD36D383	5VPSB36D983	5VPSD36D283
5VPSB36C283	5VPSD36L483	5VPSD36D883	5VPSD36D283	5VPSB36DX83	5VPSD36D283
5VPSB36CX83	5VPSD36LX83	5VPSD36D783	5VPSD36D083	5VPSD36D083	5VPSD36D983
5VPSB36D083	5VPSD36L583	5VPSD36D983	5VPSD36D283	5VPSD36D483	5VPSD36D483
5VPSB36D283	5VPSD36L383	5VPSD36D483	5VPSD36D783	5VPSD36D683	5VPSD36D183
5VPSB36D383	5VPSD36L783	5VPSD36D583	5VPSD36D583	5VPSD36D683	5VPSD36D483

Attachment c.2 (Vehicles Potentially Containing the Defect)

VIN	VIN	VIN	VIN	VIN	VIN
5VPSB36D683	5VPSD36L083002763	5VPSD36D883	5VPSD36D483	5VPSD36D983	5VPSD36DX83
5VPSB36D883	5VPSD36L 783002727	5VPSD36D083	5VPSB36LX83	5VPSD36DX83	5VPSD36D083
5VPSB36D483	5VPSD36L883002736	5VPSD36D683	5VPSD36D683	5VPSB36D483	5VPSD36D383
5VPSB36D383	5VPSD36D283002787	5VPSD36D083	5VPSD36DX83	5VPSB36D883	5VPSD36D383
5VPSB36D783	5VPSD36D383002796	5VPSD36D183	5VPSB36L783	5VPSB36D383	5VPSD36D583
5VPSB36D783	5VPSD36L 183002772	5VPSD36D283	5VPSB36L183	5VPSB36D583	5VPSD36D583
5VPSB36D583	5VPSD36L783002775	5VPSD36D383	5VPSB36L683	5VPSD36D183	5VPSD36D683
5VPSB36D083	5VPSD36L 183002769	5VPSD36D483	5VPSB36L783	5VPSB36D983	5VPSD36D683
5VPSB36D183	5VPSD36L783002808	5VPSD36D583	5VPSB36L083	5VPSB36D083	5VPSD36D783
5VPSB36D283	5VPSD36D083002805	5VPSD36D683	5VPSB36L583	5VPSB36D183	5VPSD36D783
5VPSB36DX83	5VPSD36D 183002778	5VPSD36D683	5VPSB36L683	5VPSB36D283	5VPSD36D883
5VPSB36D283	5VPSD36D 183002781	5VPSD36D783	5VPSD36D083	5VPSB36D383	5VPSD36D883
5VPSB36D683	5VPSD36D583002802	5VPSD36D883	5VPSD36D483	5VPSB36D583	5VPSD36D783
5VPSB36D483	5VPSD36D783002784	5VPSD36DX83	5VPSD36D583	5VPSB36D683	5VPSD36DX83
5VPSB36D483	5VPSD36D883002793	5VPSD36L283	5VPSD36D983	5VPSB36D683	5VPSD36D083
5VPSB36D583	5VPSD36D983002799	5VPSD36L783	5VPSD36L X83	5VPSB36D783	5VPSD36D783
5VPSB36D683	5VPSD36L783002811	5VPSD36L383	5VPSD36L883	5VPSB36D783	5VPSD36D583
5VPSB36D983	5VPSD36D383002832	5VPSD36L483	5VPSD36L583	5VPSB36D883	5VPSD36D383
5VPSB36D883	5VPSD36D283002823	5VPSD36L883	5VPSD36LX83	5VPSD36D783	5VPSD36D483
5VPSB36D183	5VPSD36L 283002814	5VPSD36L283	5VPSD36L083	5VPSB36D183	5VPSD36D883
5VPSB36D383	5VPSD36D383002829	5VPSD36LX83	5VPSD36L 583	5VPSB36DX83	5VPSD36D083
5VPSB36D183	5VPSD36D483002838	5VPSD36D183	5VPSD36L983	5VPSB36D083	5VPSD36D483
5VPSB36D883	5VPSD36D483002841	5VPSB36DX83	5VPSD36L383	5VPSB36D383	5VPSD36D483
5VPSB36D283	5VPSD36D883002826	5VPSD36L983	5VPSD36L683	5VPSB36D383	5VPSD36D183
5VPSB36D583	5VPSD36D983002835	5VPSD36L383	5VPSD36L183	5VPSB36D483	5VPSD36D183
5VPSB36D983	5VPSD36L883002817	5VPSD36D683	5VPSD36L483	5VPSB36D483	5VPSD36D683
5VPSB36D883	5VPSD36L 883002820	5VPSD36L983	5VPSD36L983	5VPSB36D483	5VPSB36D083
5VPSB36L183	5VPSD36D783002865	5VPSD36LX83	5VPSD36L683	5VPSB36D583	5VPSD36D083
5VPSB36L383	5VPSD36DX83002844	5VPSD36L983	5VPSD36L283	5VPSB36D683	5VPSD36D283
5VPSB36D583	5VPSD36D583002847	5VPSD36L883	5VPSD36L883	5VPSB36D683	5VPSD36D483
5VPSB36D783	5VPSD36D 183002862	5VPSD36LX83	5VPSD36L183	5VPSB36D783	5VPSD36D583
5VPSD36D783	5VPSD36D 183002859	5VPSD36L683	5VPSD36L783	5VPSB36D983	5VPSD36D883
5VPSB36D483	5VPSD36D683002856	5VPSD36L783	5VPSD36L783	5VPSB36D983	5VPSD36D983
5VPSB36D083	5VPSD36D583002850	5VPSD36L283	5VPSD36L883	5VPSB36D983	5VPSD36D983
5VPSB36C783	5VPSD36L483002880	5VPSD36L383	5VPSD36D483	5VPSB36DX83	5VPSD36DX83
5VPSD36D583	5VPSD36D083002853	5VPSD36C383	5VPSD36D183	5VPSB36DX83	5VPSD36D083
5VPSD36D683	5VPSD36L383002868	5VPSD36D583	5VPSD36D783	5VPSD36D083	5VPSD36D883
5VPSD36D983	5VPSD36L383002871	5VPSD36D483	5VPSD36D683	5VPSB36D283	5VPSD36D083
5VPSD36D783	5VPSD36L483002877	5VPSD36D583	5VPSD36D783	5VPSB36D283	5VPSD36D583
5VPSD36D083	5VPSD36L983002874	5VPSD36DX83	5VPSD36D383	5VPSB36DX83	5VPSD36D983
5VPSD36D783	5VPSD36L X83002883	5VPSD36D883	5VPSD36DX83	5VPSB36D083	5VPSD36D283
5VPSD36D583	5VPSD36L 283002912	5VPSD36DX83	5VPSD36DX83	5VPSB36D383	5VPSD36D483
5VPSD36D483	5VPSD36L 183002903	5VPSD36D183	5VPSD36D683	5VPSB36D483	5VPSD36D683
5VPSD36D683	5VPSD36L283002909	5VPSD36D083	5VPSD36D983	5VPSB36D483	5VPSD36D983
5VPSD36D883	5VPSD36L783002906	5VPSD36D483	5VPSD36D583	5VPSB36D583	5VPSD36D383
5VPSD36D383	5VPSD36L683002900	5VPSD36D983	5VPSD36D083	5VPSB36D683	5VPSD36D283
5VPSD36D683	5VPSB36DX83002915	5VPSD36D883	5VPSD36D083	5VPSB36D883	5VPSD36D383
5VPSD36D183	5VPSD36L X83002897	5VPSD36D083	5VPSD36D083	5VPSB36D883	5VPSD36D783
5VPSD36D983	5VPSD36L483002894	5VPSD36D183	5VPSD36D683	5VPSB36D883	5VPSD36D683
5VPSD36L383	5VPSB36D583002921	5VPSD36D483	5VPSD36D983	5VPSB36D983	5VPSD36DX83
5VPSD36DX83	5VPSB36D583002918	5VPSD36D883	5VPSD36D583	5VPSD36D583	5VPSD36D283
5VPSD36L983	5VPSD36L983002888	5VPSD36D683	5VPSD36D883	5VPSD36D583	5VPSD36D483
5VPSD36D783	5VPSD36L983002891	5VPSD36D783	5VPSD36D583	5VPSD36D283	5VPSB36D283
5VPSD36D883	5VPSD36D 183002960	5VPSD36D383	5VPSD36D283	5VPSD36D283	5VPSB36D483
5VPSD36DX83	5VPSD36D983002933	5VPSD36D283	5VPSD36D983	5VPSD36D483	5VPSD36D183
5VPSD36DX83	5VPSD36D783002963	5VPSD36D983	5VPSD36D483	5VPSD36D183	5VPSD36D583
5VPSD36D283	5VPSD36D683002954	5VPSD36D183	5VPSD36D383	5VPSD36D783	5VPSD36D783
5VPSD36D083	5VPSD36DX83002939	5VPSD36D283	5VPSD36D983	5VPSB36D083	5VPSD36D883
5VPSD36D983	5VPSD36D483002936	5VPSD36D383	5VPSD36D083	5VPSD36D583	5VPSD36DX83
5VPSD36D483	5VPSB36D683002927	5VPSD36D783	5VPSD36D283	5VPSD36D683	5VPSD36DX83
5VPSD36D183	5VPSD36D583002945	5VPSD36D983	5VPSD36D383	5VPSD36D683	5VPSD36D483
5VPSD36D583	5VPSD36DX83002942	5VPSD36D083	5VPSD36D383	5VPSD36D983	5VPSD36DX83
5VPSD36D983	5VPSB36D683002930	5VPSD36D383	5VPSD36D683	5VPSD36DX83	5VPSD36D983
5VPSD36L383	5VPSD36D083002948	5VPSD36DX83	5VPSD36D883	5VPSD36DX83	5VPSD36D883
5VPSD36D783	5VPSD36D 183002957	5VPSD36D183	5VPSD36D883	5VPSD36DX83	5VPSD36D183
5VPSD36L183	5VPSD36D083002951	5VPSD36D783	5VPSD36D483	5VPSD36D683	5VPSD36D583
5VPSD36L483	5VPSB36D083002924	5VPSD36D183	5VPSD36D583	5VPSD36D383	5VPSD36D783
5VPSD36L583	5VPSD36D883002969	5VPSD36D483	5VPSD36D683	5VPSD36D783	5VPSD36D283
5VPSD36L983	5VPSD36D883002972	5VPSD36D883	5VPSD36D283	5VPSD36D283	5VPSD36D283
5VPSD36L283	5VPSD36D983002981	5VPSD36D083	5VPSD36DX83	5VPSD36D083	5VPSD36D183
5VPSD36L783	5VPSD36D383002975	5VPSD36D883	5VPSD36D383	5VPSD36D283	5VPSD36D083

Attachment c.2 (Vehicles Potentially Containing the Defect)

VIN	VIN	VIN	VIN	VIN	VIN
5VPSB36L983	5VPSD36D283	5VPSD36DX83004240	5VPSD36DX83	5VPSD36D383	5VPSD36D583
5VPSD36D983	5VPSD36D183	5VPSD36D083004246	5VPSD36D183	5VPSD36D483	5VPSD36DX83
5VPSD36DX83	5VPSD36D983	5VPSD36D283004278	5VPSD36D083	5VPSD36D683	5VPSD36D083
5VPSD36D883	5VPSD36D683	5VPSD36D483004234	5VPSD36D983	5VPSD36D183	5VPSD36D283
5VPSD36C483	5VPSD36D183	5VPSD36D583004257	5VPSD36D083	5VPSD36D883	5VPSD36D383
5VPSD36D783	5VPSD36D083	5VPSD36D783004261	5VPSD36D183	5VPSD36D983	5VPSD36D383
5VPSB36L483	5VPSD36D483	5VPSD36D983004259	5VPSD36D783	5VPSD36D383	5VPSD36D483
5VPSB36LX83	5VPSD36D083	5VPSD36D583004307	5VPSD36D883	5VPSD36D083	5VPSD36D583
5VPSD36D283	5VPSD36D583	5VPSD36D183004305	5VPSD36D883	5VPSD36D783	5VPSD36D683
5VPSD36D183	5VPSD36D683	5VPSD36D583004288	5VPSD36DX83	5VPSD36D883	5VPSD36D783
5VPSD36D383	5VPSD36DX83	5VPSD36D483004282	5VPSD36D783	5VPSD36DX83	5VPSD36D683
5VPSD36D783	5VPSD36DX83	5VPSD36D383004290	5VPSD36D583	5VPSD36DX83	5VPSD36D583
5VPSB36D283	5VPSD36DX83	5VPSD36D483004301	5VPSD36D983	5VPSB36D783	5VPSD36D883
5VPSD36D483	5VPSD36D283	5VPSD36D083004313	5VPSD36D183	5VPSD36D983	5VPSD36D383
5VPSD36D683	5VPSD36D783	5VPSD36D883004284	5VPSD36D783	5VPSB36D183	5VPSD36D383
5VPSD36DX83	5VPSD36D983	5VPSD36D83004296	5VPSD36D283	5VPSB36D383	5VPSB36D983
5VPSB36L283	5VPSD36D183	5VPSD36D283004300	5VPSD36D583	5VPSB36D583	5VPSD36D483
5VPSB36D383	5VPSD36D483	5VPSD36D183004286	5VPSD36D983	5VPSB36D883	5VPSB36D483
5VPSB36L183	5VPSD36D083	5VPSD36D783004311	5VPSD36DX83	5VPSD36D283	5VPSB36D583
5VPSD36D583	5VPSD36D783	5VPSD36D783004292	5VPSD36DX83	5VPSD36D583	5VPSB36D783
5VPSD36D983	5VPSD36D583	5VPSD36D083004294	5VPSD36D083	5VPSD36D683	5VPSD36D083
5VPSD36D283	5VPSD36D983	5VPSD36D883004298	5VPSD36D483	5VPSB36D583	5VPSD36D083
5VPSD36D783	5VPSD36D683	5VPSD36D883004303	5VPSD36D483	5VPSB36D483	5VPSD36D283
5VPSD36D183	5VPSD36D083	5VPSD36D983004309	5VPSD36D683	5VPSB36D083	5VPSD36D783
5VPSD36D383	5VPSD36D283	5VPSD36D483004315	5VPSD36D683	5VPSB36D383	5VPSD36D883
5VPSD36D883	5VPSD36D383	5VPSD36DX83004321	5VPSD36D883	5VPSB36D683	5VPSD36D983
5VPSD36D983	5VPSD36D883	5VPSD36D283004331	5VPSB36D183	5VPSB36D183	5VPSD36DX83
5VPSD36DX83	5VPSD36DX83	5VPSD36D883004317	5VPSB36D683	5VPSB36D283	5VPSD36D283
5VPSD36D883	5VPSD36D583	5VPSD36D583004341	5VPSD36D283	5VPSB36D383	5VPSD36D583
5VPSD36D183	5VPSD36D283	5VPSD36DX83004335	5VPSD36D083	5VPSB36D483	5VPSB36D983
5VPSD36D483	5VPSD36D883	5VPSD36D783004339	5VPSB36D083	5VPSB36D683	5VPSD36D583
5VPSD36D583	5VPSD36D783	5VPSD36D783004325	5VPSD36D083	5VPSB36D783	5VPSD36DX83
5VPSD36D683	5VPSD36D983	5VPSD36D483004329	5VPSB36D583	5VPSB36D783	5VPSD36D983
5VPSD36D783	5VPSD36D583	5VPSD36D383004323	5VPSB36D683	5VPSB36D883	5VPSD36D483
5VPSD36DX83	5VPSD36D683	5VPSD36D683004333	5VPSD36D683	5VPSB36D983	5VPSD36D683
5VPSD36D583	5VPSD36D483	5VPSD36D983004343	5VPSB36D083	5VPSB36DX83	5VPSD36D283
5VPSD36DX83	5VPSD36D883	5VPSD36D083004327	5VPSB36D083	5VPSD36D283	5VPSD36D283
5VPSB36DX83	5VPSD36D783	5VPSD36D183004319	5VPSB36D183	5VPSD36D083	5VPSD36D083
5VPSD36D283	5VPSD36D583	5VPSD36D383004337	5VPSD36D183	5VPSD36DX83	5VPSD36D183
5VPSD36LX83	5VPSD36D083	5VPSD36D983004357	5VPSD36D183	5VPSD36D583	5VPSD36D183
5VPSD36D283	5VPSD36D883	5VPSD36D483004363	5VPSD36D283	5VPSD36DX83	5VPSD36D283
5VPSD36D883	5VPSD36DX83	5VPSD36D683004378	5VPSD36D783	5VPSD36D083	5VPSD36D383
5VPSD36L083	5VPSD36D683	5VPSD36D883004365	5VPSD36D183	5VPSD36D983	5VPSD36D583
5VPSD36L483	5VPSD36DX83	5VPSD36D183004367	5VPSD36D383	5VPSD36D583	5VPSD36D783
5VPSD36LX83	5VPSD36D383	5VPSD36D183004353	5VPSB36D883	5VPSD36D183	5VPSD36D783
5VPSD36D083	5VPSD36D483	5VPSD36DX83004349	5VPSB36D283	5VPSD36D883	5VPSD36D883
5VPSD36L583	5VPSD36D083	5VPSD36D983004374	5VPSB36D783	5VPSD36D483	5VPSD36D983
5VPSD36D283	5VPSD36D083	5VPSD36D483004380	5VPSB36D883	5VPSD36D683	5VPSD36DX83
5VPSD36D883	5VPSD36D683	5VPSD36D583004355	5VPSD36D883	5VPSD36D983	5VPSD36D083
5VPSD36D483	5VPSD36D283	5VPSD36D883004351	5VPSD36D983	5VPS136D083	5VPSD36D983
5VPSD36D983	5VPSD36D883	5VPSD36D883004382	5VPSB36D383	5VPSD36D383	5VPSD36DX83
5VPSD36D883	5VPSD36D183	5VPSD36D083004361	5VPSB36D483	5VPSD36D583	5VPSD36D083
5VPSD36D383	5VPSD36D783	5VPSD36D183004370	5VPSB36D583	5VPSB36D783	5VPSD36D483
5VPSD36D183	5VPSD36D583	5VPSD36D583004369	5VPSB36D783	5VPSD36D183	5VPSD36D883
5VPSD36D783	5VPSD36D283	5VPSD36D183004384	5VPSB36D983	5VPSD36D083	5VPSD36D683
5VPSD36D083	5VPSD36D983	5VPSD36D283004345	5VPSB36D983	5VPS136D683	5VPSD36D883
5VPSD36D683	5VPSD36D483	5VPSD36D283004359	5VPSB36DX83	5VPSD36DX83	5VPSD36D383
5VPSD36D983	5VPSD36D383	5VPSD36D283004376	5VPSB36L683	5VPS136D183	5VPSD36D683
5VPSD36D183	5VPSD36D583	5VPSD36D583004372	5VPSD36DX83	5VPS136D183	5VPSD36D183
5VPSD36DX83	5VPSD36D683	5VPSD36D683004347	5VPSD36D483	5VPS136D283	5VPSD36D183
5VPSD36D083	5VPSD36D483	5VPSD36D783004390	5VPSD36D483	5VPS136D283	5VPSD36D283
5VPSD36D583	5VPSD36DX83	5VPSD36DX83004416	5VPSD36D583	5VPS136D783	5VPSD36D383
5VPSD36D383	5VPSD36D183	5VPSD36D083004408	5VPSD36D783	5VPSB36D183	5VPSD36D783
5VPSD36D583	5VPSD36D083	5VPSD36D183004398	5VPSD36D283	5VPSD36D083	5VPSD36DX83
5VPSD36D483	5VPSD36D083	5VPSD36D383004418	5VPSD36LX83	5VPSD36D183	5VPSD36D083
5VPSD36D983	5VPSD36D583	5VPSD36D983004424	5VPSD36D283	5VPSD36D683	5VPSD36D083
5VPSD36DX83	5VPSD36D883	5VPSD36D083004392	5VPSD36D883	5VPSD36D783	5VPSD36D183
5VPSD36C083	5VPSD36D683	5VPSD36D683004414	5VPSD36D683	5VPSD36D283	5VPSD36D083
5VPSD36D183	5VPSD36DX83	5VPSD36D483004394	5VPSD36D083	5VPSD36D883	5VPSD36DX83
5VPSD36D683	5VPSD36D283	5VPSD36D583004422	5VPSD36D183	5VPSD36D383	5VPSD36D583
5VPSD36D683	5VPSD36D783	5VPSD36D683004400	5VPSD36D383	5VPSD36D883	5VPSD36D183

Attachment c.2 (Vehicles Potentially Containing the Defect)

VIN	VIN	VIN	VIN	VIN	VIN
5VPSD36D283	5VPSD36D083	5VPSD36D183	5VPSD36D383	5VPSD36D483	5VPSD36D283
5VPSD36D383	5VPSD36D683	5VPSD36D883	5VPSD36D583	5VPSB36D383	5VPSD36D783
5VPSD36D883	5VPSD36D783	5VPSD36D383	5VPSD36D683	5VPSB36D683	5VPSD36D283
5VPSD36D983	5VPSD36D083	5VPSD36D783	5VPSD36D983	5VPSB36D083	5VPSD36D383
5VPSD36D883	5VPSD36D683	5VPSD36D283	5VPSD36D883	5VPSB36D783	5VPSD36D383
5VPSD36D183	5VPSD36D183	5VPSD36D983	5VPSD36D183	5VPSD36D983	5VPSD36D483
5VPSD36D983	5VPSD36D X83	5VPSD36D583	5VPSD36D183	5VPSB36D683	5VPSD36D583
5VPSD36D783	5VPSD36D883	5VPSD36D983	5VPSD36D083	5VPSB36D583	5VPSD36D583
5VPSD36D683	5VPSD36D X83	5VPSD36D X83	5VPSD36D683	5VPSD36D983	5VPSD36D683
5VPSD36D783	5VPSD36D383	5VPSD36D983	5VPSD36D783	5VPS236D283	5VPSD36D683
5VPSD36D683	5VPSD36D283	5VPSD36D583	5VPSD36D283	5VPS236D283	5VPSD36D783
5VPSD36D783	5VPSD36D983	5VPSD36D383	5VPSD36D683	5VPS236D883	5VPSD36D883
5VPSD36DX83	5VPSD36D783	5VPSD36D683	5VPSD36D083	5VPSB36D183	5VPSD36D883
5VPSD36DX83	5VPSD36D283	5VPSD36D883	5VPSD36D583	5VPSB36D983	5VPSD36D883
5VPSD36D683	5VPSD36D583	5VPSD36DX83	5VPSD36D283	5VPS236D583	5VPSD36D983
5VPSD36D583	5VPSD36D483	5VPSD36D483	5VPSD36DX83	5VPSB36D383	5VPSD36D983
5VPSD36L583	5VPSD36D183	5VPSD36D183	5VPSD36D383	5VPSB36D383	5VPSD36D083
5VPSD36D783	5VPSD36D983	5VPSD36D283	5VPSD36D083	5VPSD36D983	5VPSD36D283
5VPSD36L083	5VPSD36D083	5VPSD36D983	5VPSD36D583	5VPSD36D983	5VPSD36D983
5VPSD36D083	5VPSD36D983	5VPSD36D583	5VPSD36D683	5VPSB36D983	5VPSD36D883
5VPSD36D183	5VPSD36D683	5VPSD36D983	5VPSD36D383	5VPS236D083	5VPSD36DX83
5VPSD36D283	5VPSD36D283	5VPSD36D583	5VPSD36D483	5VPSD36D483	5VPSD36D383
5VPSD36D783	5VPSD36D183	5VPSD36D583	5VPSD36D183	5VPSB36DX83	5VPSD36D283
5VPSD36D583	5VPSD36D783	5VPSD36D283	5VPSD36DX83	5VPS236D583	5VPSD36D183
5VPSD36D883	5VPSD36D383	5VPSD36D383	5VPSD36D883	5VPS236D683	5VPSD36D183
5VPSD36D083	5VPSD36D883	5VPSD36D883	5VPSD36D383	5VPSB36D283	5VPSD36D283
5VPSD36L483	5VPSD36D083	5VPSD36D483	5VPSD36D583	5VPSB36D483	5VPSD36D583
5VPSD36L483	5VPSD36D183	5VPSD36D883	5VPSD36D283	5VPSB36D483	5VPSD36D683
5VPSD36D383	5VPSD36D483	5VPSD36DX83	5VPSD36D583	5VPSB36D783	5VPSD36D783
5VPSD36D383	5VPSD36D X83	5VPSD36D283	5VPSD36D083	5VPSB36D883	5VPSD36D983
5VPSD36D983	5VPSD36D983	5VPSD36D183	5VPSD36D783	5VPSD36D183	5VPSD36D283
5VPSD36D983	5VPSD36D583	5VPSD36D483	5VPSD36D783	5VPSD36D683	5VPSD36D283
5VPSD36DX83	5VPSD36D783	5VPSD36D083	5VPSD36D983	5VPSD36D083	5VPSD36D383
5VPSD36D483	5VPSD36D883	5VPSD36D083	5VPSD36D183	5VPSD36D583	5VPSD36D783
5VPSD36D483	5VPSD36D783	5VPSD36D183	5VPSD36D483	5VPSD36D083	5VPSD36D883
5VPSD36D583	5VPSD36D083	5VPSD36D283	5VPSD36D683	5VPSD36D183	5VPSD36D183
5VPSD36D983	5VPSD36D383	5VPSD36D583	5VPSD36D283	5VPSD36D783	5VPSD36D483
5VPSD36D083	5VPSD36D383	5VPSD36D683	5VPSD36DX83	5VPSB36D683	5VPSD36D183
5VPSD36D283	5VPSD36D483	5VPSD36D683	5VPSD36D783	5VPS236D983	5VPSD36D783
5VPSB36L383	5VPSD36D283	5VPSD36D783	5VPSD36D783	5VPSD36D783	5VPSD36D983
5VPSD36L483	5VPSD36D583	5VPSD36DX83	5VPSD36D983	5VPSB36D083	5VPSD36DX83
5VPSB36LX83	5VPSD36DX83	5VPSD36D583	5VPSD36D383	5VPSB36DX83	5VPSD36D083
5VPSD36D583	5VPSD36D983	5VPSD36D883	5VPSD36D183	5VPSD36D883	5VPSD36D283
5VPSD36D883	5VPSD36D883	5VPSD36D983	5VPSD36D283	5VPSD36D283	5VPSD36D983
5VPSD36D283	5VPSD36D283	5VPSD36D683	5VPSD36D883	5VPS136D183	5VPSD36D383
5VPSD36D083	5VPSD36D083	5VPSD36D183	5VPSD36D483	5VPSB36D583	5VPSD36D183
5VPSD36D083	5VPSB36D483	5VPSB36D383	5VPSD36D083	5VPSD36D583	5VPSD36D483
5VPSD36D783	5VPSB36D983	5VPSD36D583	5VPSD36D283	5VPSB36D683	5VPSD36D683
5VPSD36DX83	5VPSD36DX83	5VPSD36D483	5VPSD36D383	5VPSB36D783	5VPSD36D883
5VPSD36D183	5VPSB36D183	5VPSD36D183	5VPSD36D583	5VPSB36D983	5VPSD36D983
5VPSD36D583	5VPSB36D883	5VPSD36D883	5VPSD36DX83	5VPSB36D483	5VPSD36D283
5VPSD36D883	5VPSB36D283	5VPSD36D083	5VPSD36D983	5VPSB36D483	5VPSD36D483
5VPSD36DX83	5VPSD36D883	5VPSD36D283	5VPSD36D883	5VPSB36D283	5VPSD36D883
5VPSD36D683	5VPSB36D783	5VPSD36D283	5VPSD36D383	5VPSB36D083	5VPSD36DX83
5VPSD36D783	5VPSB36D083	5VPSD36D583	5VPSD36D883	5VPSB36D083	5VPSD36D183
5VPSD36D183	5VPSB36D283	5VPSD36DX83	5VPSB36D283	5VPSB36D183	5VPSD36D383
5VPSD36D983	5VPSD36D083	5VPSD36DX83	5VPSB36D483	5VPSB36D183	5VPSD36D083
5VPSD36D983	5VPSD36D683	5VPSB36DX83	5VPSB36D383	5VPSB36D283	5VPSD36D683
5VPSD36D083	5VPSB36D183	5VPSD36C983	5VPSB36D883	5VPSB36D383	5VPSD36D783
5VPSD36D583	5VPSD36D783	5VPSD36D383	5VPSD36D483	5VPSB36D383	5VPSD36D383
5VPSD36D383	5VPSD36D283	5VPSD36D783	5VPSB36D983	5VPSB36D583	5VPSD36DX83
5VPSD36D283	5VPSD36D183	5VPSD36D983	5VPSB36D983	5VPSD36D683	5VPSD36D383
5VPSD36D483	5VPSB36D483	5VPSD36D983	5VPSD36D483	5VPSB36D883	5VPSD36D283
5VPSD36D883	5VPSB36D683	5VPSD36D683	5VPSD36D383	5VPSB36DX83	5VPSD36D083
5VPSD36D183	5VPSD36D683	5VPSD36D483	5VPSD36D383	5VPSD36D083	5VPSD36D783
5VPSD36D183	5VPSD36D183	5VPSB36D483	5VPSD36L083	5VPSB36DX83	5VPSD36D383
5VPSD36D483	5VPSD36DX83	5VPSB36D883	5VPSD36L183	5VPSB36D283	5VPSD36D283
5VPSD36D683	5VPSD36D083	5VPSD36D083	5VPSD36D883	5VPSB36D183	5VPSD36DX83
5VPSD36D383	5VPSB36D383	5VPSB36D983	5VPSD36L683	5VPSD36D883	5VPSD36D883
5VPSD36D283	5VPSD36D683	5VPSB36DX83	5VPSD36L283	5VPSD36D483	5VPSD36D183
5VPSD36DX83	5VPSD36D983	5VPSB36D483	5VPSD36L183C	5VPSD36D283	5VPSD36D783

Attachment c.2 (Vehicles Potentially Containing the Defect)

VIN	VIN	VIN	VIN	VIN	VIN
5VPSD36L783	5VPSD36D383	5VPSB36D283	5VPSD36L583	5VPSB36D483	5VPSD36D883
5VPSD36LX83	5VPSB36D883	5VPSB36D183	5VPSD36L883	5VPSB36D283	5VPSD36D483
5VPSD36D183	5VPSD36D283	5VPSB36D583	5VPSB36D583	5VPSB36D583	5VPSD36D083
5VPSD36D883	5VPSD36D883	5VPSB36D683	5VPSB36D583	5VPSB36D683	5VPSD36D383
5VPSD36D583	5VPSD36D683	5VPSB36D383	5VPSB36DX83	5VPSB36D783	5VPSD36D483
5VPSD36D083	5VPSD36D483	5VPSB36D683	5VPSD36L583	5VPSD36D383	5VPSD36D583
5VPSD36D483	5VPSB36D783	5VPSB36D183	5VPSD36L783	5VPSD36D383	5VPSD36D683
5VPSD36D783	5VPSD36D183	5VPSB36D883	5VPSD36L183	5VPSD36D983	5VPSD36D983
5VPSD36D683	5VPSD36D783	5VPSB36DX83	5VPSD36L583	5VPSD36D483	5VPSD36D283
5VPSD36D283	5VPSD36D783	5VPSB36D283	5VPSD36L083	5VPSD36D383	5VPSD36D083
5VPSD36D883	5VPSD36D383	5VPSB36D083	5VPSD36L383	5VPSD36D983	5VPSD36D383
5VPSD36D383	5VPSD36D183	5VPSB36D083	5VPSB36D083	5VPSD36D783	5VPSD36D583
5VPSD36DX83	5VPSD36D783	5VPSB36D383	5VPSB36D483	5VPSD36D283	5VPSD36D183
5VPSD36D783	5VPSD36D083	5VPSB36D483	5VPSB36D583	5VPSD36D183	5VPSB36D283
5VPSD36D983	5VPSD36D283	5VPSB36D783	5VPSB36D683	5VPSD36DX83	5VPSB36D383
5VPSD36D383	5VPSD36D783	5VPSB36D083	5VPSD36D683	5VPSD36D783	5VPSB36D883
5VPSD36D083	5VPSD36D983	5VPSB36D983	5VPSB36D983	5VPSD36DX83	5VPSD36D283
5VPSD36D183	5VPSD36DX83	5VPSB36D983	5VPSB36D983	5VPSD36DX83	5VPSD36D383
5VPSD36D183	5VPSD36D383	5VPSD36D583	5VPSB36DX83	5VPSD36D283	5VPSD36D483
5VPSD36D483	5VPSD36D583	5VPSD36D283	5VPSB36DX83	5VPSD36D983	5VPSD36D683
5VPSD36D683	5VPSD36D483	5VPSD36DX83	5VPSD36L683	5VPSD36D283	5VPSD36D683
5VPSD36D883	5VPSD36D883	5VPSD36D383	5VPSD36L683	5VPSD36D083	5VPSD36D783
5VPSD36D183	5VPSD36D883	5VPSD36D883	5VPSD36LX83	5VPSD36D083	5VPSD36D883
5VPSD36DX83	5VPSD36D083	5VPSD36D683	5VPSD36D583	5VPSD36D183	5VPSD36D983
5VPSD36D983	5VPSD36DX83	5VPSB36L183	5VPSD36D583	5VPSD36D183	5VPSD36D983
5VPSD36D983	5VPSD36D683	5VPSB36L383	5VPSD36D483	5VPSD36D283	5VPSD36D783
5VPSB36L583	5VPSD36D983	5VPSB36L083	5VPSD36D583	5VPSD36D383	5VPSD36D783
5VPSD36D283	5VPSD36D983	5VPSB36L083	5VPSD36DX83	5VPSD36D483	5VPSD36D383
5VPSD36D583	5VPSD36D583	5VPSB36L283	5VPSD36D483	5VPSD36D583	5VPSB36D383
5VPSD36D383	5VPSD36D783	5VPSB36L483	5VPSD36D083	5VPSD36D583	5VPSD36D083
5VPSB36L683	5VPSD36D183	5VPSB36L483	5VPSD36D083	5VPSD36D683	5VPSD36D183
5VPSD36D983	5VPSD36D583	5VPSB36L583	5VPSD36D583	5VPSD36D683	5VPSD36D283
5VPSD36L883	5VPSD36D683	5VPSB36L783	5VPSD36D383	5VPSD36D883	5VPSD36D383
5VPSD36L383	5VPSD36D083	5VPSB36L883	5VPSD36D783	5VPSD36D983	5VPSD36D483
5VPSD36D183	5VPSD36D483	5VPSB36L983	5VPSD36D683	5VPSD36DX83	5VPSD36D483
5VPSD36D583	5VPSD36D983	5VPSD36D483	5VPSD36D083	5VPSD36DX83	5VPSD36D583
5VPSD36L983	5VPSD36D383	5VPSD36D783	5VPSD36D283	5VPSB36D183	5VPSD36D683
5VPSD36D483	5VPSD36D683	5VPSD36C083	5VPSD36D983	5VPSB36D183	5VPSD36D883
5VPSD36DX83	5VPSD36D583	5VPSD36DX83	5VPSD36D783	5VPSD36D483	5VPSD36DX83
5VPSB36L983	5VPSD36DX83	5VPSD36D083	5VPSD36D883	5VPSB36D383	5VPSD36DX83
5VPSD36D483	5VPSD36D483	5VPSD36D083	5VPSD36D183	5VPSB36D283	5VPSD36D083
5VPSD36D083	5VPSD36D083	5VPSD36D283	5VPSD36D683	5VPSB36D983	5VPSD36D483
5VPSD36D983	5VPSD36D683	5VPSD36D983	5VPSD36D083	5VPSD36D283	5VPSD36D283
5VPSD36D483	5VPSD36D883	5VPSD36D483	5VPSD36D583	5VPSD36D783	5VPSD36D183
5VPSD36D683	5VPSB36L883	5VPSD36D483	5VPSD36D583	5VPSB36D283	5VPSD36D583
5VPSD36D983	5VPSB36L683	5VPSD36D683	5VPSD36D483	5VPSB36D583	5VPSD36D683
5VPSD36D883	5VPSB36L683	5VPSD36D683	5VPSD36D983	5VPSB36DX83	5VPSD36DX83
5VPSD36D383	5VPSD36D983	5VPSD36D383	5VPSD36DX83	5VPSB36D883	5VPSD36D783
5VPSD36D883	5VPSB36L183	5VPSD36D883	5VPSD36DX83	5VPSB36D083	5VPSD36D983
5VPSD36D583	5VPSB36L983	5VPSD36D583	5VPSD36DX83	5VPSB36D483	5VPSB36D883
5VPSD36D583	5VPSB36L783	5VPSD36D783	5VPSD36D583	5VPSB36D583	5VPSD36D883
5VPSD36D983	5VPSB36L783	5VPSD36D183	5VPSD36D683	5VPSB36D683	5VPSD36D383
5VPSD36D183	5VPSB36L283				