

SERVICE BULLETIN



M-1236

Safety Recall Code 0136

December 08, 2008

2009 Dyna Fuel Tank Vent Tube Assembly Recall

Purpose

Harley-Davidson has determined that a condition affecting motor vehicle safety exists on certain 2009 model year FXDB, FXDC, FXDF, FXDL vehicles. These motorcycles have a fuel tank vent tube assembly (Part No. 27389-04A) which may have been produced at the supplier with a questionable ultrasonic weld on the anti-slosh valve. If the valve separates and the bike is tipped over, it may leak fuel. This condition could lead to a fire, which could cause injury or death to the rider.

In the interest of motor vehicle safety and customer satisfaction, Harley-Davidson has elected to initiate a voluntary recall (Campaign 0136) to remedy this defect. As required by law, you may sell but NOT DELIVER any affected motorcycles to your customers until the recall is performed.

See Required Dealer Action to perform the recall service.

Motorcycles Affected

This recall applies to 2009 model year FXDB, FXDC, FXDF, FXDL vehicles built July 22, 2008 through July 25, 2008. A VIN list specific to vehicles shipped to your dealership is available via h-dnet.com and is no longer attached to mailed bulletins. This list may be found by following this path:

h-dnet.com / Service Toolbox / Safety campaign and Open VIN lists. Select 0136 campaign to view VIN list.

NOTE

If the vehicle does not appear on your dealer VIN list, refer to Safety and Product Campaign History by VIN link to verify if vehicle is affected.

Customer Notification

In accordance with Federal regulations administrated by NHTSA, Harley-Davidson Motor Company, Inc. will send a letter to registered owners of affected products in the United States notifying them of this safety-related condition and instructing them to contact their dealer for the replacement service. Samples of the customer letters are attached. Customers outside the United States market may not receive this notification. To protect the safety of our riders, it is our mutual responsibility to ensure the recall service is performed on all affected motorcycles. Therefore, we strongly urge you to perform the recall service even if the motorcycle was not purchased from your dealership

You are also required to perform the recall service on all affected vehicles in your dealership inventory prior to delivering, renting or leasing those vehicles. If you are not sure that a safety recall has been completed on a particular motorcycle, check the recall records available on TALON and h-dnet.com

IMPORTANT NOTE

Because only registered owners will receive notification from us, we request that you contact any owners of vehicles that your records show as unregistered. Advise them of the safety recall and make arrangements for them to come in for recall service. We also require that you provide us with their names, addresses and V.I.N.s as soon as possible to enable us to mail them an owner's letter, as required by the National Traffic and Motor Vehicle Safety Act (as amended).

Kit Ordering Information

One shipment of your total requirement of recall kits (Part No. 94719) will be made available the week of December 8, 2008. All kits will be shipped no charge, transportation paid via UPS1. If additional kits are needed, fill in the attached order form and fax it to the Warranty department at 414-343-8346. You must include your dealer number. Only one wave shipment will be sent.

NOTE

No kit orders will be accepted prior to the termination of the wave shipment date. Orders received prior to the termination of the wave shipments will be discarded. Termination notice of wave shipments will be sent.

Upon completion of the recall on any vehicle, please be certain to follow the instructions listed under Credit Procedure and submit your recall claims promptly.

**Table 1-1. Safety Recall Code 0136
Kit 94719 Contents**

QUANTITY	PART NUMBER	DESCRIPTION
1	27389-04A	Vent Tube with Anti-Slosh Valve

IMPORTANT NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	WARRANTY PROCESS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO.1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	RETURN THIS TO
INITIAL HERE									

©2008 H-D

Required Dealer Action

1. Verify motorcycle is involved in recall and recall is open.
2. Lay a protective cover over fuel tank.
3. Remove instrument panel. See Chapter 7 of the 2009 DYNA Models Service Manual.

NOTE

See Figure 1. Do not remove vent tube at slosh valve. Remove vent tube at top plate (1) and vapor valve (2).

4. Remove the anti-slosh valve and attached vent tubes.
5. See Figure 2. Install new anti-slosh valve and vent tubes from the recall kit.
6. Install instrument panel. See Chapter 7 of the 2009 DYNA Models Service Manual.

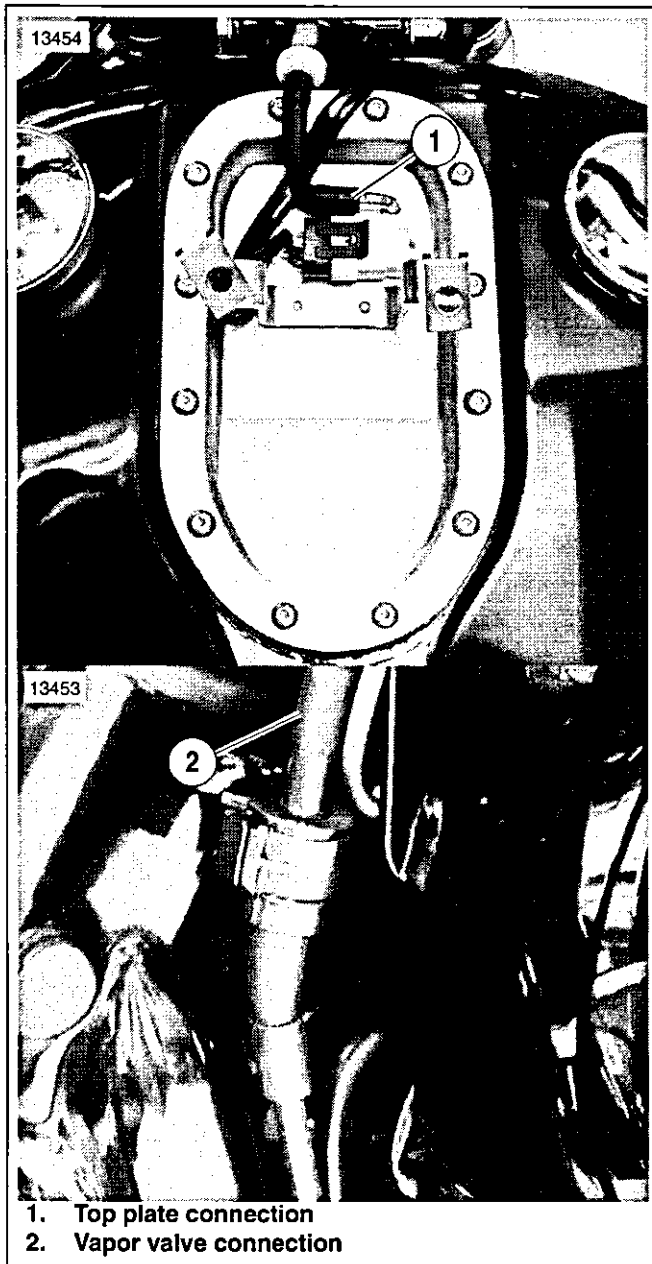


Figure 1. Vent Tube Connections

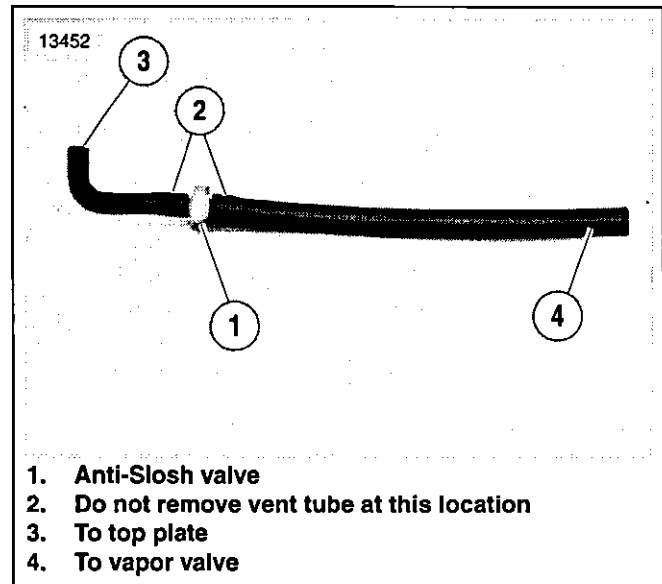


Figure 2. Anti-slosh Valve

Credit Procedure - Talon/ h-dnet.com/Lightspeed Warranty Claim Users

For each vehicle serviced, file an electronic recall claim following one of the tables that follows, depending on service required.

Table 1-2. Safety Recall Code 0136

ENTRY FIELD	ENTER
Claim Type	SRC
Problem Part	27389-04A
Quantity	Leave Blank
Primary Labor Code*	3564
Time	0.2
Customer Concern Code*	0136
Condition Code	9981
Replacement Kit Part No.	94719
Quantity	1
*These new codes may need to be downloaded into your system.	

Credit Procedure - All Other Warranty Claim Users

For each vehicle serviced, file a claim supplying all necessary information as follows:

- Dealer Number
- Repair Order Number
- Claim Date
- Campaign Number (0136)
- Fix ID (C) - Corrected
- Full Seventeen Character VIN

Credit Procedure - Dealer Inventory (All Markets)

No affected components were shipped as service parts. Dealer inventory components are not involved in this recall.

Upon receipt of the properly completed recall claim, you will be credited 0.2 hours of labor for performing the procedure, plus appropriate market administrative time. Hold all replaced parts for 60 days from date credit issued for possible field inspection and/or request for return to factory. After 60 days, destroy and discard the parts.

NOTE

Each vehicle recall inspection/correction must be filed on an individual claim. Please do not submit additional warranty events on the claims.

HARLEY-DAVIDSON MOTOR COMPANY
P.O. BOX 594, MILWAUKEE, WI U.S.A 53201
RECALL AND PRODUCT CAMPAIGN ORDER FORM

M-1236 SAFETY RECALL CODE 0136

TYPE CODE	ORDER TYPE	VEHICLE IDENTIFICATION NUMBER(S)
RC	RECALL	
PC	PRODUCT CAMPAIGN	

ORDER DATE
DEALER NUMBER

QUANTITY	PART NUMBER	ITEM
	94719	Code 0136: Fuel Tank Vent Tube
		NOTE: All orders are subject to approval. You may not receive the total quantity of kits ordered due to parts availability. If this happens, please submit another order for the balance, following all order procedures indicated in the Service Bulletin. Fax orders to the warranty department: 414-343-8346. You must include VIN number (if required) and your dealer number.

ALL ORDERS SUBJECT TO ACCEPTANCE AT MILWAUKEE, WI USA 53201

NOTE: An order acknowledgement is automatically generated and faxed to your dealership's fax number as listed in GDIS the same day as your order is entered at HDMC. This acknowledgement will provide you with the order status and order number. To retrieve order information based on the Harley-Davidson order number, go to P&A Order Inquiry on h-dnet.com under the Parts and Accessories link, select H-D Order Number, enter the order number and click "Submit". At the bottom of the page, click on "Track Part" to view tracking information for the order.

SAMPLE

Dear Harley-Davidson Motorcycle Owner:

This notice is being sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Harley-Davidson Motor Company, Inc. has decided that a defect relating to motor vehicle safety exists on certain 2009 model year FXDB, FXDC, FXDF, FXDL model motorcycles, built July 22, 2008 through July 25, 2008.

These 2009 model motorcycles have a fuel tank vent tube assembly, P/N 27389-04A, which may have been produced at the supplier with a questionable ultrasonic weld on the anti-slosh valve. If the valve separates and the bike is tipped over, it may leak fuel. This condition could lead to a fire, which could cause injury or death to the rider.

Our records indicate that you purchased one of the model motorcycles listed above that may have the condition involved in this recall.

We strongly urge you to contact your dealer to make arrangements to have the appropriate service performed as soon as possible.

Please contact your Harley-Davidson motorcycle dealer immediately and arrange an appointment to have your vehicle inspected and repaired if necessary. Actual dealer labor time to perform this service will be less than one hour; however, due to scheduling, the dealer may require your motorcycle for a longer period of time. The parts and labor will be free of charge to you. Shipping of recall kits to the dealerships will begin the week of December 8, 2008.

To verify that the service has been completed, your Dealer will ask you to sign a recall claim. If you have sold your motorcycle, please forward the appropriate information about your purchaser. This will enable us to contact him/her and advise that person of this recall. Also, Federal regulation requires that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessee within ten days.

If you have had this defect repaired before you received this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy of the problem associated with

this recall. For more information contact Harley-Davidson at 1-414-343-4056. Should you choose to ride your motorcycle prior to this service, we urge you to be aware of this condition.

If you take your motorcycle to your dealer on a mutually agreed upon date and they do not perform the required service to your satisfaction, please contact Harley-Davidson Motor Company, Inc. for immediate assistance at the address or telephone number listed on this letterhead. If your dealer or Harley-Davidson Motor Company, Inc. fails or is unable to remedy your motorcycle without charge within a reasonable time, you may wish to inform the Administrator, The National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE, Washington, DC 20590, or call the toll-free Auto Safety Hotline at 1-888-DASH-2DOT (TTY: 1-800-424-9153); or contact NHTSA at <http://www.safercar.gov>.

We regret any inconvenience this may cause you, but we are initiating this action in the interest of your personal safety and satisfaction with our products. Thank you for your cooperation.

Sincerely,

Harley-Davidson Motor Company, Inc.
0136



DEALER COMMUNICATIONS

Harley-Davidson Motor Company

Dealer Department Routing

<input checked="" type="checkbox"/> Dealer Principal	<input type="checkbox"/> General Merchandise	<input checked="" type="checkbox"/> Service
<input checked="" type="checkbox"/> General Manager	<input type="checkbox"/> Buell	<input checked="" type="checkbox"/> Parts
<input type="checkbox"/> Office Manager	<input type="checkbox"/> F&I Manager	
<input checked="" type="checkbox"/> Vehicle Sales Manager	<input type="checkbox"/> HOG Director	

December 1, 2008

ML - 445

Subject: SAFETY RECALL CAMPAIGN 0136

Dear Harley-Davidson Dealer:

Harley-Davidson Motor Company, Inc. has decided that a defect relating to motor vehicle safety may exist on certain 2009 model year FXDB, FXDC, FXDF, FXDL model motorcycles, built July 22, 2008 through July 25, 2008. These 2009 model motorcycles have a fuel tank vent tube assembly, P/N 27389-04A, which may have been produced at the supplier with a questionable ultrasonic weld on the anti-slosh valve. If the valve separates and the bike is tipped over, it may leak fuel. This condition could lead to a fire, which could cause injury or death to the rider.

We have voluntarily declared this a defect related to motor vehicle safety (Campaign 0136) to allow us to formally recall all affected motorcycles. The remedy is to remove the original vent tube assembly and replace it with a new vent tube assembly provided in our recall kit part number 94719. A service bulletin outlining the repair and credit procedure will follow within two weeks. Based on the schedule our supplier has provided we expect to begin shipping repair kits to service the entire population world-wide in one wave, on or before the week of December 8, 2008. Please reference the Service Bulletin for a detailed description of the defect.

In the interest of the safety of our mutual customers and as required by law, you may sell but NOT DELIVER any affected motorcycles to your customers until the remedy is completed. Please refer to h-dnet.com on the Service Page/Safety and Product Campaign/Open Safety Campaign Instructions and the Safety Campaign and Open VIN Lists in the Service Toolbox for an updated list of affected VINs for this recall. Select the appropriate campaign number link (0136) to view any outstanding vehicles involved.

In accordance with Federal regulations administered by NHTSA, Harley-Davidson Motor Company, Inc. will provide notice to all owners of record of affected products with direction to bring the vehicle in for the recall service.

Sincerely,
 Harley-Davidson Motor Company, Inc.
 0136