



Federal Recall Information

308-E

Supplier

Bendix Commercial Vehicle LLC

Quick Links

- [Best Buys](#)
- [Cross Reference](#)
- [Current Promotions](#)
- [ESA Administration](#)
- [PACTools](#)
- [Product Index](#)
- [SmartSearch Application](#)
- [SupportNet](#)
- [Web ECAT](#)

Description

Inspect and replace the dash mounted MV-3 tractor/trailer hand control valve manufactured by Bendix Commercial Vehicle

In This Page...


- [Supplier](#)
- [Description](#)
- [Release Date](#)
- [Introduction](#)
- [Situation](#)
- [Resolution](#)
- [Warranty](#)
- [Parts](#)
- [Labor](#)
- [Procedure](#)
- [Attachments](#)

Release Date

4/8/2008

Introduction

Certain tractor/trailer brake hand control valves (MV-3) manufactured by Bendix Commercial Vehicles have been manufactured out of specification resulting in a valve body to be oversized in the double check valve seat area.

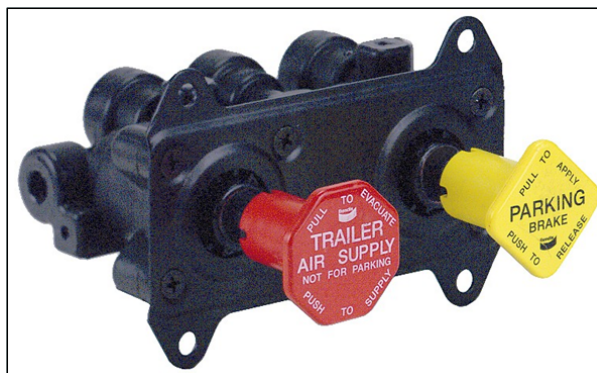

The oversize condition can allow the rubber double check valve to become lodged in the body opening under certain circumstances. If the valve becomes lodged and the primary reservoir fails, the secondary air reservoir will deplete causing a reduced ability to modulate the emergency brakes. In such event, the operator should observe an air leak, indications of low air pressure via the primary and secondary air gauges, and audible and visual low air pressure warning alarms. A vehicle crash is possible if these warnings are not heeded

Situation

This recall affects vehicles manufactured between January 17, 2008 and February 18, 2008 with air brakes.

Resolution

The recall is provided to inspect and replace the MV-3 valve

It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.

Warranty

The DWC system will indicate chassis involved in this recall with the designator of "**308-E**" in the campaign field.

Start a new claim (**one per chassis**) and reference the following information to complete the claim.

For Field...	Enter...
Failure Location	013-010-050 Tractor/Trailer Parking Valve
Failure Type	705 Federal Recall
Claim Type	C
Campaign Number	308-E
Labor	Refer to guidelines in the 'Labor' section
PFPN	<i>[enter the appropriate valve part number]</i>
CCC notes:	<i>[enter the date code you identified on the valve]</i>

Parts

Parts returns are required.

When returning parts:

1. Return to normal Bendix locations **but** do not combine shipments
2. Keep recall parts shipments separate from normal warranty shipments
3. Identify these return boxes with **RMA** number **MV3-9000**

Peterbilt will cover parts purchased through PACCAR Parts (dealer net+ 30% parts mark up) according to the schedule below.

PARTS		
	Part Number	Description
	802122BXW	MV-3 Valve for Conventional Model
	800257BXW	MV-3 Valve for Model 387
	800523BXW	MV-3 Valve for Conventional Medium Duty

Labor

The quick claim for this recall will reimburse labor according to the schedule below.

Labor		
013-xxx	0.2 hr	Inspect Only
013-852	0.3 hr	Inspect and replace Hand Valve, Trailer Brake - R & R (2005 New Interior Trucks)

Procedure

INSPECT:

Please find the attached Bendix procedure on how to inspect for a defective valve.

 [308-E Inspect procedures.pdf](#)

INSTALL:

Please find the attached Bendix procedure on how to install the MV-3 valve.

 [MV-3 Installation Instructions.pdf](#)

Attachments

 [308E dealer chassis list.xls](#)

 [308-E USCustLtr.doc](#)

 [308E CANCustLtr.doc](#)

© Copyright 2008 PACCAR Inc. All rights reserved. We welcome your [feedback](#) on this page. For technical questions or concerns about this page, please contact the [DealerNet Webmaster](#).