

FOREST RIVER, INC

GEORGETOWN BAGGAGE DOOR TRIM RECALL 08V-664 January 2009

Subject: Forest River Georgetown models have been produced with an aluminum baggage door trim under main floor slide rooms that may loosen and detach from the vehicle.

Units Affected: Model year 2007- 2009 Georgetown and Georgetown XL models starting with Forest River Serial number GTG014008 and ending with Forest River Serial number GTG016281. Georgetown SE models are excluded from this recall.

Correction: Following the diagrams attached, add fasteners to secure the aluminum baggage door trim to prevent any possibility of failure. The aluminum baggage door trim will only be found under main floor slide out rooms.

Claim Submittal: Please submit repairs made on any affected vehicle using a Forest River warranty claim form. Paper or web based claims will be accepted. Please use repair code 20-16350. Repair time is flat rated at .3 (per side).



This is an example of the aluminum baggage door trim that may loosen or detach. It will only be found under main floor slide out rooms.

Screws should be mounted from the bottom and installed vertically.

Maximum of 6" from end of extrusion to first screw.

Maximum of 12" between screws.

Screws should be #8, white, washer head, self-tapping.

