



Fleetwood Enterprises, Inc.
1010 Commerce Drive, P.O. Box 1007
Decatur, Indiana 46733

June 29, 2009

Mr. Daniel C. Smith
Associate Administrator for Enforcement
National Highway Traffic Safety Administration
1200 New Jersey Ave, SE
Washington, DC 20590

Re: Re-Amended - Safety Defect Report
Amended to April 21, 2009 notification to NHTSA.

Dear Mr. Smith:

On February 4, 2009 Fleetwood Enterprises, Inc., decided that a safety defect which relates to motor vehicle safety exists in certain motor homes as listed below, and is furnishing notification to the National Highway Traffic Safety Administration in accordance with 49 CFR Part 573 Defect and Non-compliance reports.

The following is the information required by 49 CFR Part 573:

- This amended report was prepared on June 29, 2009.
 - Fleetwood has assigned 90209, NHTSA 09V-056, as an identification code to this recall.
- (1) The affected motor homes were manufactured by the following wholly owned subsidiary of Fleetwood Enterprises, Inc.

Fleetwood Motor Homes of Indiana, Inc. #44
1031 U.S. 224 E., P.O. Box 31
Decatur, Indiana 46733

The agency should contact the following individual with respect to this recall:

Chuck James
Director – Parts & Service
Motor Home Division
1010 Commerce Dr., P.O. Box 1007
Decatur, Indiana 46733
Telephone: 260-728-9564
E-mail: chuck.james@fleetwood.com

- (2) The vehicles involved in the recall are certain 2006, 2007, 2008 and 2009 model year Providence, Excursion, Expedition, Discovery and Bounder Diesel model motor homes manufactured from: October, 2005 through June, 2008. The June, 2008 date coincides with the introduction of a newly designed modular style chassis that eliminated the problem.

These motor homes were built with a non-consecutive Fleetwood identification number range of:

Bounder Diesel	735N74400073 - 735V74499969
Discovery	770X84400002 - 770X74499986
Excursion	779L74400052 - 779X84499998
Expedition	730V84400068 - 730S74499960
Providence	772R84400054 - 772E84499999

- (3) Fleetwood reports approximately 3782 as the number of Providence, Excursion, Expedition, Discovery and Bounder Diesel model motor homes that contain the safety defect.
- (4) Fleetwood estimates that 100% of the affected Providence, Excursion, Expedition, Discovery and Bounder Diesel model motor homes contain the safety defect.
- (5) On certain Providence, Excursion, Expedition, Discovery and Bounder Diesel model motor homes affected by this recall, the battery cable is routed too close to a sharp edge that is located on top of a shelf installed over the driveshaft. This can cause abrasion to the battery cable insulation, leading to an electrical short and possibly a fire.
- (6) Not applicable.
- (7) Fleetwood began an investigation when this matter came to our attention on June 2, 2008, when a fire was reported in a customers unit at a campground.
- Fleetwood is not aware of any accidents or injuries that have resulted from this safety defect.
- (8) Fleetwood dealers will inspect, replace or repair damaged cables as necessary and install an edge guard to protect the wires from the sharp edge.
- (9) Fleetwood intends to conduct a dealer notification by e-mail in July, 2009.

Fleetwood intends to conduct a customer notification by UPS traceable in July, 2009.

 
Fleetwood does not foresee any problems with implementing this voluntary recall campaign.

(10) Copies of subsequent correspondence will be submitted to the NHTSA within five (5) working days of distribution. This correspondence will include:

- I) Letter of dealer notification
- II) Letter of customer notification
- III) Service Bulletin

A draft of these documents will be forthcoming for your review. If additional information is required, please contact Dave Fortney who can be reached by phone at (260) 724-5957 or by e-mail at dave.fortney@fleetwood.com.

Sincerely,



Chuck James
Director of Parts & Service
Motor Home Division