



October 12, 2009

SAFETY RECALL NOTICE

VOLUNTARY SAFETY RECALL CAMPAIGN # 09V-337

Dear UD Truck Owner:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Nissan Diesel America, Inc. has determined that a defect, which relates to motor vehicle safety, exists with specific 2007 and 2008 Model Year UD3300 model vehicles modified with dual steering by either Pioneer Drive LLC or Fontaine Modification Co as Intermediate Manufacturers. The vehicle identified on the enclosed "AUTHORIZATION FOR RECALL SERVICE" card fits this description and our records list you as the owner of this vehicle.

The right side steering drag link installation directional position and the steering stop adjustment on the listed VIN's may be incorrect after the dual steering modifications were completed by the intermediate manufacturers as follows.

- The right side steering drag link may have inadvertently been installed in the reverse position during the installation of the dual steering system.
- The steering stop adjustment may not have been properly adjusted after the dual steering system modification was completed.

Incorrect installation of the right side steering drag link and/or improper adjustment of the steering stops could allow the tire to contact the right side steering drag link during a full left turn. Continued operation with the right front tire contacting the right side steering drag link may result in structural weakening and bending of the drag link. This could result in a loss of steering control and/or cause a vehicle crash without warning to the vehicle operator.

As a remedy, the drag link will be inspected and replaced as required and the steering stops adjusted.

Please contact an authorized UD Truck Dealer as soon as possible to schedule an appointment to have the draglink inspected and steering stops adjusted at no charge to you. It is estimated that approximately 2.0 hours will be required to complete the repairs.

Federal regulations require that all vehicle lessors must notify all lessees within ten (10) days of receiving this notice.

IMPORTANT: We would appreciate your bringing the "AUTHORIZATION FOR RECALL SERVICE" card with you to the UD Truck Dealer at the time of your repair appointment. If you do not have the "AUTHORIZATION FOR RECALL SERVICE" card, please provide the Vehicle Identification Number (VIN) to the UD Truck Dealer when scheduling your appointment to verify that your vehicle requires this recall service.

You may be entitled to reimbursement of costs to repair a previous failure related to this recall. If you believe that you have paid for previous repairs related to this recall, please contact Nissan Diesel America, Inc. at (972) 756 - 5523.

If you no longer own or possess this vehicle, please fill in the requested information on the enclosed postage prepaid "AUTHORIZATION FOR RECALL SERVICE" card and return it to the Nissan Diesel America, Inc. Service Operations Department. This will allow proper identification and notification to the current owner of this vehicle.

You may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave., S.E., Washington, DC 20590 or call the toll free Vehicle Safety Hotline at 1-888 -327- 4236 (TTY 1-800-424-9153); or go to <http://www.safercar.gov>, if you believe that either Nissan Diesel America, Inc. or the UD Truck Dealer has failed or is unable to repair your vehicle without charge.

We regret any inconvenience this recall may have caused. If you have any questions regarding this recall, you may call the Nissan Diesel America, Inc. Service Operations Department at (972) 756 - 5523.

Sincerely,
NISSAN DIESEL AMERICA, INC.

C O R P O R A T E O F F I C E S

P.O. Box 152034, Irving, Texas 75015-2034 • 5930 West Campus Circle Drive, Irving, Texas 75063

Telephone 972-756-5500 • Fax 972-550-1255

<http://www.udtrucks.com>