



**RECEIVED**  
By Recall Mgt Div. at 7:57 am, Mar 02, 2010

**Recall Information Bulletin**

**No:** C1004110 **Issued:** 2/17/2010  
**NHTSA No:** 09V-449  
**Transport Canada No:** 09-325  
**Re:** Air Intake Duct  
**Group:** 15 **Models:** FE,FG

**SUBJECT:**

Safety Recall C1004110 - Air Intake Duct

**MODELS:**

FE83D, FE84D, FE85D and FG84D

**VEHICLES INVOLVED:**

Certain 2005 through 2010 model year FE83D, FE84D, FE85D and FG84D vehicles produced from May 27, 2004 through September 30, 2009.

A list of vehicles your Dealership has sold that require this Recall can be found on the Dealer's "Open Campaigns" list supplied by MFTA via Fusonet. Some individual vehicles described above may not need the Recall. Always check the "VIN Inquiry" tab under "Service" or "Warranty" on Fusonet to verify that the VIN requires this Safety Recall.

**Important note: It is a violation of Federal law for a dealer to deliver a new or used motor vehicle covered by this Recall Information Bulletin, under a sale or lease, until the Safety Recall has been completed.**

**OWNER NOTIFICATION:**

Owners of affected vehicles will be notified by mail. A copy of the customer notification letter can be found on Fusonet.

**CONDITION:**

Mitsubishi Fuso Truck of America, Inc. has decided that a defect which relates to motor vehicle safety exists in the air intake bracket rubber cushions. On affected vehicles, the weather resistance properties of the air intake duct rubber cushions are insufficient. During normal vehicle operation, the rubber cushions deteriorate and crack, causing abnormal noise. In the worst case, all of the rubber cushions could crack, allowing the air intake duct to fall off of the truck.

**MODIFICATION:**

Install improved air intake duct rubber cushions.

**PARTS TO BE REPLACED:**

The air intake duct rubber cushions will be replaced. The replacement parts kit **EX54A** is available through normal parts channels.

**RECALL PARTS RETENTION:**

All parts that have been removed and replaced must be properly identified and retained, as outlined in the Warranty and Service Policy Manual, section 3.8. The Product Support Manager will authorize their scrapping.

**RECALL CLAIM SUBMITTAL:**

Claim parts and labor via the DIN System using the Recall Claim Entry screen. Enter all requested information, including the Recall Number. The system will apply the labor allowance and parts pricing adjustment shown.


Recall Reimbursement					
Campaign Number	Models	Allowances		Labor Description	Part Numbers
C1004110	FE83D, FE84D, FE85D, FG84D	Labor Time	0.5 hours	Replacement of all air intake duct rubber cushions.	EX54A
		Parts Pricing	US\$27.98		

**PARTS PRICING ADJUSTMENT TABLE:**

Part #	Part Name	Qty	Dealer Net	33% Mark Up	Recall Reimbursement
EX54A	Air Intake Duct Cushion Kit	1	\$21.04	\$27.98	\$27.98

**PARTS KIT CONTENTS:**

Kit # EX54A		
Item #	Part Name	Qty
1	Cushion, Duct Upper	1
2	Cushion, Duct Support	1
3	Cushion, Duct Support	1

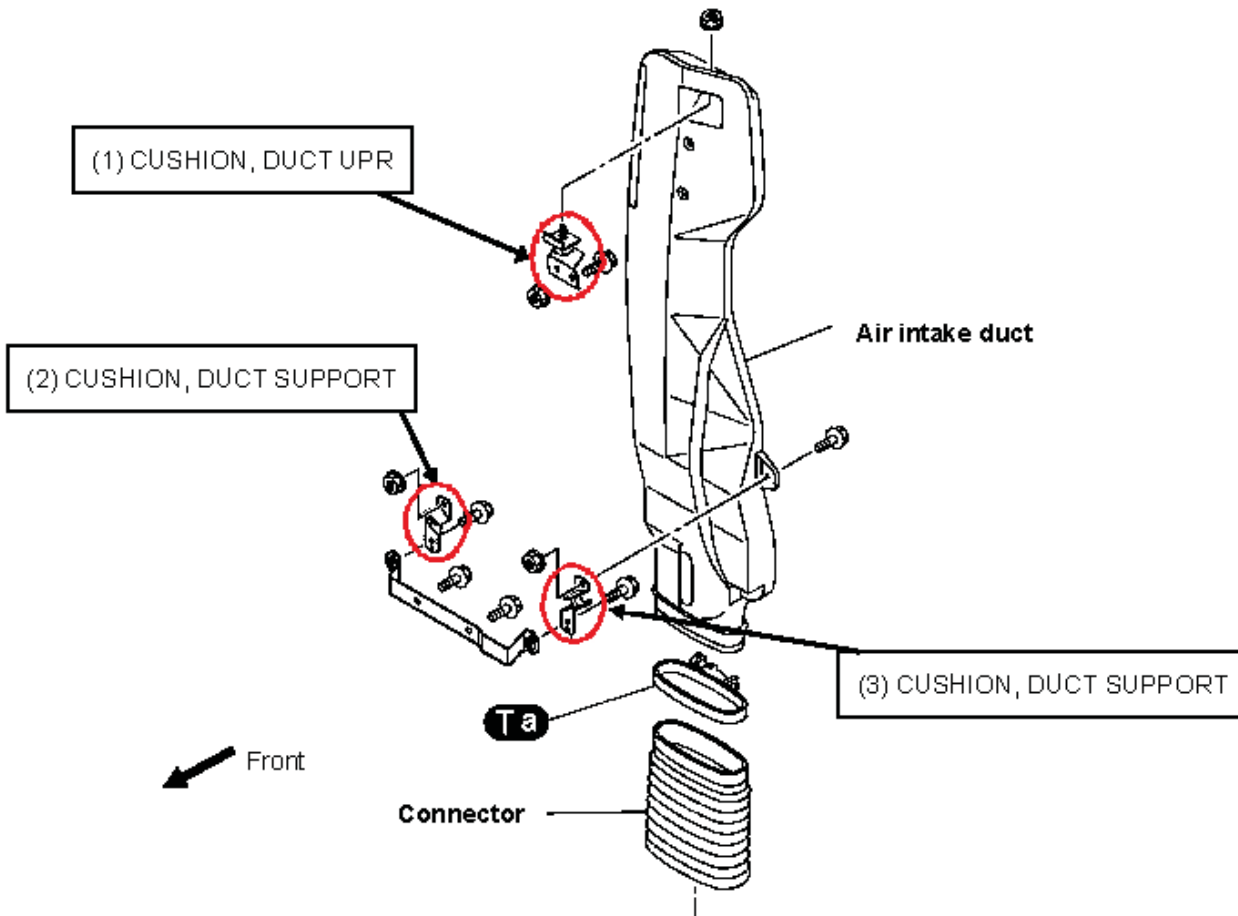

**REPAIR PROCEDURE:**

1. Park the vehicle on a flat, level surface, shut off the engine, apply the parking brake, chock the wheels and disconnect the battery cables. **CAUTION! Do not remove the wheel chocks until all modification work has been completed!**
2. Remove the air intake duct. Replace the upper duct cushion and two duct support cushions.
3. Tighten all hardware in accordance with the Tightening Torque Table below.

**TIGHTENING TORQUE TABLE:**

Parts to be tightened	Tightening Torque
Air Intake Duct Clamp (Ta)	2.2 to 2.5 ft.lbs. (3.0 – 3.4 Nm)
M6 Bolts	3.0 to 4.4 ft.lbs. (4.0 – 6.0 Nm)
M8 Bolts	7.4 to 11.1 ft.lbs. (10.0 – 15.0 Nm)