

STARCRAFT

903 SOUTH MAIN STREET • P.O. BOX 460 • MIDDLEBURY, IN 46540 • TELEPHONE: (800) 945-4787 • WWW.STARCRAFTRV.COM

July 23, 2010

Associate Administrator for Enforcement
National Highway Traffic Safety Administration
U.S. Department of Transportation
1200 New Jersey Avenue, SE
Washington, DC 20590

Dear Sir or Madam:

Pursuant to 49 CFR Part 573, Starcraft RV, Inc. (“Starcraft RV” or the “Company”) is submitting this report to NHTSA concerning a recall campaign, which is being voluntarily initiated. Specific information is as follows:

573.5(c)(2)

Affected vehicles are Model Year 2010 Starcraft RV Centennial Camping Trailers, Model 3612, manufactured between November 11, 2009 and April 9, 2010.

Starcraft RV, Inc., the responsible manufacturer, determined the recall population from its manufacturing records.

573.5(c)(3)

A total of Fifteen (15) Camping Trailers are subject to this recall. Specific Vehicle Identification Numbers (VIN) are as follows:

2010 Starcraft RV Centennial Camping Trailers with a starting VIN of 1SAAS0AH0A1FJ5057 and ending with 1SAAS0AHXA1FJ5051.

573.5(c)(4)

Starcraft RV is recalling 100 percent of the affected models of Starcraft RV Centennial Camping Trailers identified in the scope.

573.5(c)(5)

Starcraft RV has identified that the axle is located too far forward. This allows the tires to make contact with the wheel well, which may cause damage to the tire and/or the wheel well. If this condition is not addressed, it may result in an accident, injury or death.

573.5(c)(6)

Starcraft RV decided to conduct this recall following an internal investigation. Starcraft RV is not aware of any injuries or accidents related to this issue.

Starcraft RV received a complaint on July 12, 2010 stating that the tires were making contact with the wheel well. Subsequently, over the following two weeks, four additional complaints were received. A comparison

of the prints to units at Starcraft RV revealed that the location of the axle was not correct on some units because they had frames built prior to a print change which moved the axle rearward to better center the axle in the wheel well.

573.5(c)(8)

The remedy for the affected Starcraft RV Centennial Camping Trailers is to cut the brackets, move the axle rearward, and weld it in this new position.

Copies of the repair instructions, dealer notification letters, and owner letters will be provided to the agency within 10 business days. Starcraft RV is contacting all dealers and retail owners of the affected vehicles. Upon notification Starcraft RV is prepared to begin dealer notification within 5 business days after approval, and to owner's ten business days subsequent to dealer notification.

Thank you for your assistance,

A handwritten signature in black ink that reads "Joseph J. Resil". The signature is written in a cursive style with a large, stylized initial "J".

Sincerely,

Joe Resil
Regulatory Compliance Manager