



903 South Main Street • P.O. Box 460 • Middlebury, IN 46540 • (574) 825-0608 • Fax (574) 825-0572

September 2, 2010

10V-395  
(2 Pages)

Associate Administrator for Enforcement  
National Highway Traffic Safety Administration  
U.S. Department of Transportation  
400 Seventh Street S.W.  
Washington, DC. 20590

Dear Sir or Madam:

Pursuant to 49 CFR Part 573, Jayco, Inc. (“Jayco” or the “Company”) is submitting this report to NHTSA concerning a recall campaign, which is being voluntarily initiated. Specific information is as follows:

573.5(c)(2)

Affected vehicles are Model Year 2011 Jayco models Jay Feather Select Travel Trailers, series X213, manufactured between May 17, 2010 and August 16, 2010.

The recall population was determined from the manufacturing records for the Company’s manufacturing plant in Middlebury, Indiana, which produced the affected recreational vehicles.

573.5(c)(3)

A total of ninety (90) Travel Trailers are subject to this recall. Specific Vehicle Identification Numbers (VIN) are as follows:

2011 Travel Trailers with a starting VIN of 1UJB0BK0B1J30054 and ending with 1UJB0BKXB1J30160.

573.5(c)(4)

Jayco is recalling 100 percent of the affected model Travel Trailers identified in the scope.

573.5(c)(5)

Jayco has identified that the Federal ID Label and the Tire and Loading Information Label have an incorrect tire pressure. The labels currently indicate a tire pressure of 448 kPa (65 psi) The correct tire pressure is 345 kPa (50 psi) As a result, this is a non-conformance to FMVSS 110, Tire selection and rims and motor home/recreation vehicle trailer load carrying capacity information for motor vehicles with a GVWR of 4,536 kilograms (10,000 pounds) or less, section S4.3.4. The tires were correctly inflated to 345 kPa (50 psi) at the time of manufacture; however, a retail owner could potentially over-inflate the tires based on the incorrect information on the labels, increasing the risk of a crash.

573.5(c)(6)

On August 30, 2010, Jayco was informed by one of its dealers that the information on the labels was incorrect. Jayco decided to conduct this recall following an internal investigation. Jayco is not aware of any injuries or accidents related to this issue.

573.5(c)(8)

The remedy for the affected travel trailers will involve removing the incorrect Federal ID Label and the Tire and Loading Information Label and installing new corrected Labels.

Copies of the repair instructions, dealer notification letters, and owner letters will be provided to the agency within 10 business days. Jayco is contacting all dealers and retail owners of the affected vehicles. Upon notification Jayco is prepared to begin dealer notification within 5 business days after approval, and to owner's ten business days subsequent to dealer notification.

Thank you for your assistance,

A handwritten signature in black ink that reads "Joe Resil". The signature is written in a cursive style with a large initial "J" and "R".

Sincerely,

Joe Resil  
Regulatory Compliance Manager