



Hyundai de Puerto Rico
(Sojitz de Puerto Rico Corporation)
101 Ave Conquistadores Cataño PR 00962
Tel: (787) 999-3333 Fax: (787) 999-3355
www.hyundaipr.com

RECEIVED
By delia.lopez at 9:24 am, Oct 05, 2010

October 1, 2010

Associate Administrator for Enforcement
National Highway Traffic Safety Administration
Att: Recall Management Division (NVS-215)
1200 New Jersey Avenue, SE
Washington, D.C. 20590

10V-457
(4 Pages)

RE: Defect Information Report

In pursuant to Part 573 of Title 49 of the Code of Federal Regulations, Hyundai de Puerto Rico (HdPR) hereby submits information concerning a recall that is being voluntarily initiated. Specific information as required by Section 573.6 is as follows:

573.6(c)(1)

Manufacturer – Hyundai Motor Company

Manufacturing Plant – Hyundai Motor Manufacturing Alabama

Distributor – Hyundai de Puerto Rico

573.6(c)(2)

HdPR will initiate a recall of model year 2011 Hyundai Sonata vehicles produced beginning December 11, 2009 through September 10, 2010

573.6(c)(3)

The recall will include 60 model year 2011 Hyundai Sonata vehicles produced beginning December 11, 2009 through September 10, 2010.

573.6(c)(4)

Hyundai believes a small number of vehicles in the recall population may be found with a condition requiring corrective action.

573.6(c)(5)

The steering column is connected to the steering gear assembly through an intermediate shaft. Universal joints connect the upper end of the intermediate shaft to the steering column and

the lower end of the intermediate shaft to the steering gear pinion shaft. Hyundai has found eight instances from the initial production period for this new vehicle of improperly assembled or loose steering column intermediate shaft universal joint connections. Corrective actions have been implemented to ensure proper assembly of the steering column intermediate shaft.

573.6(c)(6)

Hyundai received three unrelated field reports with regard to the steering column intermediate shaft universal joint connections shortly after production began. With regard to one vehicle, Hyundai determined that the universal joint may have been damaged when the steering column assembly was dropped by a worker at the supplier before installation in the vehicle. With regard to the second vehicle, Hyundai determined that the universal joint and upper steering column splines were misaligned and the universal joint bolt had been cross-threaded during the sub-assembly process at the supplier before installation in the vehicle, which prevented the application of full clamping pressure to the misaligned splined attachment. Finally, with regard to the third vehicle, the lower steering column universal joint connection was misassembled to the splined end of the steering gear pinion shaft. These three conditions are unrelated and each occurred early in the beginning of production of this new vehicle. In addition, Hyundai received five additional warranty claims relating to intermediate shaft universal joints. Hyundai and its suppliers have implemented corrective actions to ensure proper assembly and torque of the steering column intermediate shaft. Each field report and warranty claim was received prior to implementation of the corrective actions. No further reports have been received since implementation of the corrective actions.

573.6(c)(7)

Not applicable.

573.6(c)(8)

All of these conditions occurred at very low mileages and on early production of the all-new 2011 model year Sonata vehicles. Hyundai is not aware of any occurrences after April, 2010 production. However, in order to resolve PE10-035 and to reassure our customers who have purchased 2011 model year Sonatas, Hyundai is submitting this Part 573 Defect Notification and will conduct a recall. HdPR will notify all owners of the Hyundai vehicles described in 573.6(c)(2) above to return their vehicles to their Hyundai dealers, who will inspect the steering column intermediate shaft universal joint connections for proper assembly and torque. If any deficiencies are found during the inspection, they will be corrected. This service will be provided at no cost to vehicle owners.

Additionally, Hyundai has recently updated the power steering software installed during production. Hyundai will take this opportunity to install this software update while vehicles are at dealers to have the steering column intermediate shaft universal joint connections recall inspection completed. This software update will ensure that steering wheel vibration or shaking will not occur as a result of a motor driven power steering malfunction. Like other motor driven power steering systems, manual steering is still operative even if a malfunction of the motor driven power steering were to occur and the EPS (Electric Power Steering) warning lamp would

be illuminated in the instrument cluster. This software update will also be provided at no cost to vehicle owners.

Hyundai anticipates that owners will begin to be notified by mail during October 2010, after NHTSA has approved the owner notification letter. Owner notification letters will be sent in one mailing.

Inspecting the steering column intermediate shaft universal joint connections of all vehicles affected by this recall would have been covered for 5 years or 60,000 miles under Hyundai's new vehicle limited warranty. As owners of these vehicles would not have incurred expenses for the warranted repair as a result of this condition, Hyundai believes that it is not necessary, and should not be required to provide notification regarding reimbursement under section 577.11.

573.6(c)(9)

Not applicable.

573.6(c)(10)

The Technical Service Bulletin containing the service procedure for inspecting the steering column intermediate shaft universal joint connections and updating the power steering software will be provided to NHTSA when available.

573.6(c)(11)

A draft of the owner notification letter in accordance to Part 577.5 is included as attachment in this document.

573.6(c)(12)

Hyundai has assigned "Campaign 097" as the designation for this campaign.

If you have questions regarding, don't hesitate to contact me at one of points listed below.

Sincerely,

José Carreras
Service Engineer
Hyundai de Puerto Rico
Phone: (787) 999-3333 x.2440
Fax: (787) 999-3355
E-mail: jcarreras@hyundaipr.com

Attachments (1)

1. Owner Notification Letter

CC:

1. R. Garcia – EVP & COO HdPR
2. T. Mizuno – EVP & CFO HdPR
3. R. Arzuaga – Service Manager HdPR