



903 South Main Street • P.O. Box 460 • Middlebury, IN 46540 • (574) 825-0608 • Fax (574) 825-0572

October 12, 2010

Associate Administrator for Enforcement  
National Highway Traffic Safety Administration  
U.S. Department of Transportation  
400 Seventh Street S.W.  
Washington, DC. 20590

ref 10E-046

Dear Sir or Madam:

Pursuant to 49 CFR Part 573, Jayco, Inc. (“Jayco” or the “Company”) is submitting this report to NHTSA concerning a recall campaign, which is being voluntarily initiated. Specific information is as follows:

573.5(c)(2)

Affected vehicles are:

Eagle Fifth-Wheels {series 313RKS, 321RLTS, 351RLSA, 351RLTS, 365BHS, 371RLQS}  
Eagle Super Lite Fifth-Wheels {series 25.5RKS, 26.5RLS, 28.5RSL, 30.5DBSA, 30.5RSL, 31.5FBHS, 31.5RLTS, 39.5RKS}  
Eagle Super Lite Travel Trailers {series 304BHK, 314BDS, 318RLS}  
Eagle Travel Trailers {series 256RKS, 298RLS, 320RLDS, 322FKS, 324BHDS}  
Greyhawk Class C Motor homes {series 31SS}  
Jay Feather Select Travel Trailers {series 242, 23K, 24T, 28R, 28U, 29L, X19H, X213, X21M, X23B, X23J, X26P}  
Jay Feather Sport Travel Trailers {series 165, 199, 221, X17Z, X18D, X20E}  
Jay Flight G2 Travel Trailers {series 26RKS, 29BHS, 29RLS, 32BHDS, 33RLDS}  
Jay Flight Travel Trailers {series 19RD, 22BHS, 22FB, 24FBS, 24RKS, 25BHS, 26BH, 26RLS, 29QBH, 36BHDS}  
Pinnacle Fifth-Wheels {series 34RLTS, 36REQS, 36RETS}  
Recon ZX Sport Utility Fifth-Wheel {series 39C}

The affected vehicles were manufactured between August 16, 2010 and October 1, 2010.

The recall population was determined from the manufacturing records for the Company’s manufacturing plants in Middlebury, Indiana; Topeka, Indiana; and Twin Falls, Idaho, which produced the affected recreational vehicles.

573.5(c)(3)

A total of eight-hundred-thirty-six (836) vehicles are subject to this recall. Specific Vehicle Identification Numbers (VIN) are as follows:

Model year 2011 vehicles with a starting VIN of 1UJBJ0AH1B1J50111 and ending with 1UJCJSCV2B1TC0068.

573.5(c)(4)

Jayco is recalling 100 percent of the affected vehicles identified in the scope.

573.5(c)(5)

Jayco has determined, based upon information provided to it by Atwood Mobile Products, that 17" & 21" Series 35 stoves manufactured by Atwood between July 1, 2010 and September 20, 2010 may possess a small fracture in the line supplying gas to the oven box. Such a fracture has the potential to leak gas when the oven box is in operation. Gas only flows through the suspect tube when the oven thermostat is opened and the thermocouple signals that a pilot light is present in the oven box. Once gas is flowing, it can leak through the wall of the fractured gas line leading to a potential build up of gas in the RV. In the presence of a spark or other ignition source, this leak may lead to a fire, injury, or death.

573.5(c)(6)

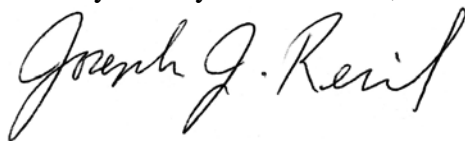
This problem was brought to Jayco's attention by Atwood Mobile Products.

573.5(c)(8)

The remedy for the affected recreation vehicles will involve inspection of the suspect tube using a test kit provided by Atwood. If the tube contains a leaks, Atwood will provide a replacement stove. The suspect stove will be returned to Atwood.

Copies of the repair instructions, dealer notification letters, and owner letters will be provided to the agency within 10 business days. Jayco is contacting all dealers and retail owners of the affected vehicles. Upon notification Jayco is prepared to begin dealer notification within 5 business days after approval, and to owner's ten business days subsequent to dealer notification.

Thank you for your assistance,

A handwritten signature in cursive script that reads "Joe Resil".

Sincerely,

Joe Resil  
Regulatory Compliance Manager