



COACHMEN RV, A DIVISION OF FOREST RIVER

October 11, 2010

TO: All Coachmen RV Class A Motorhome Dealers

RE: Safety Recall#: 10V-433 US – TC 2010-340 Canada

Dear Coachmen Class A Motorhome Dealer:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. **Coachmen** RV a Division of Forest River Inc has decided that a defect that relates to motor vehicle safety exists in certain 2011 Mirada, Encounter, Cross Country, and Pathfinder units manufactured between June 28, 2010 and August 26, 2010

On affected units, the house type circuit breakers may be faulty. Siemens, the manufacturer of the Siemens and Murray brand one inch plug-in circuit breakers, single and double pole, 15 through 50 amps manufactured between **June 23 and July 2, 2010, with a date code of 0610 and 0710** may have a non-conforming "spring clip" plug-in assembly that breaks or fails to provide sufficient force to maintain a proper electrical connection in the panel board. Over time, this condition could lead to excessive temperature, arcing or thermal damage at the connection point, and potential damage to the panel board's electrical insulation. Such activity may, in extreme situations lead to fire, property damage, or personal injury.

Owners of suspect units will be notified in a letter instructing them to contact their Coachmen dealer to schedule an appointment to have their unit repaired. A copy of this letter is attached for your reference.

Please find attached repair instructions and information relating to the preparation and submissions of claims for reimbursement.

Thank you for your prompt attention to this matter. If you have any questions or require assistance, please contact you're the Class A Service/Warranty Manager at 1-800-453-6064.

Sincerely,

COACHMEN RV A DIVISON OF FOREST RIVER INC

Attachments



COACHMEN RV, A DIVISION OF FOREST RIVER

Repair Instructions for NHTSA Safety Recall 10V-433

Your immediate and prompt attention is required to address a potential concern involving the 120 volt breakers on certain 2011 Mirada, Encounter, Cross Country and Pathfinder motor homes.

Concern

Siemens, the manufacturer of the Siemens and Murray brand one inch plug-in circuit breakers, single and double pole, 15 through 50 amps manufactured between **June 23 and July 2, 2010 with a date code of 0610 and 0710** may have a non-conforming "spring clip" plug-in assembly that breaks or fails to provide sufficient force to maintain a proper electrical connection in the panel board. Over time, this condition could lead to excessive temperature, arcing or thermal damage at the connection point, and potential damage to the panel board's electrical insulation. Such activity may, in extreme situations lead to fire, property damage, or personal injury.

Inspection

Immediately inspect the listed units attached to this letter that apply to your dealership. Pull each breaker and inspect the date code that is marked on the side of the breaker.

Action

If the date code on any breaker is **0610 or 0710**, please replace those defective breakers that are subject to recall. Then reinstall all breakers.

Parts Acquisition

To order replacement breakers for this recall, please fax in an order to Class A parts at 574-825-8457. Please include the serial number of the coach and corresponding part numbers and quantities of breakers needed. THESE BREAKERS WILL BE SENT NO CHARGE.

Below are the Forest River part numbers for these breakers:

1104289 Breaker, 220V 50AMP DBL (MP250)
250956 Breaker, 120V 20AMP SGL (MP120)
250968 Breaker, 120V 15AMP SGL (MP115)
242920 Breaker, 120V 30AMP SGL (MP130)

Claim Filing Procedure

Once the repair is completed, please complete an online Forest River warranty claim using flat rate code 40-011900 for 1.0 hour.



COACHMEN RV, A DIVISION OF FOREST RIVER

UNITS AFFECTED IN THIS RECALL (10V-433)

<u>Forest River VIN</u>	<u>Chassis VIN</u>	-	<u>Forest River VIN</u>	<u>Chassis VIN</u>
5ZTAPF609BA505198	4UZAB2DT8BCAT5898		5ZTAEC104BA505251	1F66F5DY8B0A01313
5ZTAMD005BA505205	1F66F5DY1B0A01959		5ZTAEC106BA505252	1F66F5DY2B0A01310
5ZTAMD007BA505206	1F66F5DY0B0A01967		5ZTAEC108BA505253	1F66F5DY2B0A01324
5ZTAMD000BA505208	1F66F5DY0B0A01953		5ZTAEC101BA505255	1F66F5DY9B0A01983
5ZTAMD002BA505209	1F66F5DY0B0A01855		5ZTACC403BA505257	4UZACJDT5BCAT6031
5ZTAMDZ07BA505211	1F66F5DY8B0A01974		5ZTACC405BA505258	4UZACJDT0BCAT6034
5ZTAMDZ09BA505212	1F66F5DY4B0A01955		5ZTACC407BA505259	4UZACJDT7BCAT6032
5ZTACC405BA505213	4UZACJDT3BCAT6030		5ZTACC403BA505260	4UZACJDT9ACAT5964
5ZTAMDZ02BA505214	1F66F5DY1B0A01976		5ZTAMDU01BA505261	1F66F5DY2B0A02621
5ZTAMDZ04BA505215	1F66F5DY9B0A01952		5ZTAMDU03BA505262	1F66F5DY9B0A02616
5ZTACC400BA505216	4UZACJDT3BCAT5914		5ZTAMDU09BA505265	1F66F5DY4B0A02717
5ZTAMDZ08BA505217	1F66F5DY8B0A01957		5ZTAMDX08BA505267	1F66F5DY6B0A02718
5ZTAMDU00BA505218	1F66F5DY5B0A01222		5ZTAMDX0XBA505268	1F66F5DY8B0A02719
5ZTAMDU02BA505219	1F66F5DYXB0A01832		5ZTAMDX01BA505269	1F66F5DY0B0A02715
5ZTAMDU00BA505221	1F66F5DY8B0A02610		5ZTAMDX08BA505270	1F66F5DY4B0A02622
5ZTACC60XBA505222	4UZACJDT6ACAT5873		5ZTAMDX01BA505272	1F66F5DY1B0A03324
5ZTAMDU04BA505223	1F66F5DY0B0A02617		5ZTAMDX03BA505273	1F66F5DY4B0A03320
5ZTAMDU06BA505224	1F66F5DY2B0A02618		5ZTAMDZ00BA505275	1F66F5DY2B0A01971
5ZTACC605BA505225	4UZACJDT4ACAT5872		5ZTAMDZ02BA505276	1F66F5DY1B0A01962
5ZTAMDU0XBA505226	1F66F5DY0B0A02620		5ZTAMDZ06BA505278	1F66F5DY6B0A01956
5ZTAMDX07BA505227	1F66F5DY3B0A02613		5ZTAMDZ08BA505279	1F66F5DY3B0A01851
5ZTAMDX00BA505229	1F66F5DY7B0A02615		5ZTAMDZ08BA505282	1F66F5DY3B0A01963
5ZTAMDX07BA505230	1F66F5DYXB0A02611		5ZTAMDZ0XBA505283	1F66F5DY3B0A01848
5ZTACC600BA505231	4UZACJDTXBCAT5876		5ZTAMDZ03BA505285	1F66F5DY7B0A02226
5ZTAMDX00BA505232	1F66F5DY5B0A02614		5ZTAMDZ05BA505286	1F66F5DY6B0A02217
5ZTAMDX02BA505233	1F66F5DY1B0A02612		5ZTAMDZ09BA505288	1F66F5DY9B0A02227
5ZTACC606BA505234	4UZACJDT1BCAT5877		5ZTAMDU01BA505289	1F66F5DY3B0A03325
5ZTAMDX06BA505235	1F66F5DY0B0A01841		5ZTAMDU01BA505292	1F66F5DY0B0A03329
5ZTACC60XBA505236	4UZACJDT6BCAT5874		5ZTAEC200BA505293	1F66F5DY6B0A01987
5ZTAMDZ03BA505237	1F66F5DY7B0A01965		5ZTAMDU07BA505295	1F66F5DYXB0A03323
5ZTAMDZ05BA505238	1F66F5DY4B0A01972		5ZTAMDU02BA505298	1F66F5DY2B0A03333
5ZTAMDZ03BA505240	1F66F5DY5B0A01950		5ZTAEC102BA505300	1F66F5DY0B0A01984
5ZTAMDZ05BA505241	1F66F5DYXB0A01961		5ZTAMDZ0XBA505302	1F66F5DYXB0A02222
5ZTAMDZ09BA505243	1F66F5DY2B0A01968		5ZTAMDZ03BA505304	1F66F5DY3B0A02224
5ZTAMDX07BA505244	1F66F5DY4B0A02619		5ZTACC401BA505306	4UZACJDTXBCAT5909
5ZTAMDX00BA505246	1F66F5DY8B0A02624		5ZTAMDZ09BA505307	1F66F5DY4B0A02216
5ZTAMDX02BA505247	1F66F5DYXB0A02625		5ZTAMDX08BA505317	1F66F5DY7B0A03327
5ZTAMDX06BA505249	1F66F5DY1B0A02626		5ZTAMDX01BA505322	1F66F5DY5B0A03326
5ZTAMDX02BA505250	1F66F5DY6B0A02623		5ZTAMDZ09BA505324	1F66F5DY1B0A02223
5ZTAMDZ05BA505286	1F66F5DY6B0A02217		5ZTAMDZ00BA505325	1F66F5DY0B0A02228