



## Instructions to Perform Campaign 120 – ADDENDUM Model 32H Dinette Seat Belt Anchorages

On the following models, the storage compartment is constructed of ribbed, molded plastic, which interferes with panel removal as specified in the original recall instructions starting with step 16.

- 2008 Model F32H Winnebago Voyage and Itasca Sunrise
- 2009 Model J32H Winnebago Adventurer
- 2009 Model K32H Itasca Suncruiser

For the listed models, please follow these steps in addition to the standard recall repair instructions for this campaign. (Other models are not affected by this addendum.) Below is an illustration that identifies this configuration and the method of removing the upper panel.

Using the diagram as reference:

- Remove the end panel, (A) and the fasteners on the inside of the seal plane, (B), this will allow access to the backside of the panel.
- Ensure that the wires, (located on the backside of the panel), are away from the joint you will be cutting.
- Cut the panel at bend (C).

**Note:** Verify that there are no exposed rough or sharp edges at the seam, prior to sealing as called out in the next step.

After the remainder of the recall is completed:

- Reinstall the panel and end panel.
- Apply a bead of black Urethane sealer, Winnebago Industries part # 072889-01-000 or equivalent, over the seam, (C) which was created between the upper and lower panel.

