



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

**ATTENTION:**

Service Managers / Parts Managers

**SUBJECT:**

ACX Steering Gear Bracket

**SAFETY RECALL INFORMATION:**

Autocar has identified a defect in 2008 and 2009 model-year ACX model heavy-duty class 8 LCOE vehicles. The affected vehicles may experience a fatigue failure of the steering gear mounting bracket. Over time, this failure may cause cracks that will result in undesirable movement of the steering gear mounted to that bracket (see *Figure 1*).



**Figure 1**

**VEHICLES AFFECTED:**

There are 1,952 affected vehicles that were manufactured between 30 November 2007 and 03 February 2010, with serial numbers in the range 206686 through 211241. Refer to the VIN list beginning on *page 15*.

**REPAIR:**

**For left hand drive ACX models:**

Perform steps 1-20 of the repair procedure beginning on *page 4*.

**For right hand drive ACX models:**

Perform steps 1-20 of the repair procedure beginning on *page 10*.

**To Authorize and Set Up Service,  
and to Order Service Part Kits:  
(Prior Authorization Required - See Below)**

**765-489-1960**

**Prior Authorization Required:**

Before taking a vehicle in or starting this recall, Dealers **MUST** call the Autocar Project Manager at 765-489-1960 to authorize and arrange the repairs. Autocar will not ship Service Parts Kits or accept reimbursement claims unless the repairs have been authorized by the Autocar Project Manager.

**Claims for Reimbursement:**

Submit a claim in accordance with the instructions in the claim preparation section of the Warranty Administration Manual.

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

**Claim Coding Information:**

Authorization Number: A-1002

Repair Number	Time Allowance	Description
64255-2-01	2.50	ACX Left Hand Drive Steering Gear Bracket Installation
64255-2-02	2.50	ACX Right Hand Drive Steering Gear Bracket Installation

**Dealer Responsibility:**

Dealers must perform this recall on affected vehicles at no charge to the owner regardless of vehicle mileage, age or ownership of the vehicle. If a vehicle affected by this recall is taken into or is in your vehicle inventory or at your dealership for service, you must perform this recall before the vehicle is sold or released to the owner.

**Parts:**

The following Service Part Kits are necessary for this recall:

*For Left Hand Drive ACX Models*

P/N	Description	Qty
S3831001K001	SVC KIT, ACX LHD STRG GEAR BRKT	1
S3831001K002	SVC KIT, HDW, ACX LHD STRG GEAR	1

*For Right Hand Drive ACX Models*

P/N	Description	Qty
S3831002K001	SVC KIT, ACX RHD STRG GEAR BRKT	1
S3831002K002	SVC KIT, HDW, ACX RHD STRG GEAR	1

**Tools:**

The following tools are necessary for this recall:

- 1/4" drive wrench
- 5/16" socket (1/4" drive)
- 1/2" socket (1/4" drive)
- 1/2" drive wrench
- 15/16" socket (1/2" drive)
- 11/8" socket (1/2" drive)
- 15/16" socket (1/2" drive)
- 1/2" combination wrench
- 5/8" combination wrench
- 11/16" combination wrench
- 7/8" combination wrench
- 15/16" combination wrench
- 11/8" combination wrench
- Huck cutter
- Pliers
- Torque wrench (240ft/lb capacity)
- Hammer
- Oil drain catch container

**Torque Specifications:**

Bolt Description	Torque Specification
Steering gear bolts	200 ft/lbs, +/- 10 ft/lbs
Pitman arm pinch bolt	240 ft/lbs
Steering gear bracket bolts	200 ft/lbs, +/- 10 ft/lbs
Frame bolts	200 ft/lbs
Steering shaft pinch bolt	65 ft/lbs

**Autocar, LLC**

551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## SAFETY NOTICES FOR REPAIR PROCEDURE FOR LEFT HAND DRIVE ACX MODELS

### **WARNING**

*To prevent eye injury, always wear eye protection when performing vehicle maintenance, service, or inspection.*

### **DANGER**

*Before working on a vehicle, turn the engine to off, set the parking brake, place the transmission in neutral and block the wheels. Failure to do so can result in unexpected vehicle movement, resulting in serious personal injury or death.*

### **WARNING**

*Allow ample time for the air cooler, radiator, and related components to cool after the vehicle has been shut down. A hot engine or cooling assembly may cause burns or other personal injury.*

### **CAUTION**

*Critical fasteners should be properly tightened to torque values and maintained during the service period. Refer to Autocar's preventative maintenance manual (AC-SM-177-0606-P112) for schedule.*

### **CAUTION**

#### LOCKOUT/TAGOUT PROCEDURES

Before entering the vehicle or vehicle body, read and follow OSHA regulations concerning entry and working in "CONFINED SPACE" OSHA 1910.146 and "LOCKOUT/TAGOUT" OSHA 1910.147. Follow OSHA regulations while performing any work on the vehicle. The vehicle must be disabled by the following steps before performing any work on the vehicle:

1. Place the transmission in NEUTRAL.
2. Set the parking brake.
3. Shut the engine OFF.
4. Lock cab doors, keep the key in your pocket. Block the wheels before entering the body or performing any work on the vehicle.
5. Turn the battery disconnect switch OFF.
6. Completely drain the air from the primary/A system and secondary/B system by opening the drain valves on the air tanks themselves or by using the drain manifold if supplied. When draining the air tanks, do not look into the area where air is draining. Dirt or sludge particles may be expelled in the air stream and can cause eye injury.
7. Place magnetic "DANGER" signs on both cab doors before entering the body or performing any work on the vehicle.
8. Take proper precautions before working under the vehicle. Use ramps approved for the weight of your vehicle, or use floor jacks and stands. Never work under a vehicle supported by jacks alone. Always use jack stands to support the vehicle.

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## REPAIR PROCEDURE FOR LEFT HAND DRIVE ACX MODELS

*For Right Hand Drive ACX Models, See  
Page 10.*

1. Turn the wheels all the way to the right.

### **DANGER**

*Due to the danger of sustaining personal injury and/or damage to the vehicle, never attempt to raise the cab outdoors under extremely windy conditions. Strong wind conditions could force the cab beyond the normal limits of its travel. Never rely on the hydraulic pressure to hold the cab in an open position. Always use the safety pin in the cab tilt lock tube to prevent serious personal injury or death.*

### **CAUTION**

*Remove the pump handle when not in use. It may stick out and could cause injury to passersby.*

2. Raise the cab (tilt up) to gain access to the engine compartment (see important safety notices above for raising the cab).

- Remove or secure all loose articles and close all doors before raising the cab. The area above and ahead of the cab must be clear from obstructions. Place front wheels in a straight ahead position.
- Remove the pump handle from its storage on the inside wall of the driver or passenger side door.
- Place the selector lever on the hydraulic pump in the RAISE position. Insert the pump handle into the pump and operate the handle in an up and down motion. The hydraulic cab latches will open, then the hydraulic cylinders will lift the cab until the midpoint (top) is reached.

- Once the cab has reached its midpoint, the cab will free fall forward to the fully open position. The safety pin in the cab tilt lock device must be installed when the holes line up in the sliding bar.

3. Place a clean oil drain catch container under the steering gear box. Drain the power steering system at the steering gear box by removing the braided hose, and release the fluid into the container (see Figure 2).



**Figure 2**

4. Remove the remaining three hoses from the steering gear box (see Figure 3).

**NOTE** - Mark one of the hoses for the steering assist cylinder (if equipped) at the hose and the fitting. This will ensure that the hoses are reinstalled to the proper location.






# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**


**March, 2010**

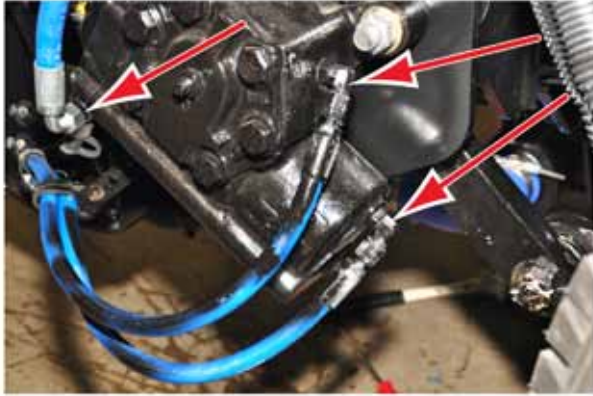

**Figure 3**

5. Remove the steering shaft from the steering gear box by first removing the steering shaft pinch bolt (see *Figure 4*).

**NOTE** - Mark the steering shaft and the gear box before removing the shaft in order to facilitate proper alignment at reinstallation.

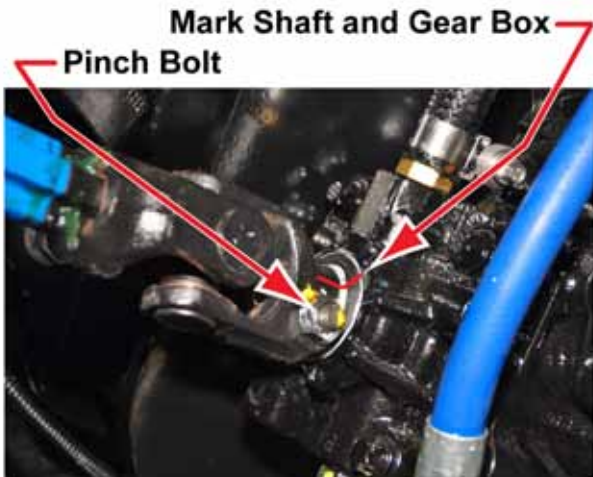

**Figure 4**

6. Remove the drag link from the pitman arm by removing one cotter pin and the castle nut (see *Figure 5*).


**Remove cotter pin and castle nut**



**Figure 5**

7. Remove the pitman arm from the steering gear box output shaft by removing the pinch bolt from the pitman arm (see *Figure 6*).

**NOTE** - Mark the pitman arm and the output shaft before removing the pitman arm in order to facilitate proper alignment at reinstallation.

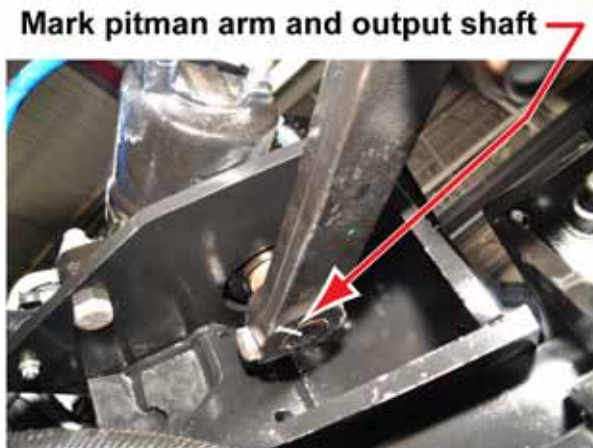

**Figure 6**

**(Viewed from under steering gear box)**

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.




# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

March, 2010


8. Remove the steering gear box by first removing the "L" bracket that is attached to the steering gear bracket, then remove three bolts that hold the steering gear box to the bracket (see Figure 7).

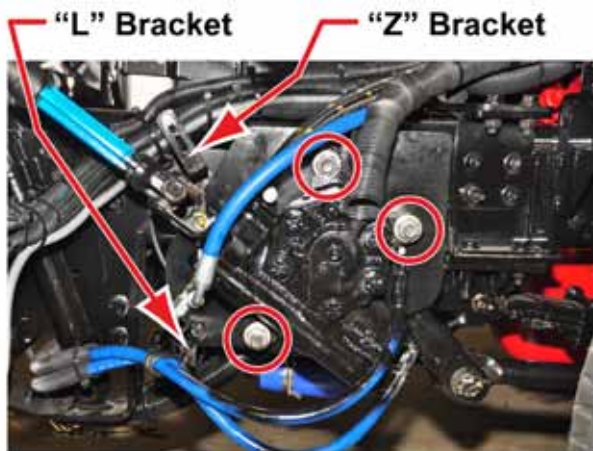

**Figure 7**

9. Remove the steering gear bracket by removing the the three hucks and two bolts that hold the steering gear box to the frame (see Figure 8). Also remove the "Z" bracket which is retained by one of the above-mentioned bolts (see Figure 7).

**NOTE** - The three hucks may have been replaced by bolts, depending on when the vehicle was built.

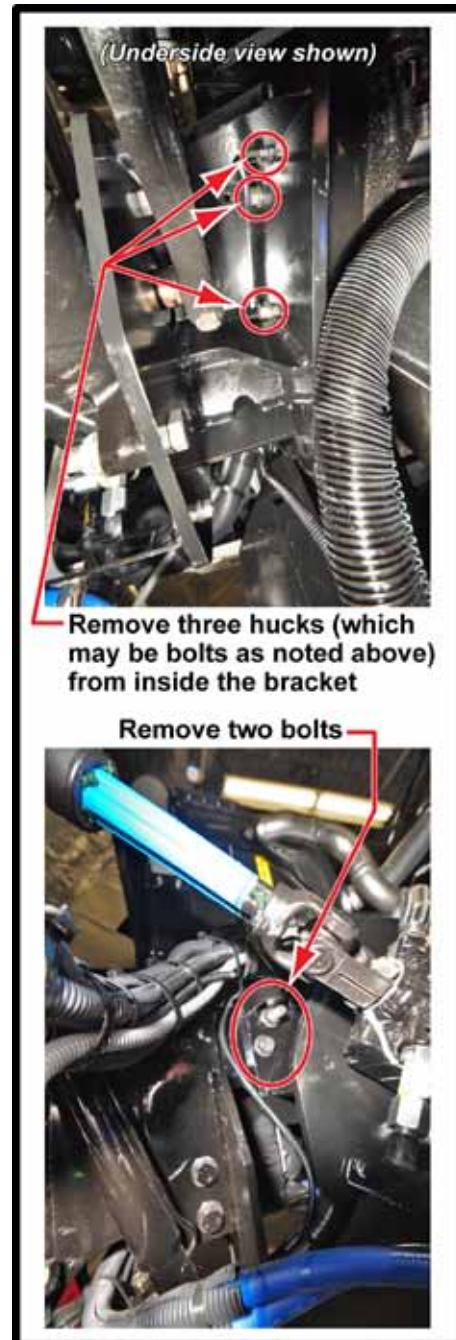

**Figure 8**

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

10. Install the new steering gear bracket using the following parts:  
S3831001K001, SVC KIT, ACX LHD STRG GEAR BRKT-  
From S3831001K002, SVC KIT, HDW, ACX LHD STRG GEAR -  
(4) 8397080 FLANGE SCREW 5/8"-11 X 2 1/2"  
(1) 8397082 FLANGE SCREW 5/8"-11 X 3"  
(5) 8307202 FLANGE LOCK NUT 5/8"-11  
Also reinstall the "Z" bracket that was removed in *step 9*.  
See Torque Specifications on *page 2*.
11. Reinstall the steering gear box to the new bracket using the following new hardware:  
From S3831001K002, SVC KIT, HDW, ACX LHD STRG GEAR -  
(3) GZ030017-002 SCR, HEX CAP 3/4"-16 X 3.25"  
(3) 3082677 SPACER WASHER 3/4" X 1/8"  
(3) 8397835 HEX NUT 3/4"-16  
See Torque Specifications on *page 2*.
12. Reinstall the steering shaft, making sure that the marks on the shaft and the steering gear box are aligned. Use the following new pinch bolt hardware:  
From S3831001K002, SVC KIT, HDW, ACX LHD STRG GEAR -  
(1) 3083736 HEX SCREW  
(1) 945989 LOCK NUT 7/16-20  
See Torque Specifications on *page 2*.
13. Reinstall the four power steering lines to the steering gear box (reference *Figures 2 and 3*).
14. Reinstall the "L" bracket to the steering gear bracket using the following new hardware:  
From S3831001K002, SVC KIT, HDW, ACX LHD STRG GEAR -  
(1) 8397004 FLANGE SCREW  
(1) 8397198 FLANGE LOCK NUT 3/8"-16
15. Reinstall the pitman arm to the steering gear box output shaft, making sure that the marks are aligned.  
**NOTE** - It may be necessary to lower the cab and turn the steering wheel slightly in order to get the marks to align.  
Use the following new pinch bolt hardware:  
From S3831001K002, SVC KIT, HDW, ACX LHD STRG GEAR -  
(1) 8397832 SCR, HEX, 3/4"-16 X 4"  
(1) 8397835 HEX NUT 3/4"-16  
See Torque Specifications on *page 2*.
16. Reinstall the drag link to the pitman arm using the existing castle nut and the following new cotter pin:  
From S3831001K002, SVC KIT, HDW, ACX LHD STRG GEAR -  
(1) 907863 SPLIT PIN
17. Lower the cab.

*continued next page...*





## AUTOCAR SAFETY RECALL A-1002 NHTSA RECALL 10V-046

March, 2010

18. Fill the power steering system to the required level using approved fluid (Type A or F), as indicated on the reservoir (see *Figure 9*).



**Figure 9**

19. Start the truck and turn the steering wheel all the way to the left and right several times to purge any air that may be in the system.
20. Check the power steering fluid level and add fluid as necessary.
21. Check for any fluid leaks and if found, correct as necessary. The repair procedure is complete.





# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## SAFETY NOTICES FOR REPAIR PROCEDURE FOR RIGHT HAND DRIVE ACX MODELS

### **WARNING**

*To prevent eye injury, always wear eye protection when performing vehicle maintenance, service, or inspection.*

### **DANGER**

*Before working on a vehicle, turn the engine to off, set the parking brake, place the transmission in neutral and block the wheels. Failure to do so can result in unexpected vehicle movement, resulting in serious personal injury or death.*

### **WARNING**

*Allow ample time for the air cooler, radiator, and related components to cool after the vehicle has been shut down. A hot engine or cooling assembly may cause burns or other personal injury.*

### **CAUTION**

*Critical fasteners should be properly tightened to torque values and maintained during the service period. Refer to Autocar's preventative maintenance manual (AC-SM-177-0606-P112) for schedule.*

### **CAUTION**

#### LOCKOUT/TAGOUT PROCEDURES

Before entering the vehicle or vehicle body, read and follow OSHA regulations concerning entry and working in "CONFINED SPACE" OSHA 1910.146 and "LOCKOUT/TAGOUT" OSHA 1910.147. Follow OSHA regulations while performing any work on the vehicle. The vehicle must be disabled by the following steps before performing any work on the vehicle:

1. Place the transmission in NEUTRAL.
2. Set the parking brake.
3. Shut the engine OFF.
4. Lock cab doors, keep the key in your pocket. Block the wheels before entering the body or performing any work on the vehicle.
5. Turn the battery disconnect switch OFF.
6. Completely drain the air from the primary/A system and secondary/B system by opening the drain valves on the air tanks themselves or by using the drain manifold if supplied. When draining the air tanks, do not look into the area where air is draining. Dirt or sludge particles may be expelled in the air stream and can cause eye injury.
7. Place magnetic "DANGER" signs on both cab doors before entering the body or performing any work on the vehicle.
8. Take proper precautions before working under the vehicle. Use ramps approved for the weight of your vehicle, or use floor jacks and stands. Never work under a vehicle supported by jacks alone. Always use jack stands to support the vehicle.

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## REPAIR PROCEDURE FOR RIGHT HAND DRIVE ACX MODELS

*For Left Hand Drive ACX Models, See  
Page 4.*

1. Turn the wheels all the way to the right.

### **DANGER**

*Due to the danger of sustaining personal injury and/or damage to the vehicle, never attempt to raise the cab outdoors under extremely windy conditions. Strong wind conditions could force the cab beyond the normal limits of its travel. Never rely on the hydraulic pressure to hold the cab in an open position. Always use the safety pin in the cab tilt lock tube to prevent serious personal injury or death.*

### **CAUTION**

*Remove the pump handle when not in use. It may stick out and could cause injury to passersby.*

2. Raise the cab (tilt up) to gain access to the engine compartment (see important safety notices above for raising the cab).

- Remove or secure all loose articles and close all doors before raising the cab. The area above and ahead of the cab must be clear from obstructions. Place front wheels in a straight ahead position.
- Remove the pump handle from its storage on the inside wall of the driver or passenger side door.
- Place the selector lever on the hydraulic pump in the RAISE position. Insert the pump handle into the pump and operate the handle in an up and down motion. The hydraulic cab latches will open, then the hydraulic cylinders will lift the cab until the midpoint (top) is reached.

- Once the cab has reached its midpoint, the cab will free fall forward to the fully open position. The safety pin in the cab tilt lock device must be installed when the holes line up in the sliding bar.

3. Place a clean oil drain catch container under the steering gear box. Drain the power steering system at the steering gear box by removing the braided hose, and release the fluid into the container (see Figure 2).

Remove braided hose



**Figure 2**

4. Remove the remaining three hoses from the steering gear box (see Figure 3).

**NOTE** - Mark one of the hoses for the steering assist cylinder (if equipped) at the hose and the fitting. This will ensure that the hoses are reinstalled to the proper location.





# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**


**March, 2010**



**Figure 3**

5. Remove the steering shaft from the steering gear box by first removing the steering shaft pinch bolt (see Figure 4).


**NOTE** - Mark the steering shaft and the gear box before removing the shaft in order to facilitate proper alignment at reinstallation.

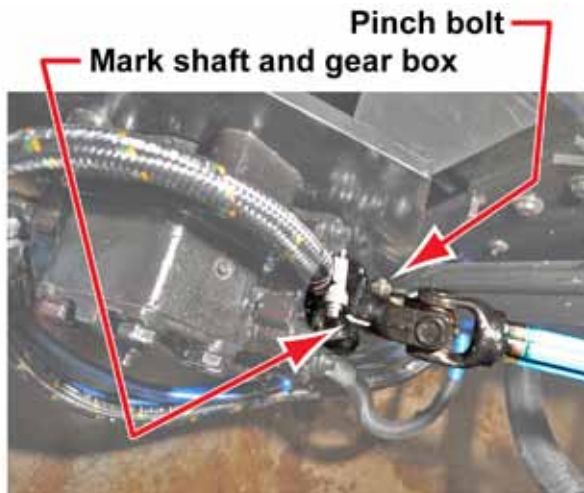

**Figure 4**

6. Remove the drag link from the pitman arm by removing one cotter pin and the castle nut (see Figure 5).

**Remove cotter pin and castle nut**

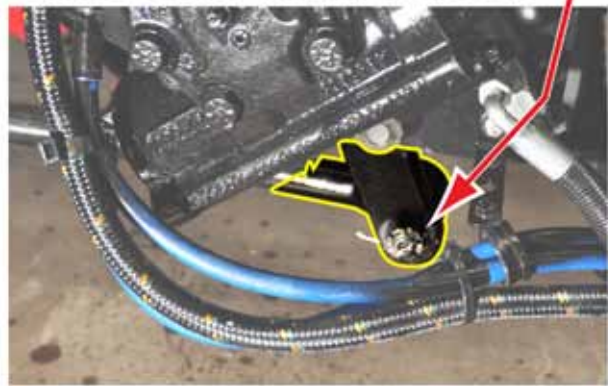

**Figure 5**

7. Remove the pitman arm from the steering gear box output shaft by removing the pinch bolt from the pitman arm (see Figure 6).

**NOTE** - Mark the pitman arm and the output shaft before removing the pitman arm in order to facilitate proper alignment at reinstallation.

**Mark pitman arm and output shaft**



**Figure 6**

**(Viewed from under steering gear box)**

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.




# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

8. Remove the steering gear box by first removing the “L” bracket that is attached to the steering gear bracket, then remove five bolts that hold the steering gear box to the bracket (see *Figure 7*).

Remove five bolts from inside bracket  
(all bolts not seen in this view)

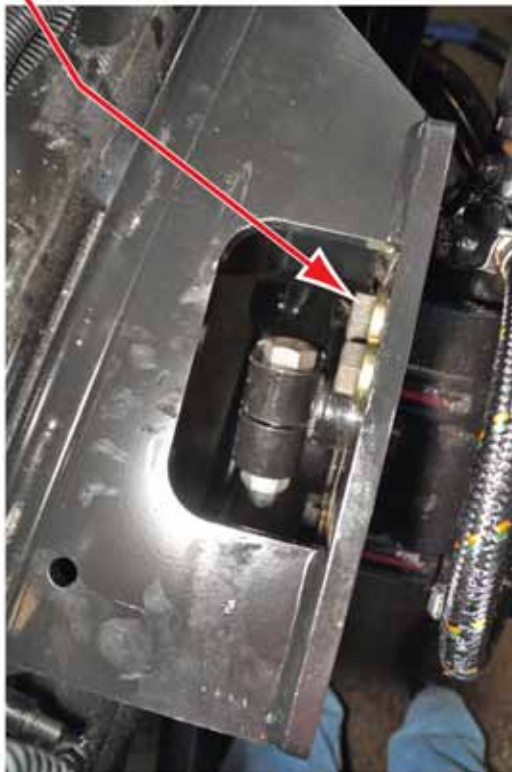

**Figure 7**

9. Remove the steering gear bracket by removing the the three hucks and two bolts that hold the steering gear box to the frame (see *Figure 8*).

**NOTE** - The three hucks may have been replaced by bolts, depending on when the vehicle was built.

Remove two bolts

Remove three hucks (which  
may be bolts as noted above)  
from inside the bracket



**Figure 8**

*continued next page...*





# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

10. Install the new steering gear bracket using the following parts (see *Figure 9*):  
**S3831002K001, SVC KIT, ACX RHD STRG GEAR BRKT**

From S3831002K002, SVC KIT, HDW, ACX RHD STRG GEAR -

(5) 8397080 FLANGE SCREW, 5/8"-11 X 2 1/2"

(5) 8397202 FLANGE LOCK NUT, 5/8"-11

See Torque Specifications on *page 2*.

11. Reinstall the steering gear box to the new bracket using the following new hardware (see *Figure 9*):


From S3831002K002, SVC KIT, HDW, ACX RHD STRG GEAR -

(4) 99-9431009 HEX BOLT, 3/4"-16 X 1.5"

(4) 3082677 SPACER WASHER 3/4" X 1/8"

(1) 99-9431009 BOLT, 7/8"-14 X 2"

See Torque Specifications on *page 2*.

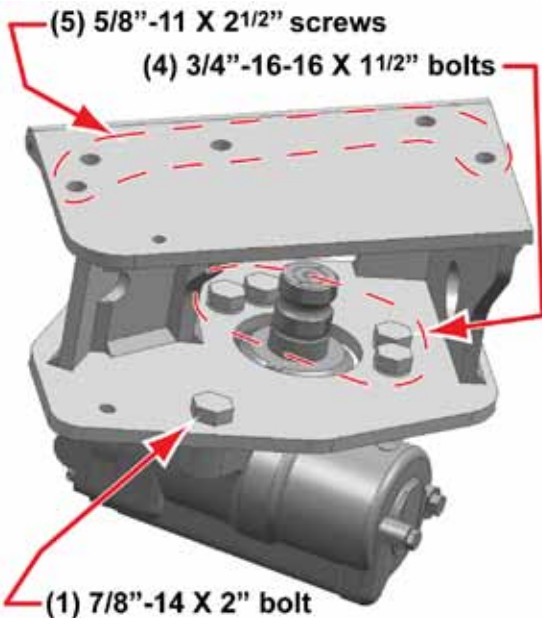

**Figure 9**

12. Reinstall the steering shaft, making sure that the marks on the shaft and the steering gear box are aligned. Use the following new pinch bolt hardware:

From S3831002K002, SVC KIT, HDW, ACX RHD STRG GEAR -

(1) 3083736 HEX SCREW

(1) 945989 LOCK NUT, 7/16"-20

See Torque Specifications on *page 2*.

13. Reinstall the four power steering lines to the steering gear box (reference *Figures 2 and 3*).

14. Reinstall the "L" bracket to the steering gear bracket using the following new hardware:

From S3831002K002, SVC KIT, HDW, ACX RHD STRG GEAR -

(1) 8397004 FLANGE SCREW

(1) 8397198 FLANGE LOCK NUT, 3/8"-16

15. Reinstall the pitman arm to the steering gear box output shaft, making sure that the marks are aligned.

**NOTE** - It may be necessary to lower the cab and turn the steering wheel slightly in order to get the marks to align.

Use the following new pinch bolt hardware:  
From S3831002K002, SVC KIT, HDW, ACX RHD STRG GEAR -

(1) 8397832 SCR, HEX, 3/4"-16 X 4"

(1) 8397835 HEX NUT, 3/4"-16

See Torque Specifications on *page 2*.





# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

16. Reinstall the drag link to the pitman arm using the existing castle nut and the following new cotter pin:  
*From S3831002K002, SVC KIT, HDW, ACX RHD STRG GEAR - (1) 907863 SPLIT PIN*
17. Lower the cab.
18. Fill the power steering system to the required level using approved fluid (Type A or F), as indicated on the reservoir (see *Figure 10*).
21. Check for any fluid leaks and if found, correct as necessary. The repair procedure is complete.



**Figure 10**

19. Start the truck and turn the steering wheel all the way to the left and right several times to purge any air that may be in the system.
20. Recheck the power steering fluid level and add fluid as necessary.

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
[www.autocartruck.com](http://www.autocartruck.com)



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACLKH38H206686	5VCACLKF58H207398	5VCACRLE48H207546	5VCACLKF79H207680
5VCACLHE98H206687	5VCACLJF38H207417	5VCACRLE68H207547	5VCACLKF99H207681
5VCACLKF88H206732	5VCACLHE38H207432	5VCACRLE88H207548	5VCACLKF79H207694
5VCACLHE18H206733	5VCACLHE58H207433	5VCACLHE58H207559	5VCACLKF99H207695
5VCACLHE38H206734	5VCACLHE78H207434	5VCACLHE18H207560	5VCACLKF09H207696
5VCACLHE58H206735	5VCACLHE98H207435	5VCACLLE58H207584	5VCACLKF29H207697
5VCACLHE78H206736	5VCACSKE08H207438	5VCACRLE38H207585	5VCACDKF19H207700
5VCACLHE98H206737	5VCACSKE28H207439	5VCACLHE79H207600	5VCACDKF39H207701
5VCACLHE08H206738	5VCACSKE98H207440	5VCACLHE99H207601	5VCACLHE49H207702
5VCACLHE28H206739	5VCACSKE08H207441	5VCACLHE09H207602	5VCACLHE69H207703
5VCACRJFX8H206817	5VCACSKE28H207442	5VCACLHE29H207603	5VCACRLE38H207750
5VCACLKH18H206895	5VCACRLE98H207445	5VCACLHE49H207604	5VCACRLE58H207751
5VCACLJF78H206951	5VCACRLE08H207446	5VCACLHE69H207605	5VCACRLE78H207752
5VCACLJF58H207001	5VCACRLE28H207447	5VCACLHE89H207606	5VCACRLE98H207753
5VCACRJF68H207236	5VCACRLE48H207448	5VCACLHEX9H207638	5VCACLHE19H207754
5VCACDJF08H207378	5VCACRLE68H207449	5VCACLHE19H207639	5VCACLHE29H207763
5VCACLKF18H207379	5VCACRLE28H207450	5VCACLJF68H207640	5VCACLHE49H207778
5VCACLKF88H207380	5VCACRLE48H207451	5VCACLJF69H207641	5VCACLLEX9H207789
5VCACLKFX8H207381	5VCACRLE68H207452	5VCA3LJF98H207650	5VCACLLE69H207790
5VCACLKF18H207382	5VCACRLE88H207453	5VCACLJF69H207655	5VCACLLE89H207791
5VCACLKF38H207383	5VCACRLEX8H207454	5VCACLKFX9H207656	5VCACLLEX9H207792
5VCACLKF58H207384	5VCACRLE18H207455	5VCACLHE79H207659	5VCACLLE19H207793
5VCACLKF78H207385	5VCACRLE38H207456	5VCACLHE39H207660	5VCA3LHF99H207798
5VCACLKF98H207386	5VCACRLE58H207457	5VCACLHE59H207661	5VCACLKE09H207799
5VCACLKF08H207387	5VCACRLE78H207458	5VCACLHE79H207662	5VCACLKE39H207800
5VCACLKF28H207388	5VCACRLE98H207459	5VCACLHE99H207663	5VCACLKE59H207801
5VCACLKF48H207389	5VCACRLE58H207460	5VCACLHE09H207664	5VCACLKE79H207802
5VCACLKF08H207390	5VCACRLE78H207461	5VCACLHE29H207665	5VCACLKE99H207803
5VCACLKF28H207391	5VCACLKE98H207539	5VCACLHE49H207666	5VCACLKE09H207804
5VCACLKF48H207392	5VCACLKE58H207540	5VCACLKF38H207674	5VCACLKE29H207805
5VCACLKF68H207393	5VCACLKE78H207541	5VCACLKF58H207675	5VCACLLE59H207814
5VCACLKF88H207394	5VCACRLE78H207542	5VCACLHE79H207676	5VCACLLE79H207815
5VCACLKFX8H207395	5VCACRLE98H207543	5VCACLHE99H207677	5VCACLLE99H207816
5VCACLKF18H207396	5VCACRLE08H207544	5VCACLKF99H207678	5VCACLKF89H207817
5VCACLKF38H207397	5VCACRLE28H207545	5VCACLKF09H207679	5VCACLKFX9H207818

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACLHE39H207819	5VCACLKF09H207889	5VCA3RJFX9H208052	5VCACLJF89H208208
5VCACLHEX9H207820	5VCACLKF79H207890	5VCA3RJF19H208053	5VCACLJFX9H208209
5VCACSKF49H207825	5VCACLHE09H207891	5VCA3RJF39H208054	5VCACLJF69H208210
5VCACSKF69H207826	5VCACLHE29H207892	5VCACRJF59H208055	5VCACDKF29H208211
5VCACSKF89H207827	5VCACLKF09H207908	5VCACRJF79H208056	5VCA3LLE49H208212
5VCACSKFX9H207828	5VCACLKF29H207909	5VCACRJF99H208057	5VCACLJF19H208213
5VCACSKE29H207829	5VCACLKF99H207910	5VCACRJF09H208058	5VCACLJF39H208214
5VCACSKE99H207830	5VCA3RHE08H207911	5VCACLHE19H208080	5VCACLHE99H208215
5VCACLJF59H207842	5VCACSKE89H207916	5VCACLKH59H208103	5VCACLJF79H208216
5VCACLHE09H207843	5VCACSKE9H207917	5VCACLKH79H208104	5VCACLJF99H208217
5VCACLKF09H207844	5VCACSKE19H207918	5VCACLHE29H208105	5VCACLJF09H208218
5VCACLKF29H207845	5VCACSKE39H207919	5VCACLHE49H208106	5VCACLJF29H208219
5VCACLKF49H207846	5VCACSKE9H207920	5VCACLJF59H208117	5VCA3RKF79H208220
5VCACLKF69H207847	5VCACSKE19H207921	5VCACLKF99H208118	5VCA3LLE09H208319
5VCACLKF89H207848	5VCACLKE69H207922	5VCACLKF09H208119	5VCACLJF29H208320
5VCACLJF79H207857	5VCACSJF29H207923	5VCACLKF79H208120	5VCACLJF49H208321
5VCACLJF99H207858	5VCACLJF79H207924	5VCACRKF59H208121	5VCACLJF69H208322
5VCACLJF09H207859	5VCACLJF99H207925	5VCACRKF79H208122	5VCACLJF89H208323
5VCACLJF79H207860	5VCACLJF09H207926	5VCACRKF99H208123	5VCACLJFX9H208324
5VCACLJF99H207861	5VCACLJF29H207927	5VCACRHEX9H208128	5VCACLJF19H208325
5VCACLJF09H207862	5VCACLKF69H207928	5VCACRHE19H208129	5VCACLJF39H208326
5VCACLJF29H207863	5VCACLHE99H207968	5VCACLKFX9H208130	5VCACRLE69H208327
5VCACLJF49H207864	5VCACLHE09H207969	5VCACLKF19H208131	5VCACRLE89H208328
5VCACLJF69H207865	5VCACLHE79H207970	5VCACLKF39H208132	5VCACRLEX9H208329
5VCACLJF89H207866	5VCACLHE99H207971	5VCACLKF59H208133	5VCACRLE69H208330
5VCACLJFX9H207867	5VCACLHE09H207972	5VCACLKF79H208134	5VCACRLE89H208331
5VCACDKF79H207880	5VCACRLE99H207995	5VCACLKF99H208135	5VCACRLEX9H208332
5VCACLKF69H207881	5VCACRJF69H207996	5VCACLKF09H208136	5VCACRLE19H208333
5VCACLKF89H207882	5VCACLJF19H207997	5VCACLKF29H208137	5VCACRLE39H208334
5VCACLKFX9H207883	5VCACLJF69H208031	5VCACLKF49H208138	5VCACLJF49H208335
5VCACLKF19H207884	5VCACLJF89H208032	5VCACLKF69H208139	5VCACLHE39H208341
5VCACLKF39H207885	5VCACLHE39H208033	5VCACLKF29H208140	5VCACLHE59H208342
5VCACLKF59H207886	5VCACLHE59H208034	5VCA3SHE39H208141	5VCACLHE99H208361
5VCACLKF79H207887	5VCACRJF69H208050	5VCACLJF49H208206	5VCACLHE09H208362
5VCACLKF99H207888	5VCA3RJF89H208051	5VCACLJF69H208207	5VCACLHE29H208363

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACLHE49H208364	5VCACLJFX9H208470	5VCACLLE89H208522	5VCACLKF29H208705
5VCACLHE69H208365	5VCACLJF19H208471	5VCACLLEX9H208523	5VCACLKF49H208706
5VCACLHE89H208366	5VCACLJF39H208472	5VCACLJF79H208524	5VCACLKF69H208707
5VCACLHEX9H208367	5VCACLJF59H208473	5VCACLHE29H208525	5VCACLKF89H208708
5VCACRJF49H208368	5VCACLJF79H208474	5VCACLHE49H208526	5VCACLHE79H208715
5VCACRJF69H208369	5VCACLJF99H208475	5VCACLHE69H208527	5VCACLHE99H208716
5VCACLKF09H208377	5VCACLJF09H208476	5VCACLHE89H208528	5VCACRLE89H208717
5VCACLHE39H208386	5VCACLJF89H208483	5VCACLHEX9H208529	5VCACRJF59H208718
5VCACLLE89H208438	5VCACLJFX9H208484	5VCACLKH89H208547	5VCACRJF79H208719
5VCACLHE99H208439	5VCACLZZ8AH208485	5VCACLHE39H208548	5VCACRJF39H208720
5VCACLLE69H208440	5VCACLZZXAH208486	5VCACRLE29H208549	5VCACRJF59H208721
5VCACLLE89H208441	5VCACLJF59H208487	5VCACRLE99H208550	5VCACRJF79H208722
5VCACRJF19H208442	5VCACLJF79H208488	5VCACRLE09H208551	5VCACRJF99H208723
5VCACLJF79H208443	5VCACRJF59H208489	5VCACRLE29H208552	5VCACLJF49H208724
5VCACLHE29H208444	5VCACRJF19H208490	5VCACRLE49H208553	5VCACLJF69H208725
5VCACLHE49H208445	5VCACRJF39H208491	5VCACRLE69H208554	5VCACLJF89H208726
5VCACLKF49H208446	5VCACRJF59H208492	5VCACRLE89H208555	5VCACLJF39H208729
5VCACLJF49H208447	5VCACLKF49H208494	5VCACLKF69H208559	5VCACRLE09H208730
5VCACLJF69H208448	5VCACLKF69H208495	5VCACRKG89H208560	5VCACRLE29H208731
5VCACRJF49H208449	5VCACRKF49H208496	5VCACRKGX9H208561	5VCACRLE49H208732
5VCACRJF09H208450	5VCACRKF69H208497	5VCACRKG19H208562	5VCACDKF19H208734
5VCACRJF29H208451	5VCACLKF19H208498	5VCACRKF09H208642	5VCACRJF59H208735
5VCACRJF49H208452	5VCACLKF39H208499	5VCACRKF29H208643	5VCACRJF79H208736
5VCACRJF69H208453	5VCACDLE19H208500	5VCACLKF29H208672	5VCACRJF99H208737
5VCACRJF89H208454	5VCACLJF69H208501	5VCACLLE49H208694	5VCACRJF09H208738
5VCACRJFX9H208455	5VCACLKF29H208512	5VCACRLE29H208695	5VCACRJF29H208739
5VCACRJF19H208456	5VCACLKF49H208513	5VCACRLE49H208696	5VCACRKF09H208740
5VCACRJF39H208457	5VCACLKF69H208514	5VCACRLE69H208697	5VCACRKF29H208741
5VCACRJF59H208458	5VCACRKF49H208515	5VCACRLE89H208698	5VCACLJF69H208742
5VCACLJF49H208464	5VCACRKF69H208516	5VCACRKF79H208699	5VCACR3E09H208758
5VCACLJF69H208465	5VCACRKF89H208517	5VCACRKF9H208700	5VCACR3E29H208759
5VCACLJF89H208466	5VCACLJF19H208518	5VCACRKF19H208701	5VCACLJF89H208760
5VCACLJFX9H208467	5VCACLJF39H208519	5VCACRKF39H208702	5VCACLJFX9H208761
5VCACLJF19H208468	5VCACLJFX9H208520	5VCACRKF59H208703	5VCACLHE59H208762
5VCACLJF39H208469	5VCACLLE69H208521	5VCACRKF79H208704	5VCACLHE79H208763

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACLHE99H208764	5VCA3LJF89H208855	5VCACLKF49H208947	5VCACLLE59H209014
5VCACLHE09H208765	5VCACLKF19H208856	5VCACLKF69H208948	5VCACLHE89H209050
5VCACLHE29H208766	5VCACRJF89H208857	5VCACLKF89H208949	5VCACLHEX9H209051
5VCACLHE49H208767	5VCACLJF39H208858	5VCACRLE69H208960	5VCACRLE29H209068
5VCACLHE69H208768	5VCACLKFX9H208872	5VCACRLE89H208961	5VCACLHE69H209077
5VCA3LLE79H208771	5VCACLKF19H208873	5VCACLLE39H208962	5VCACLHE89H209078
5VCACRLE59H208772	5VCACLKF39H208874	5VCACLLE59H208963	5VCACLHEX9H209079
5VCACRLE79H208773	5VCACLKF59H208875	5VCACDJF29H208968	5VCACLJF29H209080
5VCACRJF49H208774	5VCACLKF79H208876	5VCACDJF49H208969	5VCACLKF09H209111
5VCACRJF69H208775	5VCACLKF99H208877	5VCACDJF09H208970	5VCACLKF29H209112
5VCACRJF89H208776	5VCACLKF09H208878	5VCACDJF29H208971	5VCACLJF69H209129
5VCA3RHF29H208777	5VCACLKF29H208879	5VCACDJF49H208972	5VCACLLE79H209144
5VCA3RHF49H208778	5VCACLKF99H208880	5VCACDJF69H208973	5VCACLLE99H209145
5VCA3RHF69H208779	5VCACLKF09H208881	5VCACDJF89H208974	5VCACRJF59H209156
5VCA3RHF29H208780	5VCACDJF39H208882	5VCACDJFX9H208975	5VCACRJF79H209157
5VCACRJF19H208781	5VCACLJFX9H208890	5VCACDJF19H208976	5VCACRJF99H209158
5VCACLHE09H208782	5VCACLKH49H208898	5VCACDJF39H208977	5VCACRJF09H209159
5VCACLJF99H208783	5VCACRJF29H208899	5VCACDJF59H208978	5VCACRJF79H209160
5VCACLLE49H208811	5VCACRJF59H208900	5VCACDJF79H208979	5VCACRJF99H209161
5VCACLLE69H208812	5VCACRJF79H208901	5VCACDJF39H208980	5VCACRJF09H209162
5VCACLKF99H208815	5VCACRJF99H208902	5VCACDJF59H208981	5VCACRJF29H209163
5VCACLJF49H208836	5VCA3RLEX9H208931	5VCACDJF79H208982	5VCACRJF19H209235
5VCACLJF69H208837	5VCACLJF09H208932	5VCACRKF49H208983	5VCACDLE39H209289
5VCACLHE59H208843	5VCACLJF29H208933	5VCACRKF69H208984	5VCACDLEX9H209290
5VCACLHE79H208844	5VCACLJF49H208934	5VCACLJF19H208986	5VCACDLE19H209291
5VCACLHE99H208845	5VCACLKH69H208935	5VCACLJF39H208987	5VCACDLE39H209292
5VCACLHE09H208846	5VCACLHE19H208936	5VCACLJF59H208988	5VCACDLE59H209293
5VCACLHE29H208847	5VCACLHE39H208937	5VCACLHE09H208989	5VCACDLE79H209294
5VCACDJF39H208848	5VCACLKF19H208940	5VCACLHE79H208990	5VCACDLE99H209295
5VCACRJF99H208849	5VCACLKF39H208941	5VCACLJF99H208993	5VCACDLE09H209296
5VCACRLEX9H208850	5VCACLKF59H208942	5VCACLJF09H208994	5VCACDLE29H209297
5VCACRJF79H208851	5VCACLKF79H208943	5VCACLJF29H208995	5VCACDLE49H209298
5VCACRJF99H208852	5VCACLKF99H208944	5VCACLKF69H208996	5VCACDLE69H209299
5VCACRJF09H208853	5VCACLKF09H208945	5VCACLKF89H208997	5VCACDLE99H209300
5VCACRJF29H208854	5VCACLKF29H208946	5VCACRLE99H208998	5VCACDLE09H209301

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACLKF79H209302	5VCACDJF29H209361	5VCACDKF09H209406	5VCACLLE99H209503
5VCACRKF59H209303	5VCACDJF49H209362	5VCACDKF29H209407	5VCACLLE09H209504
5VCACLKE19H209304	5VCACDJF69H209363	5VCACDKF49H209408	5VCACLLE29H209505
5VCACLJF09H209305	5VCACDJF89H209364	5VCACDKF69H209409	5VCACLLE49H209506
5VCACLJF29H209306	5VCACDJFX9H209365	5VCACDKF29H209410	5VCACLKF39H209507
5VCACLJF49H209307	5VCACDJF19H209366	5VCACDKF49H209411	5VCACRKE29H209508
5VCACLKF89H209308	5VCACDJF39H209367	5VCACDKF69H209412	5VCACRKE49H209509
5VCACLLE29H209309	5VCACDJF59H209368	5VCACDKF89H209413	5VCACLJF19H209510
5VCACLLE99H209310	5VCACDJF79H209369	5VCACDKFX9H209414	5VCACLJF39H209511
5VCACLLE09H209311	5VCACDJF39H209370	5VCACLKF89H209440	5VCACLHF89H209512
5VCACLLE29H209312	5VCACDLE79H209375	5VCACLKFX9H209441	5VCACLHFX9H209513
5VCACLLE49H209313	5VCACDLE99H209376	5VCACLKF19H209442	5VCACLJF99H209514
5VCACLLE69H209314	5VCACDLE09H209377	5VCACLKF39H209443	5VCACLJF09H209515
5VCA3RHF89H209335	5VCACDLE29H209378	5VCACLKF59H209444	5VCACRKF19H209526
5VCA3RHF9H209336	5VCACDLE49H209379	5VCA3LHE99H209445	5VCACLKF99H209527
5VCA3RHF19H209337	5VCACDLE09H209380	5VCACRKF39H209446	5VCACDJF39H209529
5VCA3RHF39H209338	5VCACDLE69H209383	5VCACLKFX9H209447	5VCACDJFX9H209530
5VCACLKF89H209339	5VCACLKF29H209384	5VCACLKH09H209448	5VCACDJF19H209531
5VCACLKF49H209340	5VCACLKF49H209385	5VCA3RHE29H209449	5VCACDJF39H209532
5VCACLKF69H209341	5VCACLJF49H209386	5VCACLLE39H209464	5VCACDJF59H209533
5VCACLKF89H209342	5VCACLJF69H209387	5VCACLKF29H209465	5VCACDJF79H209534
5VCACLJF39H209346	5VCACLJF89H209388	5VCACLKF49H209466	5VCACDJF99H209535
5VCACLJF59H209347	5VCACLJFX9H209389	5VCACRKF29H209467	5VCACDJF09H209536
5VCACDKF19H209348	5VCACLJF69H209390	5VCACRKF49H209468	5VCACDJF29H209537
5VCACDKF39H209349	5VCACLJF89H209391	5VCACRKF69H209469	5VCACDJF49H209538
5VCACLLEX9H209350	5VCACLJFX9H209392	5VCACLKF69H209470	5VCACDJF69H209539
5VCACDKF19H209351	5VCACDKF89H209394	5VCACLKF89H209471	5VCACDJF29H209540
5VCACDJF19H209352	5VCACLJF99H209397	5VCACLLE39H209495	5VCACDJF49H209541
5VCACDJF39H209353	5VCACDKH39H209398	5VCACLLE59H209496	5VCACDJF69H209542
5VCACDJF59H209354	5VCACLKE59H209399	5VCACLLE79H209497	5VCACDJF89H209543
5VCACDJF79H209355	5VCACLJF59H209400	5VCACLLE99H209498	5VCACDJFX9H209544
5VCACDKF09H209356	5VCACLJF79H209401	5VCACLLE09H209499	5VCACDJF19H209545
5VCACDKF29H209357	5VCACLLE39H209402	5VCACLLE39H209500	5VCACDJF39H209546
5VCACDKF49H209358	5VCACLLE59H209403	5VCACLLE59H209501	5VCACDJF59H209547
5VCACDJF09H209360	5VCACLLE79H209404	5VCACLLE79H209502	5VCACLLE99H209548

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACLLE09H209549	5VCACLLE29H209584	5VCACRKF89H209621	5VCACRKE39H209663
5VCACLLE79H209550	5VCACLLE49H209585	5VCACRJF19H209624	5VCACRKE59H209664
5VCACLLE99H209551	5VCACLLE69H209586	5VCACRJF39H209625	5VCACRKE79H209665
5VCACLLE09H209552	5VCACLKF59H209587	5VCACRJF59H209626	5VCACDKF49H209666
5VCACLLE29H209553	5VCACLKF79H209588	5VCACDKF59H209627	5VCACDKF69H209667
5VCACLLE49H209554	5VCACLKF99H209589	5VCACDKF79H209628	5VCACLLE09H209681
5VCACLLE69H209555	5VCACLKF59H209590	5VCACDKF99H209629	5VCACLLE29H209682
5VCACLLE89H209556	5VCACLKF79H209591	5VCACDKF59H209630	5VCACLLE49H209683
5VCACLLEX9H209557	5VCACLKF99H209592	5VCACDKF79H209631	5VCACLLE69H209684
5VCACLLE19H209558	5VCACLKF09H209593	5VCACDKF99H209632	5VCACLLE89H209685
5VCACLLE39H209559	5VCACLKF29H209594	5VCACDKF09H209633	5VCACLLEX9H209686
5VCACLLEX9H209560	5VCACLKF49H209595	5VCACDKF29H209634	5VCACLJF79H209687
5VCACLLE19H209561	5VCACLKF69H209596	5VCACLKF19H209635	5VCACLJF99H209688
5VCACLLE39H209562	5VCACLKF89H209597	5VCACLKF39H209636	5VCACLKF29H209689
5VCACLLE59H209563	5VCACLKFX9H209598	5VCACLKF59H209637	5VCACLKF99H209690
5VCACLLE79H209564	5VCACLKF19H209599	5VCACLKF79H209638	5VCACLKF09H209691
5VCACLLE99H209565	5VCACLKF49H209600	5VCACLKF99H209639	5VCACLKF29H209692
5VCACLLE09H209566	5VCACLKF69H209601	5VCACLKF59H209640	5VCACLKF49H209693
5VCACLLE29H209567	5VCACLKF89H209602	5VCACLKF79H209641	5VCACLKF69H209694
5VCACLLE49H209568	5VCACLKFX9H209603	5VCACLKF99H209642	5VCACLKF89H209695
5VCACLLE69H209569	5VCACLKF19H209604	5VCACLKF09H209643	5VCACLKFX9H209696
5VCACLLE29H209570	5VCACLKF39H209605	5VCACLKF29H209644	5VCACLKF19H209697
5VCACLLE49H209571	5VCACLKF59H209606	5VCACLKF49H209645	5VCACLKF39H209698
5VCACLLE69H209572	5VCACRLE69H209607	5VCACLKF69H209646	5VCACLKF59H209699
5VCACLLE89H209573	5VCACRLE89H209608	5VCACLKF89H209647	5VCACLKF89H209700
5VCACLLEX9H209574	5VCACRLEX9H209609	5VCACRJF49H209648	5VCACDKF29H209701
5VCACLLE19H209575	5VCACLKF09H209612	5VCACRJF69H209649	5VCACDKF49H209702
5VCACLLE39H209576	5VCACRKF99H209613	5VCACRJF49H209651	5VCACDKF69H209703
5VCACLLE59H209577	5VCACRKF09H209614	5VCACRJF69H209652	5VCACDKF89H209704
5VCACLLE79H209578	5VCACRKF29H209615	5VCACRJF89H209653	5VCACDKFX9H209705
5VCACLLE99H209579	5VCACRKF49H209616	5VCACRJFX9H209654	5VCACDKF19H209706
5VCACLLE59H209580	5VCACRKF69H209617	5VCACRJF19H209655	5VCACLJF99H209707
5VCACLLE79H209581	5VCACRKF89H209618	5VCACRJF39H209656	5VCACRJF79H209708
5VCACLLE99H209582	5VCACRKF9H209619	5VCACLPE29H209658	5VCACSKF19H209709
5VCACLLE09H209583	5VCACRKF69H209620	5VCA3RLE39H209662	5VCACSKF89H209710

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACSKFX9H209711	5VCACRJF69H209750	5VCACRLE59H209811	5VCACDKH4AH209852
5VCACSKF19H209712	5VCACRJF89H209751	5VCACRLE79H209812	5VCACDKH6AH209853
5VCACSKF39H209713	5VCACRJFX9H209752	5VCACRLE99H209813	5VCACDKH8AH209854
5VCACSKF59H209714	5VCACRJF19H209753	5VCACRLE09H209814	5VCACDKHXA209855
5VCACSKF79H209715	5VCACRJF39H209754	5VCACRLE29H209815	5VCACDKH1AH209856
5VCACSKF99H209716	5VCACRKF29H209758	5VCACRLE49H209816	5VCACDJF3AH209857
5VCACSKF09H209717	5VCACLLE09H209759	5VCACRLE69H209817	5VCACLLE7AH209858
5VCACSKF29H209718	5VCACLKE59H209760	5VCACRLE89H209818	5VCACLLE9AH209859
5VCACSKF49H209719	5VCACLJF8AH209766	5VCACRJFXAH209822	5VCACLLE5AH209860
5VCACSKF09H209720	5VCACLJFXAH209767	5VCACRJF1AH209823	5VCACRJF0AH209862
5VCACSKF29H209721	5VCACLJF1AH209768	5VCACLKF49H209824	5VCACLLE2AH209864
5VCACSKF49H209722	5VCACRJFXAH209769	5VCACLKF69H209825	5VCACDJF2AH209865
5VCACSKF69H209723	5VCACRJF6AH209770	5VCACDKH3AH209826	5VCA3LLE6AH209866
5VCACSKF89H209724	5VCACRJF8AH209771	5VCACDKH5AH209827	5VCACRJF1AH209871
5VCACSKFX9H209725	5VCACLLE8AH209772	5VCACDKH7AH209828	5VCACRJF3AH209872
5VCACSKF19H209726	5VCACDKH39H209773	5VCACDJF5AH209830	5VCACRJF5AH209873
5VCACSKF39H209727	5VCACLJF29H209774	5VCACDJF7AH209831	5VCACLKF0AH209887
5VCACSKF59H209728	5VCACSJF6AH209775	5VCACDJF9AH209832	5VCACLKF2AH209888
5VCACSKF79H209729	5VCACSLE89H209776	5VCACDJF0AH209833	5VCACRJF9AH209889
5VCACSKF39H209730	5VCACDKF7AH209777	5VCACDJF2AH209834	5VCACRJF5AH209890
5VCACSKF59H209731	5VCACDKF9AH209778	5VCACDKF6AH209835	5VCACRJF7AH209891
5VCACSKF79H209732	5VCACDKF0AH209779	5VCACDKF8AH209836	5VCACRJF9AH209892
5VCACSKF99H209733	5VCACDKF7AH209780	5VCACDKFXAH209837	5VCACLJF6AH209894
5VCACRJF89H209734	5VCACDKF9AH209781	5VCACDKF1AH209838	5VCACLJF0AH209910
5VCACRJFX9H209735	5VCACDKF0AH209782	5VCACLKF7AH209840	5VCACLHF5AH209911
5VCACLJF79H209740	5VCACLJF79H209785	5VCACLKF9AH209841	5VCACLHF7AH209912
5VCACRLEX9H209741	5VCA3DHF7AH209799	5VCACLJF9AH209842	5VCACLHF9AH209913
5VCACRLE19H209742	5VCA3DHFAXAH209800	5VCACLJF0AH209843	5VCACLHF0AH209914
5VCACRJF99H209743	5VCA3DHF1AH209801	5VCACLJF2AH209844	5VCACLLE8AH209917
5VCACRJF09H209744	5VCACLJF8AH209802	5VCACLJF4AH209845	5VCACDKF1AH209919
5VCACRJF29H209745	5VCACLJFXAH209803	5VCACLJF6AH209846	5VCACRJF59H209920
5VCACRJF49H209746	5VCACLLE6AH209804	5VCACLJF8AH209847	5VCACRJF79H209921
5VCACRJF69H209747	5VCACLKF7AH209806	5VCACLJFXAH209848	5VCACRJF99H209922
5VCACRJF89H209748	5VCACRLE79H209809	5VCACLJF1AH209849	5VCACLLE3AH209923
5VCACRJFX9H209749	5VCACRLE39H209810	5VCACLJF8AH209850	5VCACLLE5AH209924

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACLLE7AH209925	5VCACDKF4AH209963	5VCACLKF6AH210087	5VCACLKF4AH210136
5VCACLLE9AH209926	5VCACDKF6AH209964	5VCACRKF6AH210089	5VCACLKF6AH210137
5VCACLKF8AH209927	5VCACDKF8AH209965	5VCACRKF2AH210090	5VCACLKF8AH210138
5VCACRJF4AH209928	5VCACDKFXAH209966	5VCACRKF4AH210091	5VCACLKFXAH210139
5VCACRJF6AH209929	5VCACDKF1AH209967	5VCACRKF6AH210092	5VCACRKF2AH210140
5VCACRJF2AH209930	5VCACDKF3AH209968	5VCACRKF8AH210093	5VCACRKF4AH210141
5VCACRJF4AH209931	5VCACLHE4AH209969	5VCACRKFAXAH210094	5VCACRKF6AH210142
5VCACDJF8AH209935	5VCACLLE1AH209970	5VCACRKF1AH210095	5VCACRKF8AH210143
5VCACDJFXAH209936	5VCACLJF9AH209971	5VCACRKF3AH210096	5VCACRKFAXAH210144
5VCACDJF1AH209937	5VCACLKF5AH209979	5VCACRHE7AH210097	5VCACRKF1AH210145
5VCACDJF3AH209938	5VCACLKF1AH209980	5VCACLJF4AH210106	5VCACRKF3AH210146
5VCACDJF5AH209939	5VCACLKF3AH209981	5VCACLJF6AH210107	5VCACRKF5AH210147
5VCACLKF0AH209940	5VCACLKF5AH209982	5VCACDKF2AH210108	5VCACRKF7AH210148
5VCACLKF2AH209941	5VCACLKF7AH209983	5VCACRLE7AH210110	5VCACRKF9AH210149
5VCACLKF4AH209942	5VCACLKF9AH209984	5VCACRLE9AH210111	5VCACRKF5AH210150
5VCACLLE9AH209943	5VCACLKF0AH209985	5VCACRLE0AH210112	5VCACRKF7AH210151
5VCACLLE0AH209944	5VCACLJF0AH209986	5VCACRLE2AH210113	5VCACRKF9AH210152
5VCACLLE2AH209945	5VCACDJF7AH210056	5VCACRLE4AH210114	5VCACRKF0AH210153
5VCACLLE4AH209946	5VCACRJF2AH210057	5VCACRLE6AH210115	5VCACRKF2AH210154
5VCACLLE6AH209947	5VCACRJF4AH210058	5VCACRLE8AH210116	5VCACRKF4AH210155
5VCACLLE8AH209948	5VCACRJF6AH210059	5VCACRLEXAH210117	5VCACLKFXAH210156
5VCACLLEXAH209949	5VCACLJF6AH210060	5VCACRLE1AH210118	5VCACLKF1AH210157
5VCACLLE6AH209950	5VCACRHE8AH210061	5VCACRLE3AH210119	5VCACLKF3AH210158
5VCACLLE8AH209951	5VCACRJF6AH210062	5VCACRJF5AH210120	5VCACLKF5AH210159
5VCACLLEXAH209952	5VCACRJF8AH210063	5VCACRJF7AH210121	5VCACSKF9AH210160
5VCACLLE1AH209953	5VCACRJFXAH210064	5VCACRJF9AH210122	5VCACRJF7AH210166
5VCACLLE3AH209954	5VCACRJF1AH210065	5VCACRJF0AH210123	5VCACRJF9AH210167
5VCACLLE5AH209955	5VCACRKF3AH210079	5VCACLKF8AH210124	5VCACRJF0AH210168
5VCACLLE7AH209956	5VCACRKFAXAH210080	5VCACLKFXAH210125	5VCACRJF2AH210169
5VCACLLE9AH209957	5VCACRKF1AH210081	5VCACDJF4AH210130	5VCACRJF9AH210170
5VCACLJF6AH209958	5VCACLLEXAH210082	5VCACDJF6AH210131	5VCACRJF0AH210171
5VCACLJF8AH209959	5VCACLKF9AH210083	5VCACLKF7AH210132	5VCACRJF2AH210172
5VCACLKF6AH209960	5VCACLKF0AH210084	5VCACLKF9AH210133	5VCACRLE9AH210173
5VCACDKF0AH209961	5VCACLKF2AH210085	5VCACLKF0AH210134	5VCACLKE2AH210174
5VCACDKF2AH209962	5VCACLKF4AH210086	5VCACLKF2AH210135	5VCACRJF8AH210175

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACRJFXAH210176	5VCACRJF9AH210217	5VCACDKF7AH210265	5VCACDLEXAH210301
5VCACRJF1AH210177	5VCACLJF4AH210218	5VCACDKF9AH210266	5VCACLLE9AH210302
5VCACRJF3AH210178	5VCACLKF8AH210219	5VCACDKF0AH210267	5VCACLLE0AH210303
5VCA3LLE3AH210179	5VCACLKF4AH210220	5VCACDKF2AH210268	5VCACLLE2AH210304
5VCA3LLEXAH210180	5VCACRJF0AH210221	5VCACDKF4AH210269	5VCACLLE4AH210305
5VCA3LLE1AH210181	5VCACLLE0AH210222	5VCACDKF0AH210270	5VCACLLE6AH210306
5VCACLJF9AH210182	5VCACLLE2AH210223	5VCACDKF2AH210271	5VCA3RHE3AH210307
5VCACLJF0AH210183	5VCACRLE6AH210227	5VCACDKF4AH210272	5VCA3RHE5AH210308
5VCACLPE4AH210184	5VCACRLE8AH210228	5VCACDKF6AH210273	5VCACLLE1AH210309
5VCACRKF2AH210185	5VCACRLEXAH210229	5VCACDKF8AH210274	5VCACLLE8AH210310
5VCACRKF4AH210186	5VCACLLEXAH210230	5VCACDKFXAH210275	5VCACLJF5AH210311
5VCA3DHE4AH210187	5VCACLKE2AH210241	5VCACDKF1AH210276	5VCACLJF7AH210312
5VCACLLE4AH210188	5VCACLKE4AH210242	5VCACDKF3AH210277	5VCACLJF9AH210313
5VCACLLE6AH210189	5VCACLKE6AH210243	5VCACDKF5AH210278	5VCACLJF0AH210314
5VCACLLE2AH210190	5VCACLKE8AH210244	5VCACDKF7AH210279	5VCACLJF2AH210315
5VCACLJFXAH210191	5VCACLKEXAH210245	5VCACDKF3AH210280	5VCACLJF4AH210316
5VCACLJF1AH210192	5VCACLKE1AH210246	5VCACDKF5AH210281	5VCACLLE0AH210317
5VCACLJF3AH210193	5VCACLKE3AH210247	5VCACDKF7AH210282	5VCACLLE2AH210318
5VCACLJF5AH210194	5VCACLKE5AH210248	5VCACDKF9AH210283	5VCACLLE4AH210319
5VCACLJF7AH210195	5VCACLKE7AH210249	5VCACDKF0AH210284	5VCACLLE0AH210320
5VCACRJF5AH210196	5VCACLKE3AH210250	5VCACDKF2AH210285	5VCACLLE2AH210321
5VCACLLE5AH210197	5VCACLKE5AH210251	5VCACDKF4AH210286	5VCACLLE4AH210322
5VCACLLE7AH210198	5VCACRJF0AH210252	5VCACDKF6AH210287	5VCACLLE6AH210323
5VCACLLE9AH210199	5VCACRJF2AH210253	5VCACDKF8AH210288	5VCACLLE8AH210324
5VCACLLE1AH210200	5VCACRJF4AH210254	5VCACDKFXAH210289	5VCACLLEXAH210325
5VCACLLE3AH210201	5VCACRJF6AH210255	5VCACDKF6AH210290	5VCACLLE1AH210326
5VCACLLE5AH210202	5VCACDKF6AH210256	5VCACDKF8AH210291	5VCACLKF0AH210327
5VCACRJF9AH210203	5VCACDKF8AH210257	5VCACDKFXAH210292	5VCACLKF2AH210328
5VCACSKF3AH210204	5VCACDKFXAH210258	5VCACDKF1AH210293	5VCACLKF4AH210329
5VCACRJF2AH210205	5VCACDKF1AH210259	5VCACDKF3AH210294	5VCACDKF3AH210330
5VCACRJF4AH210206	5VCACDKF8AH210260	5VCACDKF5AH210295	5VCACDKF5AH210331
5VCACLKF1AH210207	5VCACDKFXAH210261	5VCACLKF4AH210296	5VCACDKF7AH210332
5VCA3DJF4AH210208	5VCACDKF1AH210262	5VCACLLE9AH210297	5VCACDKF9AH210333
5VCA3DJF6AH210209	5VCACDKF3AH210263	5VCACRJF4AH210299	5VCACDKF0AH210334
5VCACLHE4AH210216	5VCACDKF5AH210264	5VCACDLE8AH210300	5VCACDKF2AH210335

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACDKF4AH210336	5VCACRLE2AH210371	5VCACLJF5AH210406	5VCACLJF2AH210444
5VCACDKF6AH210337	5VCACRLE4AH210372	5VCACRJF3AH210407	5VCACLJF4AH210445
5VCACDKF8AH210338	5VCACRLE6AH210373	5VCACRJF5AH210408	5VCACLKF8AH210446
5VCACDKFXAH210339	5VCACRLE8AH210374	5VCA3DHF6AH210409	5VCACLKE0AH210447
5VCACDKF6AH210340	5VCACRLEXAH210375	5VCACLJF7AH210410	5VCACLJFXAH210448
5VCACDKF8AH210341	5VCACRLE1AH210376	5VCACLKF0AH210411	5VCACLJF1AH210449
5VCACDKFXAH210342	5VCACRLE3AH210377	5VCA3RLE3AH210413	5VCACDJF0AH210450
5VCACDKF1AH210343	5VCACRLE5AH210378	5VCACDLE3AH210415	5VCACDJF2AH210451
5VCACDKF3AH210344	5VCACRLE7AH210379	5VCACDLE5AH210416	5VCACDJF4AH210452
5VCACDKF5AH210345	5VCACRLE3AH210380	5VCACDLE7AH210417	5VCACDJF6AH210453
5VCACDKF7AH210346	5VCACRLE5AH210381	5VCACDLE9AH210418	5VCACDJF8AH210454
5VCACDKF9AH210347	5VCACRLE7AH210382	5VCACDLE0AH210419	5VCACDJFXAH210455
5VCACDKF0AH210348	5VCACRLE9AH210383	5VCACDKF4AH210420	5VCACDJF1AH210456
5VCACDKF2AH210349	5VCACLJFXAH210384	5VCACDKF6AH210421	5VCACDJF3AH210457
5VCACLLE9AH210350	5VCACSLE3AH210385	5VCACDKF8AH210422	5VCACDJF5AH210458
5VCACLLE0AH210351	5VCACSLE5AH210386	5VCACDKFXAH210423	5VCACDJF7AH210459
5VCACRKF6AH210352	5VCACRJF1AH210387	5VCACDKF1AH210424	5VCACRJF7AH210460
5VCACRJF6AH210353	5VCACRJF3AH210388	5VCACDKF3AH210425	5VCACDKF7AH210461
5VCACLLE6AH210354	5VCACRJF5AH210389	5VCACDKF5AH210426	5VCACDKF9AH210462
5VCACLLE8AH210355	5VCACRJF1AH210390	5VCACDLEXAH210427	5VCACDKF0AH210463
5VCACLLEXAH210356	5VCACRJF3AH210391	5VCACLKF6AH210428	5VCACDKF2AH210464
5VCACLLE1AH210357	5VCACRJF5AH210392	5VCACLKF8AH210429	5VCACDKF4AH210465
5VCACLLE3AH210358	5VCACRJF7AH210393	5VCACDJF5AH210430	5VCACDKF6AH210466
5VCACLLE5AH210359	5VCACLJF2AH210394	5VCACDJF7AH210431	5VCACDKF8AH210467
5VCACLLE1AH210360	5VCACLJF4AH210395	5VCACLJF6AH210432	5VCACDKFXAH210468
5VCACLLE3AH210361	5VCACLJF6AH210396	5VCACLJF8AH210433	5VCACDKF1AH210469
5VCACLLE5AH210362	5VCACLJF8AH210397	5VCA3DHE8AH210435	5VCACDKF8AH210470
5VCACLLE7AH210363	5VCACLJFXAH210398	5VCACLJF3AH210436	5VCACDKFXAH210471
5VCACLLE9AH210364	5VCACLJF1AH210399	5VCACLJF5AH210437	5VCACDKF1AH210472
5VCACLLE0AH210365	5VCACLJF4AH210400	5VCACLJF7AH210438	5VCACDKF3AH210473
5VCACLLE2AH210366	5VCACLJF6AH210401	5VCACLJF9AH210439	5VCACDKF5AH210474
5VCACLLE4AH210367	5VCACLJF8AH210402	5VCACLJF5AH210440	5VCACDKF7AH210475
5VCACLLE6AH210368	5VCACLJFXAH210403	5VCA3LLE1AH210441	5VCACDKF9AH210476
5VCACLLE8AH210369	5VCACLJF1AH210404	5VCA3LLE3AH210442	5VCACDKF0AH210477
5VCACRLE0AH210370	5VCACLJF3AH210405	5VCACLJF0AH210443	5VCACDKF2AH210478

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACDKF4AH210479	5VCACDLE5AH210514	5VCACLKF7AH210549	5VCACLLE1AH210584
5VCACDKF0AH210480	5VCACDLE7AH210515	5VCACLKF3AH210550	5VCACLLE3AH210585
5VCACDKF2AH210481	5VCACDLE9AH210516	5VCACLKF5AH210551	5VCACLLE5AH210586
5VCACDKF4AH210482	5VCACDLE0AH210517	5VCACLKF7AH210552	5VCACLLE7AH210587
5VCACDKF6AH210483	5VCACDLE2AH210518	5VCACLLE1AH210553	5VCACLLE9AH210588
5VCACDKF8AH210484	5VCACDLE4AH210519	5VCACLLE3AH210554	5VCACLLE0AH210589
5VCACDKFXAH210485	5VCACDLE0AH210520	5VCACLLE5AH210555	5VCACLLE7AH210590
5VCACDKF1AH210486	5VCACDLE2AH210521	5VCACLLE7AH210556	5VCACLLE9AH210591
5VCACDKF3AH210487	5VCACDLE4AH210522	5VCACLLE9AH210557	5VCACLLE0AH210592
5VCACDKF5AH210488	5VCACDLE6AH210523	5VCACLLE0AH210558	5VCACLLE2AH210593
5VCACDKF7AH210489	5VCACDLE8AH210524	5VCACLLE2AH210559	5VCACLLE4AH210594
5VCACDKF3AH210490	5VCACDLEXAH210525	5VCACLLE9AH210560	5VCACLLE6AH210595
5VCACDKF5AH210491	5VCACDLE1AH210526	5VCACLLE0AH210561	5VCACLLE8AH210596
5VCACDKF7AH210492	5VCACDLE3AH210527	5VCACLLE2AH210562	5VCACLLEXAH210597
5VCACDKF9AH210493	5VCACDLE5AH210528	5VCACLLE4AH210563	5VCACLLE1AH210598
5VCACDKF0AH210494	5VCACDLE7AH210529	5VCACLLE6AH210564	5VCACLLE3AH210599
5VCACDKF2AH210495	5VCACDLE3AH210530	5VCACLLE8AH210565	5VCACLLE6AH210600
5VCACDKF4AH210496	5VCACDLE5AH210531	5VCACLLEXAH210566	5VCACLLE8AH210601
5VCACDKF6AH210497	5VCACDLE7AH210532	5VCACLLE1AH210567	5VCACLLEXAH210602
5VCACDKF8AH210498	5VCACDLE9AH210533	5VCACLLE3AH210568	5VCACLLE1AH210603
5VCACDKFXAH210499	5VCA3LJF3AH210534	5VCACLLE5AH210569	5VCACLLE3AH210604
5VCACDKF2AH210500	5VCACLJF5AH210535	5VCACLLE1AH210570	5VCACLLE5AH210605
5VCACDKF4AH210501	5VCACDLE4AH210536	5VCACLLE3AH210571	5VCACLLE7AH210606
5VCACDKF6AH210502	5VCACDLE6AH210537	5VCACLLE5AH210572	5VCACLLE9AH210607
5VCACDKF8AH210503	5VCACDLE8AH210538	5VCACLLE7AH210573	5VCACLLE0AH210608
5VCACDKFXAH210504	5VCACDLEXAH210539	5VCACLLE9AH210574	5VCACLLE2AH210609
5VCACDKF1AH210505	5VCACDLE6AH210540	5VCACLLE0AH210575	5VCACLLE9AH210610
5VCACDKF3AH210506	5VCACDLE8AH210541	5VCACLLE2AH210576	5VCACLLE0AH210611
5VCACDKF5AH210507	5VCACLLE7AH210542	5VCACLLE4AH210577	5VCACLLE2AH210612
5VCACDLEXAH210508	5VCACLLE9AH210543	5VCACLLE6AH210578	5VCACLLE4AH210613
5VCACDLE1AH210509	5VCACLLE0AH210544	5VCACLLE8AH210579	5VCACLLE6AH210614
5VCACDLE8AH210510	5VCACLLE2AH210545	5VCACLLE4AH210580	5VCACRKE2AH210615
5VCACDLEXAH210511	5VCACLLE4AH210546	5VCACLLE6AH210581	5VCACRKE4AH210616
5VCACDLE1AH210512	5VCACLLE6AH210547	5VCACLLE8AH210582	5VCACSKE7AH210617
5VCACDLE3AH210513	5VCACLLE8AH210548	5VCACLLEXAH210583	5VCACSKE9AH210618

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACSKE0AH210619	5VCAKLF2AH210654	5VCACRLE0AH210689	5VCAKLF8AH210724
5VCACSKE7AH210620	5VCACR0F0AH210655	5VCACRLE7AH210690	5VCAKLF9AH210725
5VCACSKE9AH210621	5VCACR2F2AH210656	5VCACRLE9AH210691	5VCAKLF1AH210726
5VCACSKE0AH210622	5VCAKLF3AH210657	5VCACRLE0AH210692	5VCAKLF3AH210727
5VCACSKE2AH210623	5VCAKLF1AH210658	5VCACRLE2AH210693	5VCAKLF5AH210728
5VCACSKE4AH210624	5VCAKLF3AH210659	5VCACRLE4AH210694	5VCAKLF7AH210729
5VCACSKE6AH210625	5VCAKLF2AH210660	5VCACR1F1AH210695	5VCAKLF3AH210730
5VCACSKE8AH210626	5VCAKLF4AH210661	5VCACR3F3AH210696	5VCAKLF5AH210731
5VCACSKE9AH210627	5VCAKLF5AH210662	5VCACR5F5AH210697	5VCAKLF7AH210732
5VCACSKE1AH210628	5VCAKLF7AH210663	5VCACR7F7AH210698	5VCAKLF9AH210733
5VCACDLE0AH210629	5VCAKLF5AH210664	5VCAKLF2AH210699	5VCAKLF0AH210734
5VCACDLE7AH210630	5VCAKLF7AH210665	5VCAKLF5AH210700	5VCACR9F9AH210735
5VCACRLE2AH210631	5VCAKLF9AH210666	5VCAKLF7AH210701	5VCACR0F0AH210736
5VCACRLE4AH210632	5VCAKLF0AH210667	5VCAKLF9AH210702	5VCACR2F2AH210737
5VCACRLE6AH210633	5VCAKLF2AH210668	5VCAKLF0AH210703	5VCAKLF8AH210738
5VCACRLE8AH210634	5VCAKLF4AH210669	5VCAKLF2AH210704	5VCAKLF9AH210739
5VCACRLEXAH210635	5VCAKLF0AH210670	5VCACR0F0AH210705	5VCAKLF6AH210740
5VCACRLE1AH210636	5VCAKLF2AH210671	5VCACR2F2AH210706	5VCAKLF8AH210741
5VCACRLE3AH210637	5VCAKLF4AH210672	5VCAKLF9AH210707	5VCACD2F2AH210742
5VCACRLE5AH210638	5VCACR4F4AH210673	5VCACR6F6AH210708	5VCACD4F4AH210743
5VCACRLE7AH210639	5VCACR6F6AH210674	5VCACR8F8AH210709	5VCACD6F6AH210744
5VCACRLE3AH210640	5VCAKLF4AH210675	5VCACR4F4AH210710	5VCACD8F8AH210745
5VCACRLE5AH210641	5VCAKLF6AH210676	5VCACR6F6AH210711	5VCACD9F9AH210746
5VCACRLE7AH210642	5VCAKLF8AH210677	5VCACR8F8AH210712	5VCA3LHE2AH210747
5VCACRLE9AH210643	5VCA3RHE5AH210678	5VCAKLF3AH210713	5VCAKLF0AH210748
5VCACRLE0AH210644	5VCACR5F5AH210679	5VCAKLF5AH210714	5VCA3R9F9AH210749
5VCACRLE2AH210645	5VCACR1F1AH210680	5VCAKLF7AH210715	5VCAKLF9AH210750
5VCACRLE4AH210646	5VCACS2F2AH210681	5VCAKLF9AH210716	5VCAKLF0AH210751
5VCACRLE6AH210647	5VCACS4F4AH210682	5VCAKLF0AH210717	5VCACSHE3AH210752
5VCAKLF9AH210648	5VCACS6F6AH210683	5VCAKLF2AH210718	5VCACS2F1AH210753
5VCAKLF0AH210649	5VCACS8F8AH210684	5VCAKLF4AH210719	5VCAKLF3AH210758
5VCAKLF7AH210650	5VCACS9F9AH210685	5VCAKLF0AH210720	5VCAKLF5AH210759
5VCAKLF9AH210651	5VCACS1F1AH210686	5VCAKLF2AH210721	5VCAKLF1AH210760
5VCAKLF0AH210652	5VCACS3F3AH210687	5VCAKLF4AH210722	5VCAKLF3AH210761
5VCAKLF2AH210653	5VCAKLF8AH210688	5VCAKLF6AH210723	5VCAKLF5AH210762

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACLJF7AH210763	5VCACRJF7AH210801	5VCACLKFXAH210836	5VCACLLE4AH210871
5VCACLJF9AH210764	5VCACRJF9AH210802	5VCACLKF1AH210837	5VCACLLE6AH210872
5VCACLJF0AH210765	5VCACRJF0AH210803	5VCACLKF3AH210838	5VCACLKF6AH210879
5VCACLJF2AH210766	5VCACDJF9AH210804	5VCACLKF5AH210839	5VCACLLE9AH210882
5VCACLJF4AH210767	5VCACDJF0AH210805	5VCACLKF1AH210840	5VCACDLE3AH210883
5VCACLJF6AH210768	5VCACLJFXAH210806	5VCACLKF3AH210841	5VCACDKF2AH210884
5VCACLJF8AH210769	5VCACLJF1AH210807	5VCACLKF5AH210842	5VCACDKF4AH210885
5VCACLJF4AH210770	5VCACLJF3AH210808	5VCACLKF7AH210843	5VCACDKF6AH210886
5VCACLJF6AH210771	5VCACLJF5AH210809	5VCACLKF9AH210844	5VCACDKF8AH210887
5VCACLJF8AH210772	5VCACLJF1AH210810	5VCACLKF0AH210845	5VCACDKFXAH210888
5VCACLJFXAH210773	5VCACRKF1AH210811	5VCACLKF2AH210846	5VCACDKF1AH210889
5VCACLJF1AH210774	5VCACRKF3AH210812	5VCACLKF4AH210847	5VCACDKF8AH210890
5VCACLJF3AH210775	5VCACDJFXAH210813	5VCACLKF6AH210848	5VCACDKFXAH210891
5VCACRJF1AH210776	5VCA3RHF8AH210814	5VCACLKF8AH210849	5VCACDKF1AH210892
5VCACRJF3AH210777	5VCACLJF0AH210815	5VCACLKF4AH210850	5VCACDKF3AH210893
5VCACRJF5AH210778	5VCACLKF4AH210816	5VCACLKF6AH210851	5VCACDKF5AH210894
5VCACSHE1AH210782	5VCACLKF6AH210817	5VCACLKF8AH210852	5VCACDKF7AH210895
5VCACLJF2AH210783	5VCACRJF2AH210818	5VCACLLE2AH210853	5VCACDKF9AH210896
5VCACLJF4AH210784	5VCACRJF4AH210819	5VCACLLE4AH210854	5VCACDKF0AH210897
5VCACLJF6AH210785	5VCACRJF0AH210820	5VCACLLE6AH210855	5VCACDKF2AH210898
5VCACLJF8AH210786	5VCACRJF2AH210821	5VCACLLE8AH210856	5VCACDKF4AH210899
5VCACLJFXAH210787	5VCACRJF4AH210822	5VCACLLEXAH210857	5VCACDKF7AH210900
5VCACLJF1AH210788	5VCACRJF6AH210823	5VCACLLE1AH210858	5VCACDKF9AH210901
5VCACLJF3AH210789	5VCACRJF8AH210824	5VCACLLE3AH210859	5VCACDKF0AH210902
5VCACDJF2AH210790	5VCACRLE4AH210825	5VCACLLEXAH210860	5VCACDKF2AH210903
5VCACDJF4AH210791	5VCACSLE7AH210826	5VCACLLE1AH210861	5VCACDKF4AH210904
5VCACDJF6AH210792	5VCACLKF9AH210827	5VCACLLE3AH210862	5VCACLLE1AH210908
5VCACDJF8AH210793	5VCACLKF0AH210828	5VCACLLE5AH210863	5VCACLLE3AH210909
5VCACDJFXAH210794	5VCACLKF2AH210829	5VCACLLE7AH210864	5VCACLLEXAH210910
5VCACRJF5AH210795	5VCACLKF9AH210830	5VCACLLE9AH210865	5VCACLLE1AH210911
5VCACRJF7AH210796	5VCACLKF0AH210831	5VCACLLE0AH210866	5VCACDLE5AH210917
5VCACRJF9AH210797	5VCACLKF2AH210832	5VCACLLE2AH210867	5VCACDKF4AH210918
5VCACRJF0AH210798	5VCACLKF4AH210833	5VCACLLE4AH210868	5VCACDKF6AH210919
5VCACRJF2AH210799	5VCACLKF6AH210834	5VCACLLE6AH210869	5VCACDKF2AH210920
5VCACRJF5AH210800	5VCACLKF8AH210835	5VCACLLE2AH210870	5VCACDKF4AH210921

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1002**  
**NHTSA RECALL 10V-046**

**March, 2010**

## **ACX Model Vehicles affected by VIN**

**Affected vehicles sorted by last six (6) digits of VIN, in ascending order from top to bottom.**

5VCACDKF6AH210922	5VCACLKF2AH210975	5VCACLKF8AH211113	5VCA3DKF0AH211211
5VCACDKF8AH210923	5VCACLKF4AH210976	5VCACLKFXAH211114	5VCACRLE2AH211214
5VCACDKFXAH210924	5VCACLKF6AH210977	5VCACLKF1AH211115	5VCACRLE4AH211215
5VCACSKF6AH210925	5VCACLKF8AH210978	5VCACLKF3AH211116	5VCACRLE6AH211216
5VCACSKF8AH210926	5VCACLKFXAH210979	5VCACRKF1AH211117	5VCACRLE8AH211217
5VCACSKFXAH210927	5VCACLKF6AH210980	5VCACRKF3AH211118	5VCACRLEXAH211218
5VCACLKF7AH210938	5VCACLKF8AH210981	5VCACLKF9AH211119	5VCACRLE1AH211219
5VCACRKF9AH210944	5VCACDKF8AH210985	5VCACLKF5AH211120	5VCACRLE8AH211220
5VCACSLE4AH210945	5VCACDKFXAH210986	5VCACRKF0AH211125	5VCACRLEXAH211221
5VCACSLE6AH210946	5VCACDKF1AH210987	5VCACRKF2AH211126	5VCA3DKF5AH211222
5VCACSLE8AH210947	5VCACDKF3AH210988	5VCACRKF4AH211127	5VCA3DKF7AH211223
5VCACSLEXAH210948	5VCACDKF5AH210989	5VCACDKF2AH211128	5VCA3DKF9AH211224
5VCACSLE1AH210949	5VCACDKF1AH210990	5VCACDKF4AH211129	5VCA3DKF0AH211225
5VCACSLE8AH210950	5VCACDKF3AH210991	5VCACDKF0AH211130	5VCA3DKF2AH211226
5VCACSLEXAH210951	5VCACDKF5AH210992	5VCACDKF2AH211131	5VCACLLE4AH211227
5VCACSLE1AH210952	5VCACDKF7AH210993	5VCACSLE2AH211155	5VCACLLE6AH211228
5VCACSLE3AH210953	5VCACDLEXAH211027	5VCACLKF4AH211156	5VCACLLE8AH211229
5VCACSLE5AH210954	5VCACDLE1AH211028	5VCACLKF6AH211157	5VCACLLE4AH211230
5VCACSLE7AH210955	5VCACDLE3AH211029	5VCACLKF8AH211158	5VCACLKF3AH211231
5VCACSLE9AH210956	5VCACDLEXAH211030	5VCACLKFXAH211159	5VCACLKF5AH211232
5VCACSLE0AH210957	5VCACDLE1AH211031	5VCACLKF6AH211160	5VCACLKF7AH211233
5VCACSLE2AH210958	5VCACDLE3AH211032	5VCACRKF4AH211161	5VCACS6F3AH211234
5VCACSLE4AH210959	5VCACDLE5AH211033	5VCA3RKF6AH211162	5VCA3RKF0AH211237
5VCACSLE0AH210960	5VCACDLE7AH211034	5VCACLKF5AH211165	5VCACSKF3AH211238
5VCACSLE2AH210961	5VCACDLE9AH211035	5VCACDKF9AH211188	5VCACLLE0AH211239
5VCACSLE4AH210962	5VCACDKF4AH211096	5VCACLKF4AH211190	5VCACLLE7AH211240
5VCACSLE6AH210963	5VCACDKF6AH211097	5VCACLKF8AH211192	5VCACLLE9AH211241
5VCACSLE8AH210964	5VCACDKF8AH211098	5VCACDKF2AH211193	
5VCACSLEXAH210965	5VCACDKFXAH211099	5VCACSKF9AH211194	
5VCACSLE1AH210966	5VCACDKF2AH211100	5VCACSKF0AH211195	
5VCACSLE3AH210967	5VCACLKF3AH211102	5VCACRKH5AH211199	
5VCACSLE5AH210968	5VCACLKF5AH211103	5VCA3DKF9AH211207	
5VCACLKF7AH210972	5VCACLKF7AH211104	5VCA3DKF0AH211208	
5VCACLKF9AH210973	5VCACLKF9AH211105	5VCA3DKF2AH211209	
5VCACLKF0AH210974	5VCACLKF6AH211112	5VCA3DKF9AH211210	

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346  
www.autocartruck.com



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.