



SAFETY
CAMPAIGN

SPORT BOATS
WARRANTY
Bulletin



⚠ WARNING: All involved customers must be notified, all involved units must be corrected as per instructions herein.

Campaign no.: 2007-0008
2008-0006
2009-0001

May 14, 2010

Subject: **Trailer Brakes Incorrectly Bled**

No. **2009-1**

MODEL (YEAR)	MODEL NUMBER	SERIAL NUMBERS
150 Speedster (2009) 180 Challenger [†] (2009) 200 Speedster (2007 to 2009) 200 WAKE (2007 to 2009) 205 Utopia (2007 to 2009) 230 Challenger (2007 to 2009) 230 WAKE (2007 to 2009) Islandia (2007 to 2008)	See attached list	See attached lists ⁽¹⁾

⁽¹⁾ Validate if the trailer is included in the SERIAL NUMBER LISTING OF INVOLVED TRAILERS

NOTE: For international market: If the trailer brake system was modified to meet local requirements this recall does not apply. If you need assistance in order to determine if this recall is applicable, contact your local service office.


PROBLEM

Trailer braking system may not have been properly bled at factory. If braking efficiency is affected, it could lead in longer braking distances and possibly result in a vehicle crash possibly resulting in injury or death.

SOLUTION

Bleed trailer braking system as per provided procedure.

SPECIAL TOOLS REQUIRED

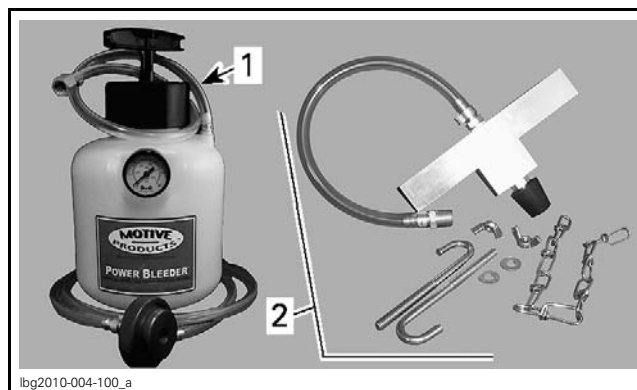

TOOLS		PART NUMBER	QTY
Item #1	Brake bleeder tank	529 036 195	1
Item #2	UFP bleeder accessory	529 036 196	1

Challenger[†] is a trademark of Bombardier Inc. used under license.

PRODUCT REQUIRED

PRODUCT	QTY
BRAKE FLUID (P/N 293 600 131)	2

PROCEDURES

Use your brake bleeder tank only as directed. Read these directions completely before starting. The brake bleeder tank is intended for use only by individuals experienced with bleeding and servicing hydraulic systems. If you are unsure about your ability or experience, consult a trained professional.

WARNING

Hydraulic fluid is hazardous. Read and follow fluid manufacturer's warnings. Always wear safety goggles when working with hydraulic fluid.

NOTICE Hydraulic fluid is corrosive and may damage painted finish or other surfaces. If fluid spills, wipe off and flush with water immediately.

Trailer Preparation


1. Position the trailer on a firm, level surface.
2. Immobilize trailer with wheel blocks to prevent accidental movements.
3. Detach trailer from the tow vehicle.
4. Using the trailer jack, lower the tongue as much as possible.

NOTE: Brake system bleeding is helpful if the actuator is lower than brake calipers.

5. Make sure trailer brake lines are properly secured and are not damaged.


Tools Installation

1. Install the UFP bleeder kit (P/N 529 036 196) to actuator.
 - 1.1 Install both hook bolts on actuator adapter using washers and wing nuts.

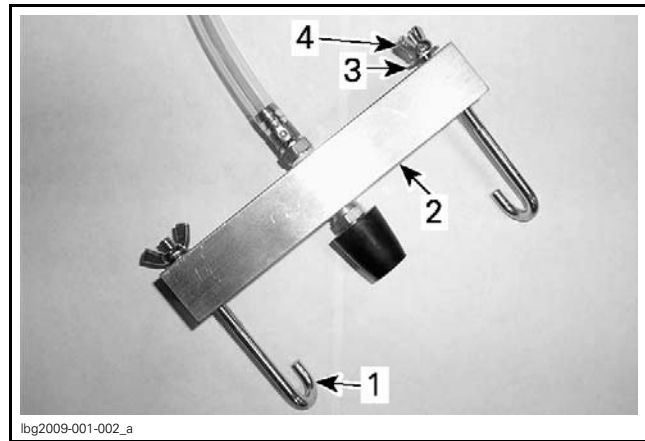


1. Hook bolt
2. Actuator adapter
3. Washer
4. Wing nut

- 1.2 Install the actuator adapter over the actuator.

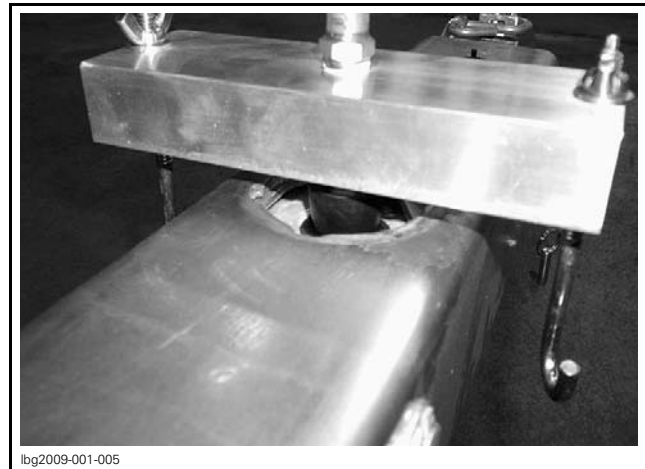


- 1.3 Using hook bolts, secure the chain under the tongue.

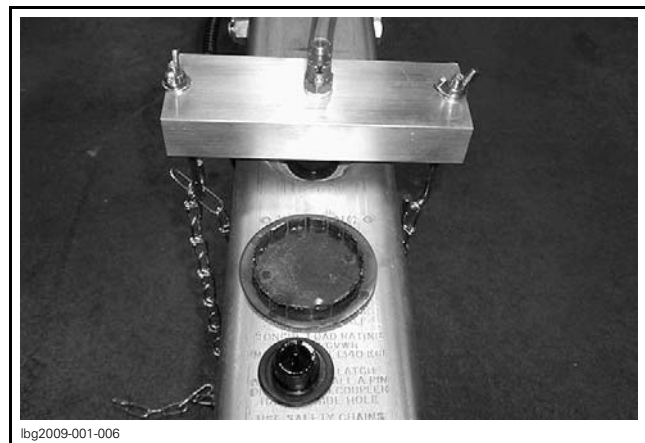

- 1.4 Tighten wing nuts to secure the actuator adapter on the actuator.
- 1.5 Ensure that actuator adapter rubber seats properly.

NOTE: If the actuator adapter is too loose, it will not make a good seal and will leak fluid when bleeding the brake system. Do not overtighten.

2. Connect hose from actuator adapter to the brake bleeder tank hose.

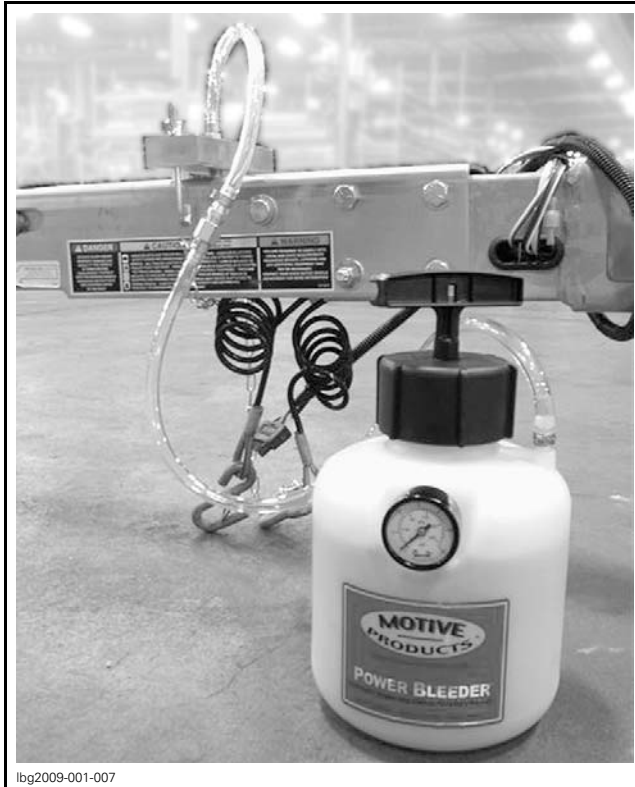

3. Ensure that brake bleeder tank is clean and free of debris, old hydraulic fluid, or any cleaners or solvents.
4. Pressurize the brake bleeder tank to 69 kPa (10 PSI).
5. Check for leaks at actuator adapter and at hoses connections.
 - 5.1 If a leak is detected, release accumulated pressure in brake bleeder tank by gently unscrewing the tank cap.

NOTE: Do not remove actuator adapter before depressurizing brake bleeder tank.
 - 5.2 Reposition and tighten the actuator adapter or tighten hoses connections.
 - 5.3 Once again pump the brake bleeder tank to 69 kPa (10 PSI) and check for leaks.
6. If no leaks are found, unscrew brake bleeder tank cap and add the brake fluid in tank.

NOTICE Use brake fluid from a sealed container. Never reuse old fluid, as it contain contaminants and water moisture.

7. Tighten the brake bleeder tank cap.

8. Pressurize the brake bleeder tank to 103 kPa (15 PSI). Do not exceed 124 kPa (18 PSI).

NOTICE Exceeding 124 kPa (18 PSI) will damage the diaphragm in the master cylinder causing it to leak.

Bleeding Procedure

1. Start bleeding with the wheel at the end of the brake line (the farthest point from actuator).

NOTE: If trailer has tandem brake axles, start bleeding on the rear axle.

2. At the brake caliper, connect a clear hose to the bleeder screw located on the top of the caliper and place free end of hose in a suitable container.
3. Loosen bleeder screw one turn. When fluid runs clear and free of bubbles for at least 3 seconds, close bleeder screw securely and remove bleeder hose.

NOTE: Make sure to maintain adequate pressure in brake bleeder tank at all time.

4. Repeat bleeding process for the other brake caliper(s).

NOTE: On trailer with tandem brake axles, complete the bleeding process on front axle then repeat the process on the rear axle brakes for a second time to assure positive purging of all air from system.

5. When bleeding is completed, release pressure by slowly loosening brake bleeder tank cap.
6. Raise the front of the trailer to a level or above level position to eliminate any brake fluid escaping from the master cylinder reservoir.
7. Remove the actuator adapter, taking care to avoid spilling any fluid that remains in its hose.
8. Check fluid level.
 - Proper fluid level is when the fluid in the reservoir just touches the end of the dipstick on the fill plug when it is fully inserted into the fill hole.
 - Not enough fluid in the reservoir will cause the reservoir to run dry as the brake pads wear.
 - Too much fluid will cause an overflow situation when the solenoid valve is energized during backing up.
9. Wipe off any brake fluid spillage on the top of the reservoir or actuator body.

Braking System Verification

Proper bleeding of braking system can be checked by backing up the trailer without energizing the solenoid valve and verify the brakes are working.

If brakes are not working properly, there is still air in the brake system and the system will have to be bled again.

Check for leaks at all fittings and connections. Tighten or correct as required.

Brake Bleeder Tank Storage and Maintenance

Never store hydraulic fluid in the brake bleeder tank. Dispose brake fluid as per your local environmental regulations.

Do not clean your brake bleeder tank with brake parts cleaners or other solvents not intended for use with plastic components.

Lubrication of the brake bleeder pump mechanism should not normally be necessary. Should lubrication be required, apply a small amount of brake fluid compatible grease to the brake bleeder pump shaft. Never lubricate with petroleum-based oils.

WARRANTY

Submit a warranty claim using the following information:

CAMPAIGN NUMBER	2007-0008
Claim Type	Campaign claim
Action	Repair
Flat Rate Time	Single Brake: 0.6 hour Tandem Brake: 1 hour

CAMPAIGN NUMBER	2008-0006
Claim Type	Campaign claim
Action	Repair
Flat Rate Time	Single Brake: 0.6 hour Tandem Brake: 1 hour

CAMPAIGN NUMBER	2009-0001
Claim Type	Campaign claim
Action	Repair
Flat Rate Time	Single Brake: 0.6 hour Tandem Brake: 1 hour

For claiming procedure, refer to the *DEALER/DISTRIBUTOR WARRANTY GUIDE*.

NOTE: Dealers/distributors are not required to return parts to support their claims.

How to Handle Serial Numbers

In BOSSWeb, when you have reached the "Claim Detail - Unit Identification" screen:

1. Type the Boat Serial Number.
2. Type the Repair Date.
3. Check the Repair box.
4. Hit the verification button (a status error will occur: ERROR 1038 SERIAL NO. PROD. CODE MISSING).

lbq2009-001-003_a

1. Boat serial number
2. Repair date
3. Repair box
4. Verification button

5. In the box for Old Serial No., enter **KARAVAN**.

6. In the box for New Serial No., enter the trailer 17 digits serial number starting by 5KBTS.

lbq2009-001-001_a

TRAILER SERIAL NUMBER DECAL

1. Trailer serial number

Then submit your claim by clicking on the **SEND** arrow.

lbq2009-001-004_a

1. Old serial no., enter **KARAVAN**
2. New serial no., enter the trailer 17 digits serial number starting by **5KBTS**
3. Send arrow

NOTE: If parts are required or if other repairs have to be done, contact **Karavan Trailers** (make sure to have boat and trailer serial numbers in hand while calling):

By Phone: 920-928-6200, ext. 228

By fax: 920-928-6201

By E-mail: Diana.stock@karavantrailers.com

SERIAL NUMBER LISTING OF 2007 INVOLVED BOATS

Model: 757A

From 025500 to 025585
From 025600 to 025645
From 025650 to 025692

Model: 757B

From 026000 to 026008
From 026010 to 026050
From 026056 to 026067
From 026073 to 026085

Model: 757C

From 025586 to 025591
From 025593 to 025599
From 025646 to 025649
From 025693 to 025696

Model: 757D

From 026051 to 026055
From 026068 to 026072
From 026086 to 026089

Model: 757E

From 027000 to 027157

Model: 757H

From 028500 to 028543

Model: 777A

From 024500 to 024528
From 024531 to 024534
From 024536 to 024549

Model: 777B

From 025000 to 025004

Model: 777C

From 024529 to 024530
024535

Model: 777E

From 026500 to 026505

Model: 777F

From 024000 to 024014

Model: 777H

027501

Model: 847A

From 023500 to 023706

Model: 857A

From 016502 to 016507
From 016542 to 016565
From 016567 to 016590
From 016619 to 016642
From 016662 to 016680

Model: 857A (cont'd)

From 016688 to 016689
From 016709 to 016718
From 016720 to 016732
From 016746 to 016792
From 016808 to 016837
From 016864 to 016889
From 016927 to 016943

Model: 857B

016719
From 017502 to 017503
From 017511 to 017523
From 017530 to 017539
From 017545 to 017550
From 017560 to 017561
From 017573 to 017594
From 017597 to 017611
From 017621 to 017622
From 017628 to 017635
017643

Model: 857C

From 016500 to 016501
From 016508 to 016541
016566
From 016591 to 016618
From 016643 to 016661
From 016681 to 016687
From 016690 to 016708
From 016733 to 016745
From 016793 to 016807
From 016838 to 016863
From 016890 to 016926
017542

Model: 857D

From 017500 to 017501
From 017504 to 017510
From 017524 to 017529
From 017540 to 017541
From 017543 to 017544
From 017551 to 017559
From 017562 to 017572
From 017595 to 017596
From 017612 to 017620
From 017623 to 017627
From 017636 to 017642

Model: 857E

From 018000 to 018189

Model: 887A

From 022500 to 022526
From 022533 to 022552
022556

Model: 887A (cont'd)

From 022560 to 022578
From 022583 to 022603
From 022612 to 022646
From 022657 to 022671
From 022679 to 022695
From 022707 to 022750
From 022757 to 022769

Model: 887B

From 022527 to 022532
From 022553 to 022555
From 022557 to 022559
From 022579 to 022582
From 022604 to 022611
From 022647 to 022656
From 022672 to 022678
From 022696 to 022706
From 022751 to 022756
022770

Model: 897A

From 022000 to 022084

Model: 967A

From 015002 to 015003
From 015013 to 015022
From 015031 to 015034
From 015048 to 015049
From 015051 to 015053
From 015057 to 015060
015064
From 015068 to 015070
From 015076 to 015078

Model: 967B

From 015505 to 015511
From 015518 to 015521

Model: 967C

From 015000 to 015001
From 015004 to 015012
From 015023 to 015030
From 015035 to 015047
015050
From 015054 to 015056
From 015061 to 015063
From 015065 to 015067
From 015071 to 015075

Model: 967D

From 015500 to 015504
From 015512 to 015516

Model: 967E

From 016000 to 016021

SERIAL NUMBER LISTING OF 2008 INVOLVED BOATS

Model: 758A

From 025500 to 025521
From 025536 to 025601
From 025620 to 025643
From 025652 to 025678
From 025692 to 025724
From 025733 to 025753
From 025760 to 025771
From 025773 to 025786
From 025798 to 025833
From 025840 to 025847
025855

Model: 758B

From 026000 to 026006
From 026012 to 026048
From 026051 to 026067
From 026079 to 026087
From 026093 to 026099
From 026101 to 026113
From 026116 to 026125
026128

Model: 758C

From 028500 to 028526
From 028535 to 028540
From 028543 to 028545
From 028547 to 028549
028552
From 028555 to 028563
From 028567 to 028570
From 028575 to 028577

Model: 758D

From 029000 to 029011
From 029017 to 029020
From 029022 to 029025
From 029028 to 029031
From 029035 to 029036
From 029038 to 029041

Model: 758E

From 027000 to 027251

Model: 758H

From 030000 to 030169

Model: 758J

From 025522 to 025535
From 025602 to 025619
From 025644 to 025651
From 025679 to 025691
From 025725 to 025732
From 025754 to 025759
From 025787 to 025797
From 025834 to 025839
From 025849 to 025854

Model: 758K

From 026007 to 026011
From 026049 to 026050
From 026068 to 026078
From 026088 to 026092
026100
From 026114 to 026115
From 026126 to 026127

Model: 758L

From 028527 to 028534
From 028541 to 028542
028546
From 028550 to 028551
From 028553 to 028554
From 028564 to 028566
From 028571 to 028574
028579

Model: 758M

From 029012 to 029016
029021
From 029026 to 029027
From 029032 to 029034
029037

Model: 778A

From 024500 to 024503
From 024509 to 024515
From 024517 to 024521
From 024523 to 024524
From 024526 to 024536
From 024538 to 024542

Model: 778B

025000
From 025002 to 025006
025008

Model: 778C

From 027500 to 027504

Model: 778D

028000

Model: 778E

From 026500 to 026503
From 026507 to 026508

Model: 778F

From 024000 to 024004
From 024007 to 024021

Model: 778G

024005

Model: 778H

From 029500 to 029505

Model: 778J

From 024504 to 024508
024516
024522
024525
024537
024543

Model: 778K

025001

Model: 778L

027505
027508

Model: 778M

028001

Model: 808A

From 021000 to 021003
From 021007 to 021016
From 021022 to 021046
From 021055 to 021071
From 021078 to 021086
From 021096 to 021114
From 021123 to 021135
From 021142 to 021144

Model: 808B

From 021004 to 021006
From 021017 to 021021
From 021047 to 021054
From 021072 to 021077
From 021087 to 021095
From 021115 to 021122
From 021136 to 021141
From 021145 to 021146

Model: 838A

From 023500 to 023673

Model: 858A

From 016500 to 016505
From 016513 to 016530
From 016550 to 016553
From 016555 to 016588
From 016617 to 016644
From 016662 to 016679
From 016701 to 016727
From 016752 to 016773
From 016799 to 016814
From 016843 to 016868
From 016897 to 016930
From 016951 to 016969

Model: 858B

From 017500 to 017502
From 017506 to 017515
From 017526 to 017534
From 017552 to 017570
From 017572 to 017577
From 017590 to 017599
From 017611 to 017620
From 017629 to 017635
From 017645 to 017652
From 017655 to 017660

Model: 858C

From 016506 to 016512
From 016531 to 016549
016554
From 016589 to 016616
From 016645 to 016661
From 016680 to 016700
From 016728 to 016751
From 016774 to 016798
From 016815 to 016842
From 016869 to 016896
From 016931 to 016950
From 016970 to 016976

Model: 858D

From 017503 to 017505
From 017516 to 017525
From 017535 to 017551
017571
From 017578 to 017589
From 017600 to 017610
From 017621 to 017628
From 017636 to 017644
From 017653 to 017654
From 017661 to 017663

Model: 858E

From 018000 to 018166
From 018169 to 018170

Model: 888A

From 022500 to 022507
From 022514 to 022552
From 022557 to 022570
From 022572 to 022578
From 022580 to 022584
From 022587 to 022599
From 022603 to 022615
022624

Model: 888B

From 022508 to 022513
From 022553 to 022556
022571
022579
From 022585 to 022586

Model: 888B (cont'd)

From 022600 to 022602
From 022616 to 022622

Model: 898A

From 022000 to 022033
022035

Model: 968A

From 015000 to 015001
From 015003 to 015006
From 015011 to 015014
From 015024 to 015025
From 015029 to 015031
From 015039 to 015040
From 015045 to 015046
From 015053 to 015055
015059

Model: 968B

From 015500 to 015501
015504
From 015506 to 015507
From 015515 to 015516
015518

Model: 968C

015002
From 015007 to 015010
From 015015 to 015023
From 015026 to 015028
From 015032 to 015038
From 015041 to 015044
From 015047 to 015052
From 015056 to 015058
015062

Model: 968D

From 015502 to 015503
015505
From 015508 to 015513

Model: 968E

From 016000 to 016023

SERIAL NUMBER LISTING OF 2009 INVOLVED BOATS

Model: 699A

From 016000 to 016003
From 016009 to 016012
From 016015 to 016031
From 016052 to 016076
From 016104 to 016109

Model: 699B

From 017000 to 017001
From 017004 to 017013
From 017032 to 017036
From 017045 to 017047

Model: 699C

From 016004 to 016008
From 016013 to 016014
From 016032 to 016051
From 016077 to 016103
From 016110 to 016146

Model: 699D

From 017002 to 017003
From 017016 to 017031
From 017037 to 017044
From 017048 to 017069

Model: 699W

From 015500 to 015540

Model: 779A

022000
022002
From 022004 to 022006
022008
From 022010 to 022013
From 022021 to 022023
From 022026 to 022027

Model: 779B

022001
022003
022007
022009
From 022015 to 022020

Model: 779N

From 022250 to 022260

Model: 779P

022261

Model: 789A

024000
From 024002 to 024004
From 024008 to 024009
From 024012 to 024016
From 024019 to 024021
From 024030 to 024036

Model: 789A (cont'd)

From 024042 to 024043
024048

Model: 789B

From 024500 to 024501
From 024503 to 024504
024506
024509
024513
From 024516 to 024520

Model: 789C

028000

Model: 789D

028500

Model: 789E

024001
From 024005 to 024007
From 024010 to 024011
From 024017 to 024018
From 024022 to 024029
From 024037 to 024041
From 024044 to 024047
024050

Model: 789F

024502
024505
From 024507 to 024508
From 024510 to 024512
From 024514 to 024515
024521

Model: 789N

From 022503 to 022510
From 022512 to 022516
From 022518 to 022529
From 022531 to 022541
From 022544 to 022554

Model: 789P

From 022500 to 022502
From 022542 to 022543

Model: 789W

From 025500 to 025526

Model: 789X

From 026500 to 026502

Model: 799A

023001
From 023004 to 023009
From 023014 to 023018
From 023021 to 023028

Model: 799A (cont'd)

From 023033 to 023037
From 023044 to 023051
From 023056 to 023064
From 023072 to 023079

Model: 799B

From 023500 to 023501
From 023503 to 023506
From 023509 to 023511
From 023519 to 023525
From 023529 to 023537
023544

Model: 799C

From 027000 to 027001
From 027003 to 027004
From 027008 to 027010
From 027016 to 027018
From 027023 to 027027

Model: 799D

From 027500 to 027501
027505
027507
027510

Model: 799E

From 023002 to 023003
From 023010 to 023013
From 023019 to 023020
From 023029 to 023032
From 023038 to 023041
From 023052 to 023055
From 023065 to 023071
From 023082 to 023087

Model: 799F

023502
From 023507 to 023508
From 023512 to 023518
From 023526 to 023528
From 023538 to 023543

Model: 799G

027002
From 027005 to 027007
From 027012 to 027014
From 027019 to 027022
From 027028 to 027031

Model: 799H

From 027502 to 027504
027506
From 027508 to 027509
027511

Model: 799W

From 025000 to 025049
From 025051 to 025095

Model: 799X

From 026000 to 026078

Model: 839A

From 021500 to 021523

Model: 869A

017518
From 017548 to 017549
017580

Model: 869B

018506
018522

Model: 869C

017509
From 017561 to 017562
017564
017590
017610

Model: 869F

019010

Model: 879A

019529
From 019534 to 019535
019639
019643
019648
From 019667 to 019668
019726
019729
From 019746 to 019747
019803
019805
019816
019880
019882

Model: 879B

From 020515 to 020516
020519
020521
020541
020585
020592
020595
020599
020632
020634
020670
020677

Model: 879C

019548
From 019554 to 019555
019606
019624
019633
From 019681 to 019682
From 019687 to 019688
019691
019696
019701
019714
019717
019759
019835
019863
019896

Model: 879D

020507
020527
From 020529 to 020532
020534
020560
020564
020572
020574
020577
020605
020607
020614
020623
020643
020645
020655
020683
020723
020726

Model: 889A

021250
From 021252 to 021256
021259
From 021261 to 021263
From 021267 to 021274
From 021280 to 021285
From 021288 to 021297
From 021300 to 021302

Model: 889B

021251
From 021257 to 021258
021260
From 021264 to 021266
From 021275 to 021278
From 021286 to 021287
021298

Model: 899A

From 021000 to 021002
From 021004 to 021007
021011
From 021013 to 021028
From 021032 to 021034
From 021040 to 021043
From 021048 to 021049

Model: 899B

021003
From 021008 to 021010
021012
From 021029 to 021031
From 021036 to 021039
From 021044 to 021047
From 021050 to 021053

Model: 979A

011184

Model: 979C

011203

Model: 989A

012544
012557

Model: 989C

From 012522 to 012524
012566
From 012569 to 012570
012572
012584
012603

Model: 989D

From 013531 to 013532

Model: 999A

From 014046 to 014047
014080
014169
From 014181 to 014182
014188
014191
014255
014283
014357

Model: 999B

015005
015017
From 015021 to 015022
015030
015055
015082
From 015128 to 015129
015132
015177

Model: 999B (cont'd)

015185

015219

From 015259 to 015260

Model: 999C

From 014054 to 014055

014065

014068

014073

From 014117 to 014118

From 014161 to 014162

014206

014210

014215

014268

From 014323 to 014324

Model: 999D

015037

From 015046 to 015047

015086

015090

015100

015119

From 015146 to 015148

015150

015152

From 015155 to 015157

015193

From 015221 to 015222

015230

015238

015251

015279

SAFETY RECALL NOTICE

**Bombardier Recreational Products Inc.**

565 de la Montagne Street
Valcourt, Québec, Canada J0E 2L0
T 450.532.2211 F 450.532.5133

www.brp.com

Date: May 14, 2010

Re: Trailer Brakes Incorrectly Bled

Dear Sea-Doo® Sport Boats Owner,

This notice is being sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act, the Canada Motor Vehicle Safety Act and other applicable laws. Bombardier Recreational Products Inc. and BRP US Inc. ("BRP") have decided that a defect exist in certain Karavan trailers delivered with Sea-Doo Sport Boats.

What is the potential problem?

Trailer braking system may not have been properly bled at factory. If braking efficiency is affected, it could lead in longer braking distances and possibly result in a vehicle crash possibly resulting in injury or death.

Which Sea-Doo Sport Boat Models are Involved?

Model	Model Year	Model	Model Year
- 150 Speedster	2009	- 205 Utopia	2007 to 2009
- 180 Challenger	2009	- 230 Challenger	2007 to 2009
- 200 Speedster	2007 to 2009	- 230 Wake	2007 to 2009
- 200 Wake	2007 to 2009	- Islandia	2007 to 2008

What should you do?

Call an authorized BRP Sea-Doo Sport Boats dealer and make an appointment to have your trailer repaired. We will bleed the trailer braking system. *The dealer will perform this work at no charge to you.*

What to do if you feel this notice is an error?

This notice was mailed to you according to the most current information we have available. If you no longer own this trailer or some information in this notice is incorrect, please contact BRP at your earliest convenience.

For US residents only

If you believe that the dealer or BRP has failed or is unable to remedy the problem within a reasonable time, you may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue S.E. Washington, D.C. 20590, or call the toll free Auto Safety Hot Line at 1-888-327-4236 (TTY: 1-800-424-9153), or go to <http://www.safercar.gov>.

For Canadian residents only

If you believe that the notification or correction is inadequate, that the manufacturer fails to correct the situation in accordance with the notification or it fails or is unable to correct the situation within 60 days, you may submit a complaint to the Road Safety and Motor Vehicle Regulation Directorate of Transport Canada at 1-800-333-0510.

If you have questions, need assistance, or to find the nearest authorized BRP Sea-Doo Sport Boats dealer:

• Visit www.sea-doo.com

• In the US and Canada: 1-888-638-5397, 8:00 to 18:00 Eastern time

We apologize for any inconvenience this may cause you. Thank you for your immediate attention to this matter.

Sincerely,
After-Sales Service Department,
Bombardier Recreational Products Inc.

Ski-Doo
Lynx
Sea-Doo
Evinrude
Johnson
Rotax
Can-Am