



INSTRUCTIONS TO PERFORM CAMPAIGN 116

Models Affected:

- Certain 2010 model year Winnebago View®/View Profile® and Itasca Navion®/NavioniQ® motor homes.

These motor homes were manufactured from April 27, 2009 through January 21, 2010.

Tools Required:

- Torque Wrench
- T-50 Socket

Kit Includes:

- (2) Bolts
- Instructions

Procedure:

Verify driver and passenger cab outboard seat bolt installation and torque to specification.

1. Remove bolt cover from outboard side of cab seat. See Photo A.
NOTE: In some models, the seat belt may be attached to the seat.



2. Assure seat bolt is present. See Photo B. If seat bolt is present, torque to 37+/-3 ft./lbs. and proceed to Step 4. If seat bolt is not present, continue with Step 3.



3. Install seat bolt and torque to 37+ / -3 ft./lbs.
4. Reinstall bolt cover.
5. Repeat Steps 1 through 4 on second cab seat.