

Retail Operator General Manager	Sales New Motorcycles	Sales Pre-Owned Motorcycles	Business Manager (F&I)	Service	Parts & Accessories	Administration
Date: September 2010	Source: SI 31/2010					
Bulletin # 11 004 10 (051)	Name: Shawn McLean					
	Title: Service & Technical Manager					
	Phone: 201-307-4131					



**BMW Motorrad
USA
Service Information Bulletin**

****Notice of recall 10V-328****

Subject: Retrofitting Arrester Cables for Left Siren Speaker

Model: R 1200 RT-P (K26, 0388) with option code 0113 Authority equipment package.

Details: Under extreme dynamic loading when the motorcycle is being ridden, the bracket of the siren loudspeaker on the left protection bar can break. In order to keep the siren speaker safely attached to the motorcycle if the bracket breaks, 2 arrester cables are attached to the siren speaker and the left protection bar.

Motorcycles affected: This affects only R 1200 RT-P (K26, 0388) models fitted with option code 0113 Authority equipment package. In order to determine if a specific motorcycle is affected by this Recall Campaign, it will be necessary to verify all motorcycle VINs through a DCS Vehicle History Check. Based on the response of the system, either proceed with the repair or take no further action. Please note, affected VINs may not appear until 24-48 hours after the release of this bulletin.

NHTSA Statement: Under the National Traffic and Motor Vehicle Safety Act of 1966, as amended, if there has been a recall campaign, dealers must assure that all new vehicles and new items of replacement equipment are free of safety defects and comply with all applicable Federal Motor Vehicle Safety Standards at the time of delivery to the consumer. This means that dealers may not deliver new motor vehicles or new items of replacement equipment to consumers unless the safety defect or noncompliance has been remedied before delivery.

Production Solution: The Authority units built in the future will be fitted with protection bars (left and right) of a new stronger siren speaker bracket design.


Aftersales Solution: The work stipulated for this technical campaign (see following work item 00 60 231) is to be completed the next time a verified affected motorcycle is in the workshop. In the case of motorcycles still on your premises, you are to undertake the work involved before delivery to the customer.

Note: If a different arrester cable has already been retrofitted, it must be removed and the two new arrester cables fitted.

Work item: 00 60 231 Installing arrester cables.

Securing siren speaker with arrester cables:

- Remove nuts (1).
- Hold arrester cable (2) in position and locate it with nuts (1).
- Remove nuts (3).
- Hold arrester cable (4) in position and locate it with nuts (3).
- Tighten nuts (1) and (3) alternately.

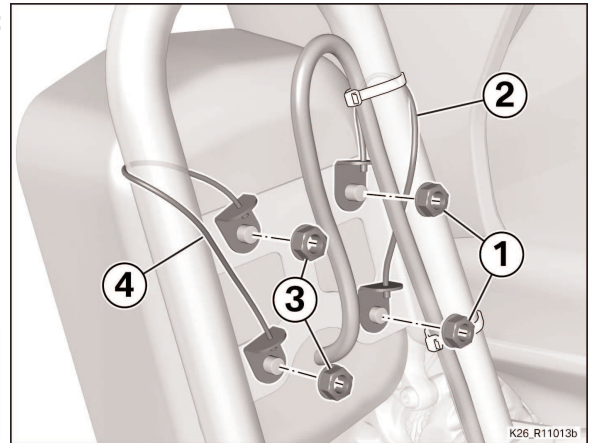

Tightening torques	
Siren speaker to protection bar	
1/4" - 20 UNC	8 Nm

Because of the nature of how the speaker will settle into place, it is necessary to apply the torque sequence 4 times.

Finishing work: Final check of work performed.

Warranty: The repair described in this bulletin is covered under warranty regardless of time or mileage. Reimbursement for this recall will be via normal claim entry utilizing the following information:

Warranty Information:	Defect code:	00 00 11 19 00	Retrofit, arrester cables for left siren speaker
	FRU code:	00 60 231	Installing arrester cables, 5 FRUs
	Part number:	11 84 7 717 666	Arrester cables for siren speaker (each contains 2 cables, enough for 1 motorcycle)

Contact: Service and Technical Manager