



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
NHTSA Recall 10V-363

August, 2010

## Attention

Service Managers / Parts Managers

## Subject

Ignition Relay Replacement

## Service Recall Information

Autocar has identified a defect in ignition relay for 2008 and 2009 model-year ACX model heavy-duty class 8 vehicles. Water intrusion in the ignition relay of the affected vehicles may lead to corrosion, which may short-circuit the relay causing the part to fail. Failure of the relay could cause the engine to shut down without warning or fail to start.

## Vehicles Affected

There are 2,184 affected vehicles that were manufactured between 30 November 2007 and 28 July 2010, with serial numbers in the range 206732 through 211912. Refer to the VIN list beginning on page 6.

## Prior Authorization Required

Dealers MUST call the Autocar Project Manager at 765-489-6016 to authorize and arrange the repairs. Autocar will not ship Service Parts Kits or accept reimbursement claims unless the repairs have been pre-authorized by the Autocar Project Manager.

## Claims for Reimbursement

Submit a claim in accordance with the instructions in the claim preparation section of the Warranty Administration Manual.

## Claim Coding Information

Labor Operation Code: 36401-0-28  
Time Allowance: 1.0 Hour

## Required Parts

### Relay Kit (S8721004K001)

Part Number	Description	Quantity
A8721040-001	Relay	1
S8721008K001	Harness Kit	1
A8721054-002	Harness	1
A8721055-002	Harness	1
A8721056-002	Harness	1
S8721009K001	Hardware Kit	1
940180	Screw 1/4 – 20 x 2.25	1
8030029	Washer 1/4 inch	1
3082745	Locknut 1/4 – 20	1

### To Order Parts:

**765-489-6016**

**765-489-1960**

### Main Number

**877-973-3486**

### Technical Support

**888-218-3611**

## Required Tools

- Wire stripping pliers
- Electric heat gun
- Wire crimper pliers
- 7/16" combination wrench
- Diagonal cutting pliers
- 3/8" drive torque wrench
- 3/8" drive ratchet
- 3/8" drive / 7/16" socket
- 3/8" drive / 9/16" socket
- 3/8" drive / 1/2" socket





# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
NHTSA Recall 10V-363

**August, 2010**

## Safety Notices

### **WARNING**

*Allow the vehicle's engine and cooling system to cool to ambient temperature before performing the repair procedure. A hot engine or cooling assembly may cause burns or other personal injury.*

### **DANGER**

*To prevent eye injury, always wear eye protection when performing vehicle maintenance, service or inspection.*



### **DANGER**

*Before working on a vehicle, set the parking brake, place the transmission in neutral and block the wheels. Failure to do so can result in unexpected vehicle movement and can cause serious personal injury or death.*



### **CAUTION**

#### **Lockout/Tagout Procedures**

Before entering the vehicle or vehicle body, read and follow OSHA regulations concerning entry and working in "CONFINED SPACE" OSHA 1910.146 and "LOCKOUT/TAGOUT" OSHA 1910.147. Follow OSHA regulations while performing any work on the vehicle. The vehicle must be disabled by the following steps before performing any work on the vehicle:

1. Place the transmission in NEUTRAL.
2. Set the parking brake.
3. Shut the engine OFF.
4. Lock cab doors, keep the key in your pocket. Block the wheels before entering the body or performing any work on the vehicle.
5. Turn the battery disconnect switch OFF.
6. Completely drain the air from the primary/A system and secondary/B system by opening the drain valves on the air tanks themselves or by using the drain manifold if supplied. When draining the air tanks, do not look into the area where air is draining. Dirt or sludge particles may be expelled in the air stream and can cause eye injury.
7. Place magnetic "DANGER" signs on both cab doors before entering the body or performing any work on the vehicle.
8. Take proper precautions before working under the vehicle. Use ramps approved for the weight of your vehicle, or use floor jacks and stands. Never work under a vehicle supported by jacks alone. Always use jack stands to support the vehicle.





## AUTOCAR SAFETY RECALL A-1003 NHTSA Recall 10V-363

August, 2010


### Replacement of Ignition Relay

1. Turn off the battery disconnect switch. If the vehicle is not equipped with a switch, disconnect the batteries.


### WARNING

*Disconnect the negative battery connections first to avoid possible arcing.*

2. Locate the ignition relay switch (brown) near the external fuse box (see *Figure 1* and *Figure 2*).

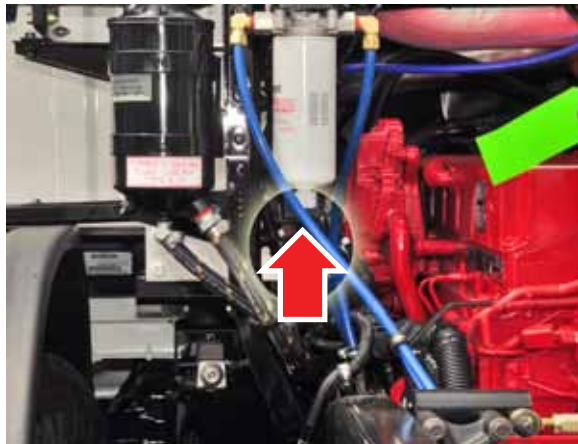


**Figure 1**

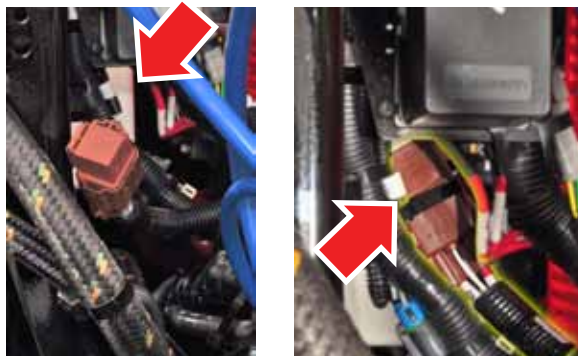


**Figure 2**

3. Peel back the wire loom to expose the wiring. Using diagonal cutting pliers, cut the four wires as close as possible to the existing ignition relay connector. Discard the relay and connector (see *Figure 3*).

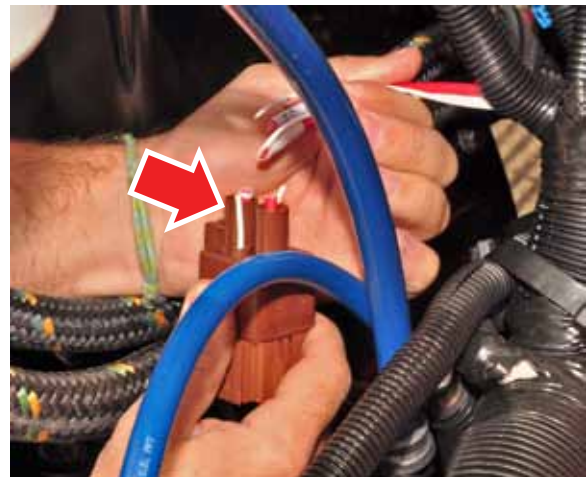

**Figure 3**

4. Using wire stripping pliers, strip away 1/4" (6.35 mm) of insulation from the four existing wires (see *Figure 4*).

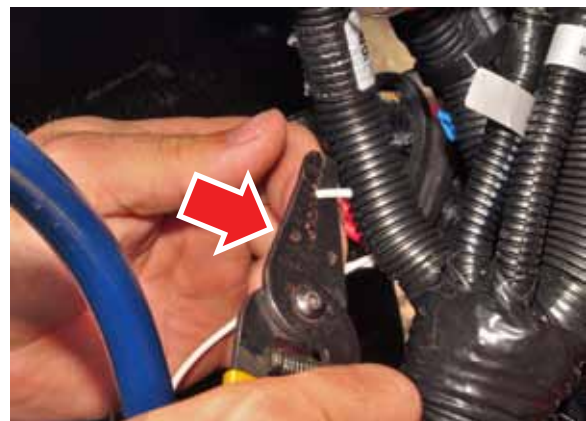

**Figure 4**






# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
NHTSA Recall 10V-363

August, 2010

5. Match the existing wire numbers to the corresponding wire numbers contained in the service kit.
6. Using wire crimper pliers, crimp the new wires to the existing wires. Using an electric heat gun, heat shrink the connections (see *Figure 5*).

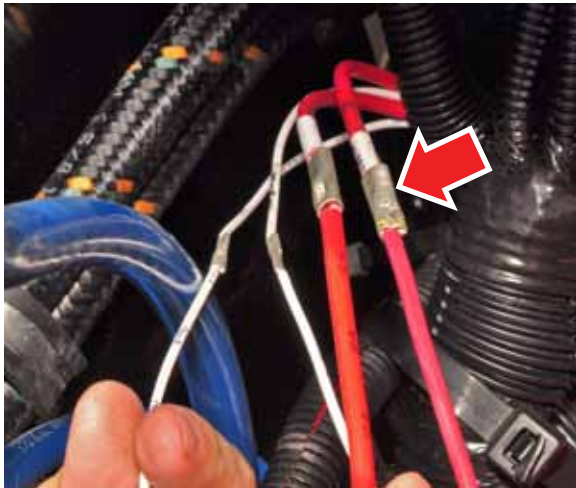

**Figure 5**

7. Align the new relay with the center hole on the upright in the left side of the truck (see *Figure 6*)



**Figure 6**

8. Using a 7/16" combination wrench w/7/16" socket, install the new relay with the 1/4" fastener supplied with the service kit and tighten to 9 Ft-Lbs (40 N-m) of torque. (see *Figure 6* and *Figure 7*).



**Figure 7**






# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
NHTSA Recall 10V-363


**August, 2010**

9. Install two electrical connectors into the relay (see *Figure 8*).
10. Using a 1/2" socket and torque wrench, attach the ring terminated wire (1 C-A) to the 5/16" threaded stud and tighten to 9 Ft-Lbs (40 N-m) of torque (see *Figure 8*).

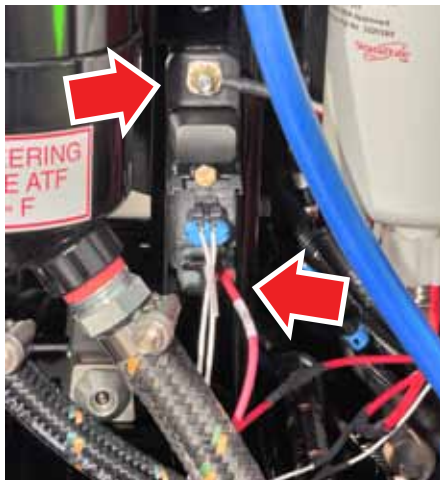

**Figure 8**

11. Reinstall wire loom and secure as required (see *Figure 9*).

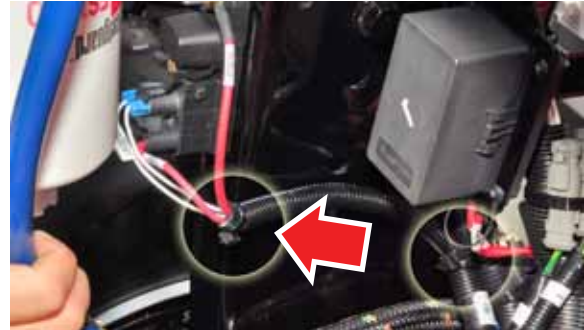

**Figure 9**

12. If the batteries were disconnected as part of step one, apply corrosion inhibitor as required. Using a 9/16" socket and torque wrench, install the battery cables and tighten to 14 Ft-Lbs (62 N-m) of torque.

## **WARNING**

**Install positive cables first to avoid arcing.**





# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACLKF88H206732	5VCACSKE98H207440	5VCACRLE88H207548	5VCACLLE19H207793
5VCACRJFX8H206817	5VCACSKE08H207441	5VCACLLE58H207584	5VCA3LHF99H207798
5VCACLJF78H206951	5VCACSKE28H207442	5VCACRLE38H207585	5VCACLKE09H207799
5VCACLJF58H207001	5VCACRLE98H207445	5VCACLJF68H207640	5VCACLKE39H207800
5VCACRJF68H207236	5VCACRLE08H207446	5VCACLJF69H207641	5VCACLKE59H207801
5VCACDJF08H207378	5VCACRLE28H207447	5VCA3LJF98H207650	5VCACLKE79H207802
5VCACLKF18H207379	5VCACRLE48H207448	5VCACLJF69H207655	5VCACLKE99H207803
5VCACLKF88H207380	5VCACRLE68H207449	5VCACLKFX9H207656	5VCACLKE09H207804
5VCACLKFX8H207381	5VCACRLE28H207450	5VCACLKF38H207674	5VCACLKE29H207805
5VCACLKF18H207382	5VCACRLE48H207451	5VCACLKF58H207675	5VCACLLE59H207814
5VCACLKF38H207383	5VCACRLE68H207452	5VCACLKF99H207678	5VCACLLE79H207815
5VCACLKF58H207384	5VCACRLE88H207453	5VCACLKF09H207679	5VCACLLE99H207816
5VCACLKF78H207385	5VCACRLEX8H207454	5VCACLKF79H207680	5VCACLKF89H207817
5VCACLKF98H207386	5VCACRLE18H207455	5VCACLKF99H207681	5VCACLKFX9H207818
5VCACLKF08H207387	5VCACRLE38H207456	5VCACLKF79H207694	5VCACSKF49H207825
5VCACLKF28H207388	5VCACRLE58H207457	5VCACLKF99H207695	5VCACSKF69H207826
5VCACLKF48H207389	5VCACRLE78H207458	5VCACLKF09H207696	5VCACSKF89H207827
5VCACLKF08H207390	5VCACRLE98H207459	5VCACLKF29H207697	5VCACSKFX9H207828
5VCACLKF28H207391	5VCACRLE58H207460	5VCACDKF19H207700	5VCACSKE29H207829
5VCACLKF48H207392	5VCACRLE78H207461	5VCACDKF39H207701	5VCACSKE99H207830
5VCACLKF68H207393	5VCACLKE98H207539	5VCACLKH79H207745	5VCACLJF59H207842
5VCACLKF88H207394	5VCACLKE58H207540	5VCACRLE38H207750	5VCACLKF09H207844
5VCACLKFX8H207395	5VCACLKE78H207541	5VCACRLE58H207751	5VCACLKF29H207845
5VCACLKF18H207396	5VCACRLE78H207542	5VCACRLE78H207752	5VCACLKF49H207846
5VCACLKF38H207397	5VCACRLE98H207543	5VCACRLE98H207753	5VCACLKF69H207847
5VCACLKF58H207398	5VCACRLE08H207544	5VCACLLEX9H207789	5VCACLKF89H207848
5VCACLJF38H207417	5VCACRLE28H207545	5VCACLLE69H207790	5VCACLJF79H207857
5VCACSKE08H207438	5VCACRLE48H207546	5VCACLLE89H207791	5VCACLJF99H207858
5VCACSKE28H207439	5VCACRLE68H207547	5VCACLLEX9H207792	5VCACLJF09H207859

Autocar, LLC  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACLJF79H207860	5VCACLKE69H207922	5VCACRKF99H208123	5VCA3LLE09H208319
5VCACLJF99H207861	5VCACSJF29H207923	5VCACRHEX9H208128	5VCACLJF29H208320
5VCACLJF09H207862	5VCACLJF79H207924	5VCACRHE19H208129	5VCACLJF49H208321
5VCACLJF29H207863	5VCACLJF99H207925	5VCACLKFX9H208130	5VCACLJF69H208322
5VCACLJF49H207864	5VCACLJF09H207926	5VCACLKF19H208131	5VCACLJF89H208323
5VCACLJF69H207865	5VCACLJF29H207927	5VCACLKF39H208132	5VCACLJFX9H208324
5VCACLJF89H207866	5VCACLKF69H207928	5VCACLKF59H208133	5VCACLJF19H208325
5VCACLJFX9H207867	5VCACRLE99H207995	5VCACLKF79H208134	5VCACLJF39H208326
5VCACDKF79H207880	5VCACRJF69H207996	5VCACLKF99H208135	5VCACRLE69H208327
5VCACLKF69H207881	5VCACLJF19H207997	5VCACLKF09H208136	5VCACRLE89H208328
5VCACLKF89H207882	5VCACLJF69H208031	5VCACLKF29H208137	5VCACRLEX9H208329
5VCACLKFX9H207883	5VCACLJF89H208032	5VCACLKF49H208138	5VCACRLE69H208330
5VCACLKF19H207884	5VCACRJF69H208050	5VCACLKF69H208139	5VCACRLE89H208331
5VCACLKF39H207885	5VCA3RJF89H208051	5VCACLKF29H208140	5VCACRLEX9H208332
5VCACLKF59H207886	5VCA3RJFX9H208052	5VCA3SHE39H208141	5VCACRLE19H208333
5VCACLKF79H207887	5VCA3RJF19H208053	5VCACLJF49H208206	5VCACRLE39H208334
5VCACLKF99H207888	5VCA3RJF39H208054	5VCACLJF69H208207	5VCACRJF49H208368
5VCACLKF09H207889	5VCACRJF59H208055	5VCACLJF89H208208	5VCACRJF69H208369
5VCACLKF79H207890	5VCACRJF79H208056	5VCACLJFX9H208209	5VCACLKF09H208377
5VCACLKF09H207908	5VCACRJF99H208057	5VCACLJF69H208210	5VCACLLE89H208438
5VCACLKF29H207909	5VCACRJF09H208058	5VCACDKF29H208211	5VCACLLE69H208440
5VCACLKF99H207910	5VCACLKH59H208103	5VCA3LLE49H208212	5VCACLLE89H208441
5VCA3RHE08H207911	5VCACLKH79H208104	5VCACLJF19H208213	5VCACRJF19H208442
5VCACSKE89H207916	5VCACLJF59H208117	5VCACLJF39H208214	5VCACLJF79H208443
5VCACSKEX9H207917	5VCACLKF99H208118	5VCACLJF79H208216	5VCACLKF49H208446
5VCACSKE19H207918	5VCACLKF09H208119	5VCACLJF99H208217	5VCACLJF49H208447
5VCACSKE39H207919	5VCACLKF79H208120	5VCACLJF09H208218	5VCACLJF69H208448
5VCACSKEX9H207920	5VCACRKF59H208121	5VCACLJF29H208219	5VCACRJF49H208449
5VCACSKE19H207921	5VCACRKF79H208122	5VCA3RKF79H208220	5VCACRJF09H208450





# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACRJF29H208451	5VCACRJF39H208491	5VCACRLE69H208554	5VCACRJF59H208718
5VCACRJF49H208452	5VCACRJF59H208492	5VCACRLE89H208555	5VCACRJF79H208719
5VCACRJF69H208453	5VCACLKF49H208494	5VCACLKF69H208559	5VCACRJF39H208720
5VCACRJF89H208454	5VCACLKF69H208495	5VCACRKG89H208560	5VCACRJF59H208721
5VCACRJFX9H208455	5VCACRKF49H208496	5VCACRKGX9H208561	5VCACRJF79H208722
5VCACRJF19H208456	5VCACRKF69H208497	5VCACRKG19H208562	5VCACRJF99H208723
5VCACRJF39H208457	5VCACLKF19H208498	5VCAEL2E09H208638	5VCACLJF49H208724
5VCACRJF59H208458	5VCACLKF39H208499	5VCAEL2E29H208639	5VCACLJF69H208725
5VCACLJF49H208464	5VCACDLE19H208500	5VCAEL2E99H208640	5VCACLJF89H208726
5VCACLJF69H208465	5VCACLJF69H208501	5VCAEL2E09H208641	5VCACLJF39H208729
5VCACLJF89H208466	5VCACLKF29H208512	5VCACRKF09H208642	5VCACRLE09H208730
5VCACLJFX9H208467	5VCACLKF49H208513	5VCACRKF29H208643	5VCACRLE29H208731
5VCACLJF19H208468	5VCACLKF69H208514	5VCACLKF29H208672	5VCACRLE49H208732
5VCACLJF39H208469	5VCACRKF49H208515	5VCACLLE49H208694	5VCACLKF79H208733
5VCACLJFX9H208470	5VCACRKF69H208516	5VCACRLE29H208695	5VCACDKF19H208734
5VCACLJF19H208471	5VCACRKF89H208517	5VCACRLE49H208696	5VCACRJF59H208735
5VCACLJF39H208472	5VCACLJF19H208518	5VCACRLE69H208697	5VCACRJF79H208736
5VCACLJF59H208473	5VCACLJF39H208519	5VCACRLE89H208698	5VCACRJF99H208737
5VCACLJF79H208474	5VCACLJFX9H208520	5VCACRKF79H208699	5VCACRJF09H208738
5VCACLJF99H208475	5VCACLLE69H208521	5VCACRKF9H208700	5VCACRJF29H208739
5VCACLJF09H208476	5VCACLLE89H208522	5VCACRKF19H208701	5VCACRKF09H208740
5VCACLJF89H208483	5VCACLLEX9H208523	5VCACRKF39H208702	5VCACRKF29H208741
5VCACLJFX9H208484	5VCACLJF79H208524	5VCACRKF59H208703	5VCACLJF69H208742
5VCACLZZ8AH208485	5VCACLKH89H208547	5VCACRKF79H208704	5VCACLJF89H208760
5VCACLZZXAH208486	5VCACRLE29H208549	5VCACLKF29H208705	5VCACLJFX9H208761
5VCACLJF59H208487	5VCACRLE99H208550	5VCACLKF49H208706	5VCA3LLE79H208771
5VCACLJF79H208488	5VCACRLE09H208551	5VCACLKF69H208707	5VCACRLE59H208772
5VCACRJF59H208489	5VCACRLE29H208552	5VCACLKF89H208708	5VCACRLE79H208773
5VCACRJF19H208490	5VCACRLE49H208553	5VCACRLE89H208717	5VCACRJF49H208774

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACRJF69H208775	5VCACLKF29H208879	5VCACDJF29H208968	5VCACLKF09H209111
5VCACRJF89H208776	5VCACLKF99H208880	5VCACDJF49H208969	5VCACLKF29H209112
5VCA3RHF29H208777	5VCACLKF09H208881	5VCACDJF09H208970	5VCACLJF69H209129
5VCA3RHF49H208778	5VCACDJF39H208882	5VCACDJF29H208971	5VCACLLE79H209144
5VCA3RHF69H208779	5VCACLJFX9H208890	5VCACDJF49H208972	5VCACLLE99H209145
5VCA3RHF29H208780	5VCACLKH49H208898	5VCACDJF69H208973	5VCACRJF59H209156
5VCACRJF19H208781	5VCACRJF29H208899	5VCACDJF89H208974	5VCACRJF79H209157
5VCACLJF99H208783	5VCACRJF59H208900	5VCACDJFX9H208975	5VCACRJF99H209158
5VCACLLE49H208811	5VCACRJF79H208901	5VCACDJF19H208976	5VCACRJF09H209159
5VCACLLE69H208812	5VCACRJF99H208902	5VCACDJF39H208977	5VCACRJF79H209160
5VCACLKF99H208815	5VCA3RLEX9H208931	5VCACDJF59H208978	5VCACRJF99H209161
5VCACLJF49H208836	5VCACLJF09H208932	5VCACDJF79H208979	5VCACRJF09H209162
5VCACLJF69H208837	5VCACLJF29H208933	5VCACDJF39H208980	5VCACRJF29H209163
5VCACDJF39H208848	5VCACLJF49H208934	5VCACDJF59H208981	5VCACRJF19H209235
5VCACRJF99H208849	5VCACLKH69H208935	5VCACDJF79H208982	5VCACDLE39H209289
5VCACRLEX9H208850	5VCACLKF19H208940	5VCACRKF49H208983	5VCACDLEX9H209290
5VCACRJF79H208851	5VCACLKF39H208941	5VCACRKF69H208984	5VCACDLE19H209291
5VCACRJF99H208852	5VCACLKF59H208942	5VCACLJF19H208986	5VCACDLE39H209292
5VCACRJF09H208853	5VCACLKF79H208943	5VCACLJF39H208987	5VCACDLE59H209293
5VCACRJF29H208854	5VCACLKF99H208944	5VCACLJF59H208988	5VCACDLE79H209294
5VCA3LJF89H208855	5VCACLKF09H208945	5VCACLJF99H208993	5VCACDLE99H209295
5VCACLJF39H208858	5VCACLKF29H208946	5VCACLJF09H208994	5VCACDLE09H209296
5VCACLKFX9H208872	5VCACLKF49H208947	5VCACLJF29H208995	5VCACDLE29H209297
5VCACLKF19H208873	5VCACLKF69H208948	5VCACLKF69H208996	5VCACDLE49H209298
5VCACLKF39H208874	5VCACLKF89H208949	5VCACLKF89H208997	5VCACDLE69H209299
5VCACLKF59H208875	5VCACRLE69H208960	5VCACRLE99H208998	5VCACDLE99H209300
5VCACLKF79H208876	5VCACRLE89H208961	5VCACLLE59H209014	5VCACDLE09H209301
5VCACLKF99H208877	5VCACLLE39H208962	5VCACRLE29H209068	5VCACLKF79H209302
5VCACLKF09H208878	5VCACLLE59H208963	5VCACLJF29H209080	5VCACRKF59H209303

Autocar, LLC  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACLKE19H209304	5VCACDKF09H209356	5VCACLJFX9H209392	5VCACLLE39H209464
5VCACLJF09H209305	5VCACDKF29H209357	5VCACDKF89H209394	5VCACLKF29H209465
5VCACLJF29H209306	5VCACDKF49H209358	5VCACLJF99H209397	5VCACLKF49H209466
5VCACLJF49H209307	5VCACDJF09H209360	5VCACDKH39H209398	5VCACRKF29H209467
5VCACLKF89H209308	5VCACDJF29H209361	5VCACLKE59H209399	5VCACRKF49H209468
5VCACLLE29H209309	5VCACDJF49H209362	5VCACLJF59H209400	5VCACRKF69H209469
5VCACLLE99H209310	5VCACDJF69H209363	5VCACLJF79H209401	5VCACLKF69H209470
5VCACLLE09H209311	5VCACDJF89H209364	5VCACLLE39H209402	5VCACLKF89H209471
5VCACLLE29H209312	5VCACDJFX9H209365	5VCACLLE59H209403	5VCACLLE39H209495
5VCACLLE49H209313	5VCACDJF19H209366	5VCACLLE79H209404	5VCACLLE59H209496
5VCACLLE69H209314	5VCACDJF39H209367	5VCACDKF09H209406	5VCACLLE79H209497
5VCA3RHF89H209335	5VCACDJF59H209368	5VCACDKF29H209407	5VCACLLE99H209498
5VCA3RHFX9H209336	5VCACDJF79H209369	5VCACDKF49H209408	5VCACLLE09H209499
5VCA3RHF19H209337	5VCACDJF39H209370	5VCACDKF69H209409	5VCACLLE39H209500
5VCA3RHF39H209338	5VCACDLE79H209375	5VCACDKF29H209410	5VCACLLE59H209501
5VCACLKF89H209339	5VCACDLE99H209376	5VCACDKF49H209411	5VCACLLE79H209502
5VCACLKF49H209340	5VCACDLE09H209377	5VCACDKF69H209412	5VCACLLE99H209503
5VCACLKF69H209341	5VCACDLE29H209378	5VCACDKF89H209413	5VCACLLE09H209504
5VCACLKF89H209342	5VCACDLE49H209379	5VCACDKFX9H209414	5VCACLLE29H209505
5VCACLJF39H209346	5VCACDLE09H209380	5VCACLKF89H209440	5VCACLLE49H209506
5VCACLJF59H209347	5VCACDLE69H209383	5VCACLKFX9H209441	5VCACLKF39H209507
5VCACDKF19H209348	5VCACLKF29H209384	5VCACLKF19H209442	5VCACRKE29H209508
5VCACDKF39H209349	5VCACLKF49H209385	5VCACLKF39H209443	5VCACRKE49H209509
5VCACLLEX9H209350	5VCACLJF49H209386	5VCACLKF59H209444	5VCACLJF19H209510
5VCACDKF19H209351	5VCACLJF69H209387	5VCA3LHE99H209445	5VCACLJF39H209511
5VCACDJF19H209352	5VCACLJF89H209388	5VCACRJF39H209446	5VCACLHF89H209512
5VCACDJF39H209353	5VCACLJFX9H209389	5VCACLKGX9H209447	5VCACLHFX9H209513
5VCACDJF59H209354	5VCACLJF69H209390	5VCACLKH09H209448	5VCACLJF99H209514
5VCACDJF79H209355	5VCACLJF89H209391	5VCA3RHE29H209449	5VCACLJF09H209515

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACRJF19H209526	5VCACLLE89H209556	5VCACLLE49H209585	5VCACRKF49H209616
5VCACLKF99H209527	5VCACLLEX9H209557	5VCACLLE69H209586	5VCACRKF69H209617
5VCACDJF39H209529	5VCACLLE19H209558	5VCACLKF59H209587	5VCACRKF89H209618
5VCACDJFX9H209530	5VCACLLE39H209559	5VCACLKF79H209588	5VCACRKF9H209619
5VCACDJF19H209531	5VCACLLEX9H209560	5VCACLKF99H209589	5VCACRKF69H209620
5VCACDJF39H209532	5VCACLLE19H209561	5VCACLKF59H209590	5VCACRKF89H209621
5VCACDJF59H209533	5VCACLLE39H209562	5VCACLKF79H209591	5VCACRKF19H209624
5VCACDJF79H209534	5VCACLLE59H209563	5VCACLKF99H209592	5VCACRKF39H209625
5VCACDJF99H209535	5VCACLLE79H209564	5VCACLKF09H209593	5VCACRKF59H209626
5VCACDJF09H209536	5VCACLLE99H209565	5VCACLKF29H209594	5VCACDKF59H209627
5VCACDJF29H209537	5VCACLLE09H209566	5VCACLKF49H209595	5VCACDKF79H209628
5VCACDJF49H209538	5VCACLLE29H209567	5VCACLKF69H209596	5VCACDKF99H209629
5VCACDJF69H209539	5VCACLLE49H209568	5VCACLKF89H209597	5VCACDKF59H209630
5VCACDJF29H209540	5VCACLLE69H209569	5VCACLKFX9H209598	5VCACDKF79H209631
5VCACDJF49H209541	5VCACLLE29H209570	5VCACLKF19H209599	5VCACDKF99H209632
5VCACDJF69H209542	5VCACLLE49H209571	5VCACLKF49H209600	5VCACDKF09H209633
5VCACDJF89H209543	5VCACLLE69H209572	5VCACLKF69H209601	5VCACDKF29H209634
5VCACDJFX9H209544	5VCACLLE89H209573	5VCACLKF89H209602	5VCACLKF19H209635
5VCACDJF19H209545	5VCACLLEX9H209574	5VCACLKFX9H209603	5VCACLKF39H209636
5VCACDJF39H209546	5VCACLLE19H209575	5VCACLKF19H209604	5VCACLKF59H209637
5VCACDJF59H209547	5VCACLLE39H209576	5VCACLKF39H209605	5VCACLKF79H209638
5VCACLLE99H209548	5VCACLLE59H209577	5VCACLKF59H209606	5VCACLKF99H209639
5VCACLLE09H209549	5VCACLLE79H209578	5VCACRLE69H209607	5VCACLKF59H209640
5VCACLLE79H209550	5VCACLLE99H209579	5VCACRLE89H209608	5VCACLKF79H209641
5VCACLLE99H209551	5VCACLLE59H209580	5VCACRLEX9H209609	5VCACLKF99H209642
5VCACLLE09H209552	5VCACLLE79H209581	5VCACLKF09H209612	5VCACLKF09H209643
5VCACLLE29H209553	5VCACLLE99H209582	5VCACRKF99H209613	5VCACLKF29H209644
5VCACLLE49H209554	5VCACLLE09H209583	5VCACRKF09H209614	5VCACLKF49H209645
5VCACLLE69H209555	5VCACLLE29H209584	5VCACRKF29H209615	5VCACLKF69H209646

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.





# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACRLE79H209812	5VCACLJF6AH209846	5VCACLHF5AH209911	5VCACLLE4AH209946
5VCACRLE99H209813	5VCACLJF8AH209847	5VCACLHF7AH209912	5VCACLLE6AH209947
5VCACRLE09H209814	5VCACLJFXAH209848	5VCACLHF9AH209913	5VCACLLE8AH209948
5VCACRLE29H209815	5VCACLJF1AH209849	5VCACLHF0AH209914	5VCACLLEXAH209949
5VCACRLE49H209816	5VCACLJF8AH209850	5VCACLLE8AH209917	5VCACLLE6AH209950
5VCACRLE69H209817	5VCACDKH4AH209852	5VCACDKF1AH209919	5VCACLLE8AH209951
5VCACRLE89H209818	5VCACDKH6AH209853	5VCACRJF59H209920	5VCACLLEXAH209952
5VCACRJFXAH209822	5VCACDKH8AH209854	5VCACRJF79H209921	5VCACLLE1AH209953
5VCACRJF1AH209823	5VCACDKHXAH209855	5VCACRJF99H209922	5VCACLLE3AH209954
5VCACLKF49H209824	5VCACDKH1AH209856	5VCACLLE3AH209923	5VCACLLE5AH209955
5VCACLKF69H209825	5VCACDJF3AH209857	5VCACLLE5AH209924	5VCACLLE7AH209956
5VCACDKH3AH209826	5VCACLLE7AH209858	5VCACLLE7AH209925	5VCACLLE9AH209957
5VCACDKH5AH209827	5VCACLLE9AH209859	5VCACLLE9AH209926	5VCACLJF6AH209958
5VCACDKH7AH209828	5VCACLLE5AH209860	5VCACLKF8AH209927	5VCACLJF8AH209959
5VCACDJF5AH209830	5VCACRJF0AH209862	5VCACRJF4AH209928	5VCACLKF6AH209960
5VCACDJF7AH209831	5VCACLLE2AH209864	5VCACRJF6AH209929	5VCACDKF0AH209961
5VCACDJF9AH209832	5VCACDJF2AH209865	5VCACRJF2AH209930	5VCACDKF2AH209962
5VCACDJF0AH209833	5VCA3LLE6AH209866	5VCACRJF4AH209931	5VCACDKF4AH209963
5VCACDJF2AH209834	5VCACRJF1AH209871	5VCACDJF8AH209935	5VCACDKF6AH209964
5VCACDKF6AH209835	5VCACRJF3AH209872	5VCACDJFXAH209936	5VCACDKF8AH209965
5VCACDKF8AH209836	5VCACRJF5AH209873	5VCACDJF1AH209937	5VCACDKFXAH209966
5VCACDKFXAH209837	5VCACLKF0AH209887	5VCACDJF3AH209938	5VCACDKF1AH209967
5VCACDKF1AH209838	5VCACLKF2AH209888	5VCACDJF5AH209939	5VCACDKF3AH209968
5VCACLKF7AH209840	5VCACRJF9AH209889	5VCACLKF0AH209940	5VCACLHE4AH209969
5VCACLKF9AH209841	5VCACRJF5AH209890	5VCACLKF2AH209941	5VCACLLE1AH209970
5VCACLJF9AH209842	5VCACRJF7AH209891	5VCACLKF4AH209942	5VCACLJF9AH209971
5VCACLJF0AH209843	5VCACRJF9AH209892	5VCACLLE9AH209943	5VCACLKF5AH209979
5VCACLJF2AH209844	5VCACLJF6AH209894	5VCACLLE0AH209944	5VCACLKF1AH209980
5VCACLJF4AH209845	5VCACLJF0AH209910	5VCACLLE2AH209945	5VCACLKF3AH209981

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACLKF5AH209982	5VCACRKFAXAH210094	5VCACLKF8AH210138	5VCACRJF2AH210172
5VCACLKF7AH209983	5VCACRKF1AH210095	5VCACLKFXAH210139	5VCACRLE9AH210173
5VCACLKF9AH209984	5VCACRKF3AH210096	5VCACRKF2AH210140	5VCACLKF2AH210174
5VCACLKF0AH209985	5VCACRHE7AH210097	5VCACRKF4AH210141	5VCACRJF8AH210175
5VCACLJF0AH209986	5VCACLJF4AH210106	5VCACRKF6AH210142	5VCACRJFXAH210176
5VCACDJF7AH210056	5VCACLJF6AH210107	5VCACRKF8AH210143	5VCACRJF1AH210177
5VCACRJF2AH210057	5VCACDKF2AH210108	5VCACRKFAXAH210144	5VCACRJF3AH210178
5VCACRJF4AH210058	5VCACRLE7AH210110	5VCACRKF1AH210145	5VCA3LLE3AH210179
5VCACRJF6AH210059	5VCACRLE9AH210111	5VCACRKF3AH210146	5VCA3LLEXAH210180
5VCACLJF6AH210060	5VCACRLE0AH210112	5VCACRKF5AH210147	5VCA3LLE1AH210181
5VCACRHE8AH210061	5VCACRLE2AH210113	5VCACRKF7AH210148	5VCACLJF9AH210182
5VCACRJF6AH210062	5VCACRLE4AH210114	5VCACRKF9AH210149	5VCACLJF0AH210183
5VCACRJF8AH210063	5VCACRLE6AH210115	5VCACRKF5AH210150	5VCACLPE4AH210184
5VCACRJFXAH210064	5VCACRLE8AH210116	5VCACRKF7AH210151	5VCACRKF2AH210185
5VCACRJF1AH210065	5VCACRLEXAH210117	5VCACRKF9AH210152	5VCACRKF4AH210186
5VCACRKF3AH210079	5VCACRLE1AH210118	5VCACRKF0AH210153	5VCA3DHE4AH210187
5VCACRKFAXAH210080	5VCACRLE3AH210119	5VCACRKF2AH210154	5VCACLLE4AH210188
5VCACRKF1AH210081	5VCACRJF5AH210120	5VCACRKF4AH210155	5VCACLLE6AH210189
5VCACLLEXAH210082	5VCACRJF7AH210121	5VCACLKFXAH210156	5VCACLLE2AH210190
5VCACLKF9AH210083	5VCACRJF9AH210122	5VCACLKF1AH210157	5VCACLJFXAH210191
5VCACLKF0AH210084	5VCACRJF0AH210123	5VCACLKF3AH210158	5VCACLJF1AH210192
5VCACLKF2AH210085	5VCACLKF8AH210124	5VCACLKF5AH210159	5VCACLJF3AH210193
5VCACLKF4AH210086	5VCACLKFXAH210125	5VCACSKF9AH210160	5VCACLJF5AH210194
5VCACLKF6AH210087	5VCACLKF7AH210132	5VCACRJF7AH210166	5VCACLJF7AH210195
5VCACRKF6AH210089	5VCACLKF9AH210133	5VCACRJF9AH210167	5VCACRJF5AH210196
5VCACRKF2AH210090	5VCACLKF0AH210134	5VCACRJF0AH210168	5VCACLLE5AH210197
5VCACRKF4AH210091	5VCACLKF2AH210135	5VCACRJF2AH210169	5VCACLLE7AH210198
5VCACRKF6AH210092	5VCACLKF4AH210136	5VCACRJF9AH210170	5VCACLLE9AH210199
5VCACRKF8AH210093	5VCACLKF6AH210137	5VCACRJF0AH210171	5VCACLLE1AH210200

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACLLE3AH210201	5VCACLKEXAH210245	5VCACDKF8AH210274	5VCACLLE2AH210304
5VCACLLE5AH210202	5VCACLKE1AH210246	5VCACDKFXAH210275	5VCACLLE4AH210305
5VCACRJF9AH210203	5VCACLKE3AH210247	5VCACDKF1AH210276	5VCACLLE6AH210306
5VCACSKF3AH210204	5VCACLKE5AH210248	5VCACDKF3AH210277	5VCA3RHE3AH210307
5VCACRJF2AH210205	5VCACLKE7AH210249	5VCACDKF5AH210278	5VCA3RHE5AH210308
5VCACRJF4AH210206	5VCACLKE3AH210250	5VCACDKF7AH210279	5VCACLLE1AH210309
5VCACLKF1AH210207	5VCACLKE5AH210251	5VCACDKF3AH210280	5VCACLLE8AH210310
5VCA3DJF4AH210208	5VCACRJF0AH210252	5VCACDKF5AH210281	5VCACLJF5AH210311
5VCA3DJF6AH210209	5VCACRJF2AH210253	5VCACDKF7AH210282	5VCACLJF7AH210312
5VCACLHE4AH210216	5VCACRJF4AH210254	5VCACDKF9AH210283	5VCACLJF9AH210313
5VCACRJF9AH210217	5VCACRJF6AH210255	5VCACDKF0AH210284	5VCACLJF0AH210314
5VCACLJF4AH210218	5VCACDKF6AH210256	5VCACDKF2AH210285	5VCACLJF2AH210315
5VCACLKF8AH210219	5VCACDKF8AH210257	5VCACDKF4AH210286	5VCACLJF4AH210316
5VCACLKF4AH210220	5VCACDKFXAH210258	5VCACDKF6AH210287	5VCACLLE0AH210317
5VCACRJF0AH210221	5VCACDKF1AH210259	5VCACDKF8AH210288	5VCACLLE2AH210318
5VCACLLE0AH210222	5VCACDKF8AH210260	5VCACDKFXAH210289	5VCACLLE4AH210319
5VCACLLE2AH210223	5VCACDKFXAH210261	5VCACDKF6AH210290	5VCACLLE0AH210320
5VCACL3E4AH210224	5VCACDKF1AH210262	5VCACDKF8AH210291	5VCACLLE2AH210321
5VCAEL3E3AH210225	5VCACDKF3AH210263	5VCACDKFXAH210292	5VCACLLE4AH210322
5VCAEL3E5AH210226	5VCACDKF5AH210264	5VCACDKF1AH210293	5VCACLLE6AH210323
5VCACRLE6AH210227	5VCACDKF7AH210265	5VCACDKF3AH210294	5VCACLLE8AH210324
5VCACRLE8AH210228	5VCACDKF9AH210266	5VCACDKF5AH210295	5VCACLLEXAH210325
5VCACRLEXAH210229	5VCACDKF0AH210267	5VCACLKF4AH210296	5VCACLLE1AH210326
5VCACLLEXAH210230	5VCACDKF2AH210268	5VCACLLE9AH210297	5VCACLKF0AH210327
5VCAELKH5AH210240	5VCACDKF4AH210269	5VCACRJF4AH210299	5VCACLKF2AH210328
5VCACLKE2AH210241	5VCACDKF0AH210270	5VCACDLE8AH210300	5VCACLKF4AH210329
5VCACLKE4AH210242	5VCACDKF2AH210271	5VCACDLEXAH210301	5VCACDKF3AH210330
5VCACLKE6AH210243	5VCACDKF4AH210272	5VCACLLE9AH210302	5VCACDKF5AH210331
5VCACLKE8AH210244	5VCACDKF6AH210273	5VCACLLE0AH210303	5VCACDKF7AH210332

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACDKF9AH210333	5VCACLE5AH210362	5VCACRJF3AH210391	5VCACDKF8AH210422
5VCACDKF0AH210334	5VCACLE7AH210363	5VCACRJF5AH210392	5VCACDKFXAH210423
5VCACDKF2AH210335	5VCACLE9AH210364	5VCACRJF7AH210393	5VCACDKF1AH210424
5VCACDKF4AH210336	5VCACLE0AH210365	5VCACLJF2AH210394	5VCACDKF3AH210425
5VCACDKF6AH210337	5VCACLE2AH210366	5VCACLJF4AH210395	5VCACDKF5AH210426
5VCACDKF8AH210338	5VCACLE4AH210367	5VCACLJF6AH210396	5VCACDLEXAH210427
5VCACDKFXAH210339	5VCACLE6AH210368	5VCACLJF8AH210397	5VCACLKF6AH210428
5VCACDKF6AH210340	5VCACLE8AH210369	5VCACLJFXAH210398	5VCACLKF8AH210429
5VCACDKF8AH210341	5VCACRLE0AH210370	5VCACLJF1AH210399	5VCACDJF5AH210430
5VCACDKFXAH210342	5VCACRLE2AH210371	5VCACLJF4AH210400	5VCACDJF7AH210431
5VCACDKF1AH210343	5VCACRLE4AH210372	5VCACLJF6AH210401	5VCACLJF6AH210432
5VCACDKF3AH210344	5VCACRLE6AH210373	5VCACLJF8AH210402	5VCACLJF8AH210433
5VCACDKF5AH210345	5VCACRLE8AH210374	5VCACLJFXAH210403	5VCAEL3E1AH210434
5VCACDKF7AH210346	5VCACRLEXAH210375	5VCACLJF1AH210404	5VCA3DHE8AH210435
5VCACDKF9AH210347	5VCACRLE1AH210376	5VCACLJF3AH210405	5VCACLJF3AH210436
5VCACDKF0AH210348	5VCACRLE3AH210377	5VCACLJF5AH210406	5VCACLJF5AH210437
5VCACDKF2AH210349	5VCACRLE5AH210378	5VCACRJF3AH210407	5VCACLJF7AH210438
5VCACLE9AH210350	5VCACRLE7AH210379	5VCACRJF5AH210408	5VCACLJF9AH210439
5VCACLE0AH210351	5VCACRLE3AH210380	5VCA3DHF6AH210409	5VCACLJF5AH210440
5VCACRKF6AH210352	5VCACRLE5AH210381	5VCACLJF7AH210410	5VCA3LLE1AH210441
5VCACRJF6AH210353	5VCACRLE7AH210382	5VCACLKF0AH210411	5VCA3LLE3AH210442
5VCACLE6AH210354	5VCACRLE9AH210383	5VCA3RLE3AH210413	5VCACLJF0AH210443
5VCACLE8AH210355	5VCACLJFXAH210384	5VCACDLE3AH210415	5VCACLJF2AH210444
5VCACLLEXAH210356	5VCACSLE3AH210385	5VCACDLE5AH210416	5VCACLJF4AH210445
5VCACLE1AH210357	5VCACSLE5AH210386	5VCACDLE7AH210417	5VCACLKF8AH210446
5VCACLE3AH210358	5VCACRJF1AH210387	5VCACDLE9AH210418	5VCACLKE0AH210447
5VCACLE5AH210359	5VCACRJF3AH210388	5VCACDLE0AH210419	5VCACLJFXAH210448
5VCACLE1AH210360	5VCACRJF5AH210389	5VCACDKF4AH210420	5VCACLJF1AH210449
5VCACLE3AH210361	5VCACRJF1AH210390	5VCACDKF6AH210421	5VCACDJFXAH210455

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACRJF7AH210460	5VCACDKF7AH210489	5VCACDLE2AH210518	5VCACLLE6AH210547
5VCACDKF7AH210461	5VCACDKF3AH210490	5VCACDLE4AH210519	5VCACLLE8AH210548
5VCACDKF9AH210462	5VCACDKF5AH210491	5VCACDLE0AH210520	5VCACLKF7AH210549
5VCACDKF0AH210463	5VCACDKF7AH210492	5VCACDLE2AH210521	5VCACLKF3AH210550
5VCACDKF2AH210464	5VCACDKF9AH210493	5VCACDLE4AH210522	5VCACLKF5AH210551
5VCACDKF4AH210465	5VCACDKF0AH210494	5VCACDLE6AH210523	5VCACLKF7AH210552
5VCACDKF6AH210466	5VCACDKF2AH210495	5VCACDLE8AH210524	5VCACLLE1AH210553
5VCACDKF8AH210467	5VCACDKF4AH210496	5VCACDLEXAH210525	5VCACLLE3AH210554
5VCACDKFXAH210468	5VCACDKF6AH210497	5VCACDLE1AH210526	5VCACLLE5AH210555
5VCACDKF1AH210469	5VCACDKF8AH210498	5VCACDLE3AH210527	5VCACLLE7AH210556
5VCACDKF8AH210470	5VCACDKFXAH210499	5VCACDLE5AH210528	5VCACLLE9AH210557
5VCACDKFXAH210471	5VCACDKF2AH210500	5VCACDLE7AH210529	5VCACLLE0AH210558
5VCACDKF1AH210472	5VCACDKF4AH210501	5VCACDLE3AH210530	5VCACLLE2AH210559
5VCACDKF3AH210473	5VCACDKF6AH210502	5VCACDLE5AH210531	5VCACLLE9AH210560
5VCACDKF5AH210474	5VCACDKF8AH210503	5VCACDLE7AH210532	5VCACLLE0AH210561
5VCACDKF7AH210475	5VCACDKFXAH210504	5VCACDLE9AH210533	5VCACLLE2AH210562
5VCACDKF9AH210476	5VCACDKF1AH210505	5VCA3LJF3AH210534	5VCACLLE4AH210563
5VCACDKF0AH210477	5VCACDKF3AH210506	5VCACLJF5AH210535	5VCACLLE6AH210564
5VCACDKF2AH210478	5VCACDKF5AH210507	5VCACDLE4AH210536	5VCACLLE8AH210565
5VCACDKF4AH210479	5VCACDLEXAH210508	5VCACDLE6AH210537	5VCACLLEXAH210566
5VCACDKF0AH210480	5VCACDLE1AH210509	5VCACDLE8AH210538	5VCACLLE1AH210567
5VCACDKF2AH210481	5VCACDLE8AH210510	5VCACDLEXAH210539	5VCACLLE3AH210568
5VCACDKF4AH210482	5VCACDLEXAH210511	5VCACDLE6AH210540	5VCACLLE5AH210569
5VCACDKF6AH210483	5VCACDLE1AH210512	5VCACDLE8AH210541	5VCACLLE1AH210570
5VCACDKF8AH210484	5VCACDLE3AH210513	5VCACLLE7AH210542	5VCACLLE3AH210571
5VCACDKFXAH210485	5VCACDLE5AH210514	5VCACLLE9AH210543	5VCACLLE5AH210572
5VCACDKF1AH210486	5VCACDLE7AH210515	5VCACLLE0AH210544	5VCACLLE7AH210573
5VCACDKF3AH210487	5VCACDLE9AH210516	5VCACLLE2AH210545	5VCACLLE9AH210574
5VCACDKF5AH210488	5VCACDLE0AH210517	5VCACLLE4AH210546	5VCACLLE0AH210575

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACLE2AH210576	5VCACLE5AH210605	5VCACRLE8AH210634	5VCACLJF2AH210668
5VCACLE4AH210577	5VCACLE7AH210606	5VCACRLEXAH210635	5VCACLJF4AH210669
5VCACLE6AH210578	5VCACLE9AH210607	5VCACRLE1AH210636	5VCACLJF0AH210670
5VCACLE8AH210579	5VCACLE0AH210608	5VCACRLE7AH210639	5VCACLJF2AH210671
5VCACLE4AH210580	5VCACLE2AH210609	5VCACRLE3AH210640	5VCACLJF4AH210672
5VCACLE6AH210581	5VCACLE9AH210610	5VCACRLE5AH210641	5VCACRKF4AH210673
5VCACLE8AH210582	5VCACLE0AH210611	5VCACRLE7AH210642	5VCACRKF6AH210674
5VCACLEXAH210583	5VCACLE2AH210612	5VCACRLE9AH210643	5VCACLE4AH210675
5VCACLE1AH210584	5VCACLE4AH210613	5VCACRLE0AH210644	5VCACLE6AH210676
5VCACLE3AH210585	5VCACLE6AH210614	5VCACLKF9AH210648	5VCACLE8AH210677
5VCACLE5AH210586	5VCACRKE2AH210615	5VCACLKF0AH210649	5VCA3RHE5AH210678
5VCACLE7AH210587	5VCACRKE4AH210616	5VCACLKF7AH210650	5VCACRKF5AH210679
5VCACLE9AH210588	5VCACSKE7AH210617	5VCACLKF9AH210651	5VCACRKF1AH210680
5VCACLE0AH210589	5VCACSKE9AH210618	5VCACLKF0AH210652	5VCACSJF2AH210681
5VCACLE7AH210590	5VCACSKE0AH210619	5VCACLKF2AH210653	5VCACSJF4AH210682
5VCACLE9AH210591	5VCACSKE7AH210620	5VCACLKH2AH210654	5VCACSJF6AH210683
5VCACLE0AH210592	5VCACSKE9AH210621	5VCACRJF0AH210655	5VCACSJF8AH210684
5VCACLE2AH210593	5VCACSKE0AH210622	5VCACRJF2AH210656	5VCACSJFXAH210685
5VCACLE4AH210594	5VCACSKE2AH210623	5VCACLKFXAH210657	5VCACSJF1AH210686
5VCACLE6AH210595	5VCACSKE4AH210624	5VCACLKF1AH210658	5VCACSJF3AH210687
5VCACLE8AH210596	5VCACSKE6AH210625	5VCACLKF3AH210659	5VCACLJF8AH210688
5VCACLEXAH210597	5VCACSKE8AH210626	5VCACLE2AH210660	5VCACRLE0AH210689
5VCACLE1AH210598	5VCACSKE9AH210627	5VCACLE4AH210661	5VCACRLE7AH210690
5VCACLE3AH210599	5VCACSKE1AH210628	5VCACLHE5AH210662	5VCACRLE9AH210691
5VCACLE6AH210600	5VCACDLE0AH210629	5VCACLHE7AH210663	5VCACRLE0AH210692
5VCACLE8AH210601	5VCACDLE7AH210630	5VCACLJF5AH210664	5VCACRLE2AH210693
5VCACLEXAH210602	5VCACRLE2AH210631	5VCACLJF7AH210665	5VCACRLE4AH210694
5VCACLE1AH210603	5VCACRLE4AH210632	5VCACLJF9AH210666	5VCACRJF1AH210695
5VCACLE3AH210604	5VCACRLE6AH210633	5VCACLJF0AH210667	5VCACRJF3AH210696

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACRJF5AH210697	5VCACLJF1AH210726	5VCACLJF7AH210763	5VCACDJFXAH210794
5VCACRJF7AH210698	5VCACLJF3AH210727	5VCACLJF9AH210764	5VCACRJF5AH210795
5VCACLJF2AH210699	5VCACLJF5AH210728	5VCACLJF0AH210765	5VCACRJF7AH210796
5VCACLJF5AH210700	5VCACLJF7AH210729	5VCACLJF2AH210766	5VCACRJF9AH210797
5VCACLJF7AH210701	5VCACLJF3AH210730	5VCACLJF4AH210767	5VCACRJF0AH210798
5VCACLJF9AH210702	5VCACLJF5AH210731	5VCACLJF6AH210768	5VCACRJF2AH210799
5VCACLJF0AH210703	5VCACLJF7AH210732	5VCACLJF8AH210769	5VCACRJF5AH210800
5VCACLJF2AH210704	5VCACLJF9AH210733	5VCACLJF4AH210770	5VCACRJF7AH210801
5VCACRJF0AH210705	5VCACRJF9AH210735	5VCACLJF6AH210771	5VCACRJF9AH210802
5VCACRJF2AH210706	5VCACRJF0AH210736	5VCACLJFXAH210773	5VCACRJF0AH210803
5VCACLKFXAH210707	5VCACRJF2AH210737	5VCACLJF1AH210774	5VCACDJF9AH210804
5VCACRJF6AH210708	5VCACLJF8AH210738	5VCACLJF3AH210775	5VCACDJF0AH210805
5VCACRJF8AH210709	5VCACLJFXAH210739	5VCACRJF1AH210776	5VCACLJFXAH210806
5VCACRJF4AH210710	5VCACLJF6AH210740	5VCACRJF3AH210777	5VCACLJF1AH210807
5VCACRJF6AH210711	5VCACLJF8AH210741	5VCACRJF5AH210778	5VCACLJF3AH210808
5VCACRJF8AH210712	5VCACDJF6AH210744	5VCACLJF0AH210779	5VCACLJF5AH210809
5VCACLJF3AH210713	5VCACDJF8AH210745	5VCACLJF7AH210780	5VCACLJF1AH210810
5VCACLJF5AH210714	5VCACDJFXAH210746	5VCACSHE1AH210782	5VCACRKF1AH210811
5VCACLJF7AH210715	5VCA3LHE2AH210747	5VCACLJF2AH210783	5VCACRKF3AH210812
5VCACLJF9AH210716	5VCACLJF0AH210748	5VCACLJF4AH210784	5VCACDJFXAH210813
5VCACLJF0AH210717	5VCA3RJF9AH210749	5VCACLJF6AH210785	5VCA3RHF8AH210814
5VCACLJF2AH210718	5VCACLJF9AH210750	5VCACLJF8AH210786	5VCACLJF0AH210815
5VCACLJF4AH210719	5VCACLJF0AH210751	5VCACLJFXAH210787	5VCACLK4AH210816
5VCACLJF0AH210720	5VCACSJF1AH210753	5VCACLJF1AH210788	5VCACLK6AH210817
5VCACLJF2AH210721	5VCACLJF3AH210758	5VCACLJF3AH210789	5VCACRJF4AH210819
5VCACLJF4AH210722	5VCACLJF5AH210759	5VCACDJF2AH210790	5VCACRJF0AH210820
5VCACLJF6AH210723	5VCACLJF1AH210760	5VCACDJF4AH210791	5VCACRJF2AH210821
5VCACLJF8AH210724	5VCACLJF3AH210761	5VCACDJF6AH210792	5VCACRJF4AH210822
5VCACLJFXAH210725	5VCACLJF5AH210762	5VCACDJF8AH210793	5VCACRJF6AH210823

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACRJF8AH210824	5VCACLLE2AH210853	5VCACDKF8AH210890	5VCACSKFXAH210927
5VCACRLE4AH210825	5VCACLLE4AH210854	5VCACDKFXAH210891	5VCACRKF9AH210944
5VCACSLE7AH210826	5VCACLLE6AH210855	5VCACDKF1AH210892	5VCACSLE4AH210945
5VCACLKF9AH210827	5VCACLLE8AH210856	5VCACDKF3AH210893	5VCACSLE6AH210946
5VCACLKF0AH210828	5VCACLLEXAH210857	5VCACDKF5AH210894	5VCACSLE8AH210947
5VCACLKF2AH210829	5VCACLLE1AH210858	5VCACDKF7AH210895	5VCACSLEXAH210948
5VCACLKF9AH210830	5VCACLLE3AH210859	5VCACDKF9AH210896	5VCACSLE1AH210949
5VCACLKF0AH210831	5VCACLLEXAH210860	5VCACDKF0AH210897	5VCACSLE8AH210950
5VCACLKF2AH210832	5VCACLLE1AH210861	5VCACDKF2AH210898	5VCACSLEXAH210951
5VCACLKF4AH210833	5VCACLLE3AH210862	5VCACDKF4AH210899	5VCACSLE1AH210952
5VCACLKF6AH210834	5VCACLLE5AH210863	5VCACDKF7AH210900	5VCACSLE3AH210953
5VCACLKF8AH210835	5VCACLLE7AH210864	5VCACDKF9AH210901	5VCACSLE5AH210954
5VCACLKFXAH210836	5VCACLLE9AH210865	5VCACDKF0AH210902	5VCACSLE7AH210955
5VCACLKF1AH210837	5VCACLLE0AH210866	5VCACDKF2AH210903	5VCACSLE9AH210956
5VCACLKF3AH210838	5VCACLLE2AH210867	5VCACDKF4AH210904	5VCACSLE0AH210957
5VCACLKF5AH210839	5VCACLLE4AH210868	5VCACLLE1AH210908	5VCACSLE2AH210958
5VCACLKF1AH210840	5VCACLLE6AH210869	5VCACLLE3AH210909	5VCACSLE4AH210959
5VCACLKF3AH210841	5VCACLLE2AH210870	5VCACLLEXAH210910	5VCACSLE0AH210960
5VCACLKF5AH210842	5VCACLLE4AH210871	5VCACLLE1AH210911	5VCACSLE2AH210961
5VCACLKF7AH210843	5VCACLLE6AH210872	5VCACDLE5AH210917	5VCACSLE4AH210962
5VCACLKF9AH210844	5VCACLKF6AH210879	5VCACDKF4AH210918	5VCACSLE6AH210963
5VCACLKF0AH210845	5VCACLLE9AH210882	5VCACDKF6AH210919	5VCACSLE8AH210964
5VCACLKF2AH210846	5VCACDLE3AH210883	5VCACDKF2AH210920	5VCACSLEXAH210965
5VCACLKF4AH210847	5VCACDKF2AH210884	5VCACDKF4AH210921	5VCACSLE1AH210966
5VCACLKF6AH210848	5VCACDKF4AH210885	5VCACDKF6AH210922	5VCACSLE3AH210967
5VCACLKF8AH210849	5VCACDKF6AH210886	5VCACDKF8AH210923	5VCACSLE5AH210968
5VCACLKF4AH210850	5VCACDKF8AH210887	5VCACDKFXAH210924	5VCACSLE5AH210971
5VCACLKF6AH210851	5VCACDKFXAH210888	5VCACSKF6AH210925	5VCACLKF7AH210972
5VCACLKF8AH210852	5VCACDKF1AH210889	5VCACSKF8AH210926	5VCACLKF9AH210973

**Autocar, LLC**  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACLKF0AH210974	5VCACDKF1AH211055	5VCACLKF9AH211122	5VCACLKF4AH211156
5VCACLKF2AH210975	5VCACDKF7AH211092	5VCACLKF0AH211123	5VCACLKF6AH211157
5VCACLKF4AH210976	5VCACDKF9AH211093	5VCACLKF2AH211124	5VCACLKF8AH211158
5VCACLKF6AH210977	5VCACDKF0AH211094	5VCACRKF0AH211125	5VCACLKFXAH211159
5VCACLKF8AH210978	5VCACDKF2AH211095	5VCACRKF2AH211126	5VCACLKF6AH211160
5VCACLKFXAH210979	5VCACDKF4AH211096	5VCACRKF4AH211127	5VCACRKF4AH211161
5VCACLKF6AH210980	5VCACDKF6AH211097	5VCACDKF2AH211128	5VCA3RKF6AH211162
5VCACLKF8AH210981	5VCACDKF8AH211098	5VCACDKF4AH211129	5VCAEL3E1AH211163
5VCACDKF2AH210982	5VCACDKFXAH211099	5VCACDKF0AH211130	5VCAEL3E3AH211164
5VCACDKF4AH210983	5VCACDKF2AH211100	5VCACDKF2AH211131	5VCACLKF5AH211165
5VCACDKF6AH210984	5VCACLKF3AH211102	5VCACSLE9AH211136	5VCACSLE9AH211184
5VCACDKF8AH210985	5VCACLKF5AH211103	5VCACSLE0AH211137	5VCACSLE0AH211185
5VCACDKFXAH210986	5VCACLKF7AH211104	5VCACSLE2AH211138	5VCACSLE2AH211186
5VCACDKF1AH210987	5VCACLKF9AH211105	5VCACSLE4AH211139	5VCACSLE4AH211187
5VCACDKF3AH210988	5VCACLKF0AH211106	5VCACSLE0AH211140	5VCACDKF9AH211188
5VCACDKF5AH210989	5VCACLLE5AH211107	5VCACSLE2AH211141	5VCACDKF0AH211189
5VCACDKF1AH210990	5VCACSLE4AH211108	5VCACSLE4AH211142	5VCACLKF4AH211190
5VCACDKF3AH210991	5VCACSLE6AH211109	5VCACSLE6AH211143	5VCACLKF6AH211191
5VCACDKF5AH210992	5VCACSLE2AH211110	5VCACSLE8AH211144	5VCACLKF8AH211192
5VCACDKF7AH210993	5VCACLKF6AH211112	5VCACSLEXAH211145	5VCACDKF2AH211193
5VCACDLEXAH211027	5VCACLKF8AH211113	5VCACSLE1AH211146	5VCACSKF9AH211194
5VCACDLE1AH211028	5VCACLKFXAH211114	5VCACSLE3AH211147	5VCACSKF0AH211195
5VCACDLE3AH211029	5VCACLKF1AH211115	5VCACSLE5AH211148	5VCACSKF2AH211196
5VCACDLEXAH211030	5VCACLKF3AH211116	5VCACSLE7AH211149	5VCACSKF4AH211197
5VCACDLE1AH211031	5VCACRKF1AH211117	5VCACSLE3AH211150	5VCACSKF6AH211198
5VCACDLE3AH211032	5VCACRKF3AH211118	5VCACLLE8AH211151	5VCACRKH5AH211199
5VCACDLE5AH211033	5VCACLKF9AH211119	5VCACLLEXAH211152	5VCACSLE3AH211200
5VCACDLE7AH211034	5VCACLKF5AH211120	5VCACLKF0AH211154	5VCACSLE5AH211201
5VCACDLE9AH211035	5VCACLKF7AH211121	5VCACSLE2AH211155	5VCACSLE7AH211202





# SAFETY RECALL BULLETIN

## AUTOCAR SAFETY RECALL A-1003 NHTSA Recall 10V-363

August, 2010

### Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACSLE9AH211203	5VCACLKF5AH211232	5VCACLKF2AH211267	5VCACRKF4AH211337
5VCACSLE0AH211204	5VCACLKF7AH211233	5VCACLKF4AH211268	5VCACRKF6AH211338
5VCACSLE2AH211205	5VCA3RKFOAH211237	5VCACLKF6AH211269	5VCACRKF8AH211339
5VCACSLE4AH211206	5VCACSKF3AH211238	5VCACSKFXAH211270	5VCACRKF4AH211340
5VCA3DKF9AH211207	5VCACLLE0AH211239	5VCACSKF1AH211271	5VCACRKE1AH211352
5VCA3DKF0AH211208	5VCACLLE7AH211240	5VCACRKF2AH211272	5VCACDKH0AH211355
5VCA3DKF2AH211209	5VCACLLE9AH211241	5VCACRLE7AH211273	5VCACDKH2AH211356
5VCA3DKF9AH211210	5VCACLKF8AH211242	5VCACLLE2AH211274	5VCACDKH4AH211357
5VCA3DKF0AH211211	5VCACRLE9AH211243	5VCACLLE4AH211275	5VCACDKH6AH211358
5VCA3LLE2AH211212	5VCACLKF1AH211244	5VCACLLE6AH211276	5VCACDKH8AH211359
5VCA3LLE4AH211213	5VCACLKF3AH211245	5VCACLKF9AH211282	5VCACDKH4AH211360
5VCACRLE2AH211214	5VCACLKF5AH211246	5VCACRKF7AH211283	5VCACSLE5AH211361
5VCACRLE4AH211215	5VCACLKF7AH211247	5VCACRKF9AH211284	5VCACRLE6AH211362
5VCACRLE6AH211216	5VCACLKE1AH211249	5VCACLLE9AH211286	5VCACRLE5AH211367
5VCACRLE8AH211217	5VCACLKE8AH211250	5VCA3LLE0AH211287	5VCACRLE7AH211368
5VCACRLEXAH211218	5VCACRKF5AH211251	5VCACRKF6AH211288	5VCACLLE2AH211369
5VCACRLE1AH211219	5VCACRKF7AH211252	5VCACRKF8AH211289	5VCACLLE9AH211370
5VCACRLE8AH211220	5VCACRKF9AH211253	5VCACLKF8AH211290	5VCACLLE0AH211371
5VCACRLEXAH211221	5VCACRKF0AH211254	5VCACLKFXAH211291	5VCACLLE2AH211372
5VCA3DKF5AH211222	5VCACRKF2AH211255	5VCACLKFXAH211307	5VCACLLE4AH211373
5VCA3DKF7AH211223	5VCACRKF4AH211256	5VCACSLEXAH211310	5VCACLLE6AH211374
5VCA3DKF9AH211224	5VCA3DKF2AH211257	5VCAEL3E1AH211311	5VCACLLE8AH211375
5VCA3DKF0AH211225	5VCACLKF1AH211258	5VCAEL3E3AH211312	5VCACLLEXAH211376
5VCA3DKF2AH211226	5VCAEL2EXAH211261	5VCAEL3E5AH211313	5VCACLLE1AH211377
5VCACLLE4AH211227	5VCAEL2E1AH211262	5VCACRKE4AH211314	5VCACLLE3AH211378
5VCACLLE6AH211228	5VCACLKF5AH211263	5VCACRLEXAH211333	5VCACLLE5AH211379
5VCACLLE8AH211229	5VCACLKF7AH211264	5VCACRKF9AH211334	5VCACLLE1AH211380
5VCACLLE4AH211230	5VCACLKF9AH211265	5VCACRKF0AH211335	5VCACLLE3AH211381
5VCACLKF3AH211231	5VCACLKF0AH211266	5VCACRKF2AH211336	5VCACLLE5AH211382





# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACLE7AH211383	5VCACLKF2AH211477	5VCACLKE2BH211553	5VCACSLE6BH211595
5VCACLE9AH211384	5VCACLKF4AH211478	5VCACLKE4BH211554	5VCACSLE8BH211596
5VCACLE0AH211385	5VCACLKF6AH211479	5VCACLKE6BH211555	5VCACSLEXBH211597
5VCACRLE9AH211386	5VCACLKF2AH211480	5VCACRLE6BH211556	5VCACSLE1BH211598
5VCACRLE0AH211387	5VCACRKF7AH211512	5VCACRLE8BH211557	5VCACSLE3BH211599
5VCACRLE2AH211388	5VCACSLE4AH211514	5VCACRLEXBH211558	5VCACSLE6BH211600
5VCACRLE4AH211389	5VCACSLE6AH211515	5VCACRLE1BH211559	5VCACSLE8BH211601
5VCACRLE0AH211390	5VCACRLE7AH211516	5VCACRLE8BH211560	5VCACSLEXBH211602
5VCACRLE2AH211391	5VCACRLE9AH211517	5VCACRLEXBH211561	5VCACSLE1BH211603
5VCACRLE4AH211392	5VCACRLE0AH211518	5VCACRLE1BH211562	5VCACSLE3BH211604
5VCACRLE6AH211393	5VCACRLE2AH211519	5VCACRLE3BH211563	5VCACSLE5BH211605
5VCACRLE8AH211394	5VCACRLE9AH211520	5VCACRLE5BH211564	5VCACSLE7BH211606
5VCACRLEXAH211395	5VCACRLE0AH211521	5VCACRLE7BH211565	5VCACSKE2AH211609
5VCACRLE1AH211396	5VCACRLE4AH211523	5VCACDKE3BH211566	5VCACSLE9BH211610
5VCACRLE3AH211397	5VCACSKE7AH211525	5VCACDKE5BH211567	5VCACSLE0BH211611
5VCACRLE5AH211398	5VCACLE3AH211526	5VCACDKE7BH211568	5VCACDKF5BH211612
5VCACRLE7AH211399	5VCACRLE1AH211527	5VCACRLE0BH211570	5VCACDKF7BH211613
5VCA3RKF7AH211400	5VCACLE7AH211528	5VCACLE8AH211571	5VCACDKF9BH211614
5VCACLKF4AH211464	5VCACRKF2AH211529	5VCACLEXAH211572	5VCACDKF0BH211615
5VCACRKF2AH211465	5VCACRKF9AH211530	5VCACLE6BH211585	5VCACLKG0BH211620
5VCACRKF4AH211466	5VCACRKF0AH211531	5VCACLE8BH211586	5VCACLKG2BH211621
5VCA3LLE6AH211469	5VCACRKF2AH211532	5VCACLEXBH211587	5VCACLKG4BH211622
5VCACRLE9AH211470	5VCACRKF4AH211533	5VCACLE1BH211588	5VCACLKG6BH211623
5VCACRKF8AH211471	5VCACRKF6AH211534	5VCACLE3BH211589	5VCACLKG8BH211624
5VCACRKF9AH211472	5VCACLKG6AH211538	5VCACLEXBH211590	5VCACLE7BH211627
5VCACRKF1AH211473	5VCACDKH2AH211549	5VCACSLE9BH211591	5VCACLE9BH211631
5VCACRKF3AH211474	5VCACLKH6AH211550	5VCACSLE0BH211592	5VCACLE0BH211632
5VCACRKF5AH211475	5VCACLKE0AH211551	5VCACSLE2BH211593	5VCACLE2BH211633
5VCACRKF7AH211476	5VCACLKE2AH211552	5VCACSLE4BH211594	5VCACSKE1AH211634

Autocar, LLC  
551 South Washington Street  
Hagerstown, IN 47346



**Questions?** Visit the Autocar website at [www.autocartruck.com](http://www.autocartruck.com) and click the **Web-Link Direct** icon to request emergency service assistance.



# SAFETY RECALL BULLETIN

**AUTOCAR SAFETY RECALL A-1003**  
**NHTSA Recall 10V-363**

**August, 2010**

## Vehicles affected by VIN

Affected vehicles sorted by last (6) digits of VIN, in ascending order from top to bottom:

5VCACSKE5AH211636	5VCACLKF7BH211704	5VCACRKF6BH211762	5VCACSLE3BH211828
5VCACSKE7AH211637	5VCACSKF6BH211705	5VCACSKF9BH211763	5VCACSLE5BH211829
5VCACSKE9AH211638	5VCACSKF8BH211706	5VCACDLE9BH211764	5VCACSLE1BH211830
5VCACSKE9AH211641	5VCACSKFXBH211707	5VCACDLE0BH211765	5VCACSLE3BH211831
5VCACRKF0AH211657	5VCACSKF1BH211708	5VCACDLE2BH211766	5VCACSLE5BH211832
5VCACRKF2AH211658	5VCACLKF4BH211711	5VCACLKF9BH211767	5VCACSLE7BH211833
5VCACDLE1BH211659	5VCACLKF6BH211712	5VCACLKF0BH211768	5VCACSLE9BH211834
5VCACDLE8BH211660	5VCACLKF3BH211716	5VCACLKF2BH211769	5VCACRKF9BH211884
5VCACDLEXBH211661	5VCACLKF7BH211721	5VCACLKF9BH211770	5VCACRLE2BH211912
5VCACDLE1BH211662	5VCACLKF9BH211722	5VCACLKF0BH211771	
5VCACLLE1BH211669	5VCACLKF0BH211723	5VCACLKF2BH211772	
5VCACRKG0BH211670	5VCACLKF2BH211724	5VCACRKF2BH211774	
5VCACRKG2BH211671	5VCACLKF4BH211725	5VCACSKF2BH211779	
5VCACLLE1BH211672	5VCACLKF6BH211726	5VCACLKF8BH211811	
5VCACRKG6BH211673	5VCACLKF8BH211727	5VCACRLE9BH211812	
5VCACSKFXBH211674	5VCACLKFXBH211728	5VCACRLE0BH211813	
5VCACSKF1BH211675	5VCACLKF1BH211729	5VCACRLE2BH211814	
5VCACSLE8BH211677	5VCACLKF8BH211730	5VCACRLE4BH211815	
5VCACSLEXBH211678	5VCACRKF6BH211731	5VCACRLE6BH211816	
5VCACLLE4BH211679	5VCACRKF8BH211732	5VCACRLE8BH211817	
5VCACLKF8BH211680	5VCACRKF7BH211740	5VCACRLEXBH211818	
5VCACRKF6BH211681	5VCACRKF9BH211741	5VCACLLE5BH211819	
5VCACRKF8BH211682	5VCACRKF0BH211742	5VCACLLE1BH211820	
5VCACLKF9BH211686	5VCACRKF2BH211743	5VCACLKF0BH211821	
5VCACRKE1BH211689	5VCACRKF4BH211744	5VCACSLE4BH211823	
5VCACRKF9BH211697	5VCACRKF1BH211748	5VCACSLE6BH211824	
5VCACRLE0BH211701	5VCACRKF3BH211749	5VCACSLE8BH211825	
5VCACRLE2BH211702	5VCACLLE6BH211750	5VCACSLEXBH211826	
5VCACRLE4BH211703	5VCACDLE0BH211751	5VCACSLE1BH211827	

