

Thor Motor Coach Technical Service Bulletin 10-010



TSB # **TSB 10-010**
Description/Title: **2011 23U Heat Shield**
Affected Product Line(s): **Four Winds 23U Class C**

Service Campaign # : **RC000029**

Released Date: **12/17/2010**

Failure Code:

Document Date: **12/17/2010**

Time Allowed: **.5 Hrs**

Document Revision: **A**

2011 23U FOUR WINDS 5000, AND CHATEAU SPORT MOTORHOMES MANUFACTURED FROM OCTOBER 2010 THROUGH NOVEMBER 2010

(See affected Vin's below)

SUMMARY:

The engine exhaust runs down inside of the frame rail, behind LP tank, and does not have the proper heat shield in place.

PARTS REQUIRED:

FM-7145 has been shipped to each dealer affected by this TSB

(3) 1/4-20x3/4 Hex head Bolts

(3) 1/4 Lock Washers

(3) 1/4 Nuts

UNITS AFFECTED:

1FDWE3FS7BDA02423 1FDWE3FS7BDA02437

1FDWE3FS8BDA02432 1FDWE3FS9BDA02424


1FDWE3FS4BDA05134 1FDWE3FS9BDA05131

1FDWE3FS2BDA09828 1FDWE3FS3BDA00572

1GB6G3BG6A1161146 1FDWE3FS4BDA02427

1FDWE3FS4BDA02430 1FDWE3FS5BDA00573

1FDWE3FS6BDA00579 1FDWE3FS5BDA00590

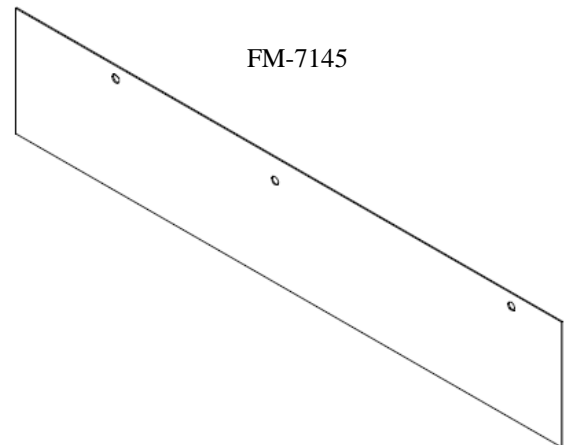

DIRECTIONS:

The heat shield will be placed behind the LP tank, on the outside of the frame rail, and attached using three existing holes in the frame. The Heat shield should hang down from the frame rail when in proper position.

