



1010 Johnson Drive
Buffalo Grove, IL
60089-6918

Phone: 847.777.6400
Fax: 847.520.2222
www.wabtec.com

SAFETY RECALL

MECHANICALLY FASTENED TEETER LEVER

NHTSA Recall No. 11E-010

April 28, 2011

Dear Vehicle Owner:

This notice is sent to you in accordance with the requirements of the National Highway Traffic and Motor Vehicle Safety Act.

Vapor Bus International has decided that a defect which relates to motor vehicle safety exists in certain buses equipped with Vapor Bus International Air-Open/Spring-Close Base Plate Assemblies incorporating Mechanically Fastened Teeter Levers and manufactured from March 1, 2007 to February 28, 2011. The cam plate may rotate relative to the hub of the teeter lever base, causing the attachment screws to fracture and permit the cam plate to partially or completely separate from the teeter lever base, preventing the door latching mechanism from maintaining the rear passenger doors in a closed and locked condition. A passenger leaning on the door might fall through the unlocked door and sustain injury, or, in the case of a moving bus, a passenger standing near the doors might be forced against the door with sufficient momentum to force the doors open, fall through the doors and sustain injury.

Based upon information obtained from New Flyer of America Inc. and from our records, certain **vehicles in your fleet**, as identified in the enclosed letter from New Flyer of America Inc. **are affected**. For this reason, Vapor recommends that all Mechanically Fastened Teeter Lever Assemblies be modified to remedy this defect.

The remedy for the defect consists of replacing the existing cam plate with a new cam plate that incorporates mechanical stops to prevent the cam plate from rotating relative to the teeter lever base. If the teeter lever base has already sustained significant damage, the entire teeter lever assembly would be replaced.

Vapor Bus International will arrange for qualified technicians to modify your vehicles to remedy this defect at a mutually convenient time and location at no cost to your organization. A Vapor Sales/Service representative will contact you within 30 days from the date of this letter to make arrangements for the modification.

Should you and the Vapor Sales/Service representative mutually agree that local circumstances favor your applying the remedy using your own vehicle maintenance personnel, Vapor Bus International will

SAFETY RECALL

**MECHANICALLY FASTENED
TEETER LEVER**

provide the necessary remediation parts and instructions. Upon receipt of a form (to be provided with the parts) signed by an authorized manager and showing the date of completion of the work on each bus, Vapor Bus International will reimburse your organization at the rate of \$ 25.00 per bus.

If this defect caused repairs to be made to an affected vehicle prior to this notification, you may be entitled to reimbursement for the cost of those repairs on the basis described above.

If you have questions concerning this recall or problems in obtaining the necessary materials, please telephone the undersigned at 847-777-6450.

We regret any inconvenience that this action may cause. However, we are concerned about the safety of your customers and employees. If Vapor Bus International fails to provide the information and parts required to remedy this defect without charge and within a reasonable time, you may submit a written complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE, Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

Thank you for your attention to this important matter.

Very truly yours,
Vapor Bus International



James R. Pearson
Marketing Manager