



ENTEGR  
COACH®

# Recall Campaign

NHTSA #: 11V-019

TC #: 2011-027

Job Code: 9901091

Flat Rate: 1 hour

## Part enclosed with notification

### ACTION REQUIRED:

Change the placement of the headlights so the low beam is on top and the high beam is on the bottom

### MODELS / UNITS:

#### 2010 Models

##### Aspire Class A Motor home

40DRQ A13A8051  
40SKT A13C8050-8057  
42RB A13G8051-8055

##### Insignia Class A Motor home

40FKSA A1ZC0051-0053  
40CKFL A1ZE0050-0051  
36CKFL A1ZJ0050-0052  
40SU A1ZP0050

#### 2011 Models

##### Aspire Class A Motor home

40DRQ B13A8051-8053  
40SKT B13C8051-8065  
42DL B13E8051-8056, 8063  
42RB B13G8051-8066, 8069  
42DLQ B13L8051-8053  
42RBQ B13N8051

##### Insignia Class A Motor home

40FKSA B1ZC8051-8053, 8056-8057  
40CKFL B1ZE8051-8054, 8056-8057  
36CKFL BA1ZJ8051-8053, 8055-8056

### KIT CONTENTS

N/A

### TOOLS/MATERIAL REQ.:


Slotted screwdriver  
Hammer

## Instructions

### Removing the headlights

1. Using a slotted screwdriver, carefully pry the (3) plastic clips off of the (bottom) headlight fastener posts (**Fig. 1a**). When the clips have been removed, remove the headlight by pulling back on the base. Repeat this process on the top headlight.

**NOTE:** Extra clips have been included in the event one breaks during the removal or installation process.

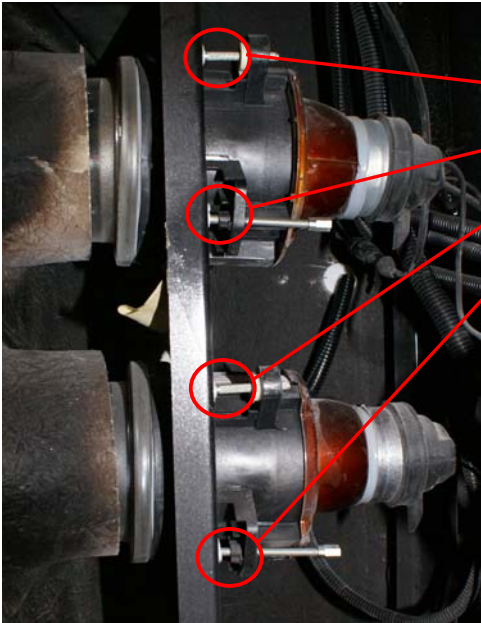

**NOTE:** The 3rd post is located on the top of the other side of the head light

**NOTE:** Some headlight applications may be in a different bracket. The removal process will be the same for either bracket.



### Re-installing the headlights

2. Insert the low beam headlight into the top bracket. Using a hammer, lightly tap the (3) fastener posts until the clip is securely fastened to the bracket. Make sure the headlight is securely fastened.
3. Insert the high beam headlight into the lower bracket. Using a hammer, lightly tap the (3) fastener posts until the clip is securely fastened to the bracket. Make sure the headlight is securely fastened.



**Correct installation**



**Low Beam**



**High Beam**

4. Repeat steps 1 through 3 on the other side of the unit.

Headlight recall

Rev. A 2/21/11  
February, 2011