



Recall Campaign

NHTSA #: 11V-251 TC #: 2011-166

Job Code: 9901094

Flat Rate: 1 hour

Parts will be supplied with recall notification

ACTION REQUIRED:

Remove and replace stabilizer jack bolts

MODELS / UNITS:

EAGLE SUPER LITE TRAVEL TRAILER

298RES **B1DL**0136-0142, 0144-0145, 0148-0156, 0158-0171, 0175-0177, 0180-0182

304BHK **B1DH**0232, 0235-0240, 0244, 0246, 0248-0249, 0252, 0254-0255, 0257-0269

314BDS **B1DJ**0317-0318, 0320-0329, 0331-0376

EAGLE TRAVEL TRAILER

320RLDS **B1CB**0226-0228, 0232-0234, 0236-0239, 0241, 0243-0244, 0246-0249, 0251

324BHDS **B1CV**0113, 0115-0116, 0119-0120, 0122-0123

330RLTS **B1CW**0051-0115, 0117-0122

JAY FLIGHT G2 TRAVEL TRAILER

29RLS **B1E2**0247-0267, 0269-0281, 0283-0285

KIT CONTENTS

Parts will be supplied with recall notification

(16) 5/16" bolts

(8) washers

Instruction sheet




TOOLS/MATERIAL REQ.:

1/2" socket wrench

Instructions

1. Remove (all) existing stabilizer jack bolts and replace with the bolts and washers (where applicable per pictures) supplied in the kit.

Manual Stabilizer Jack applications

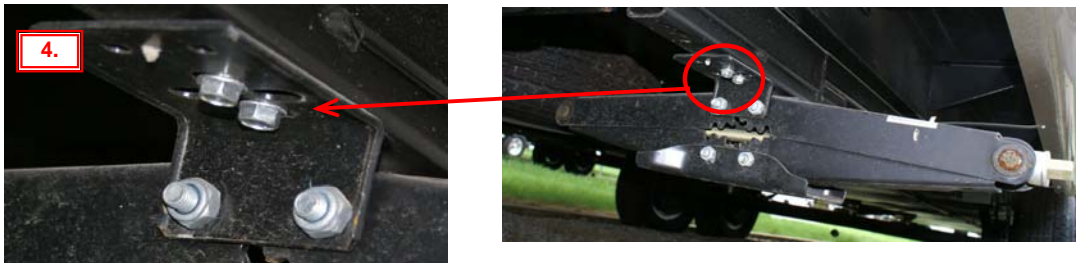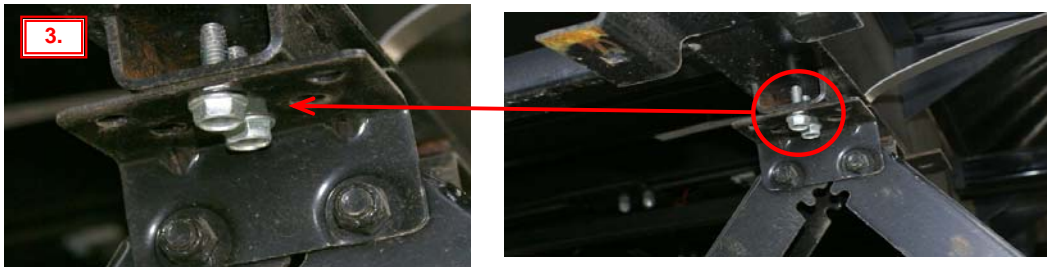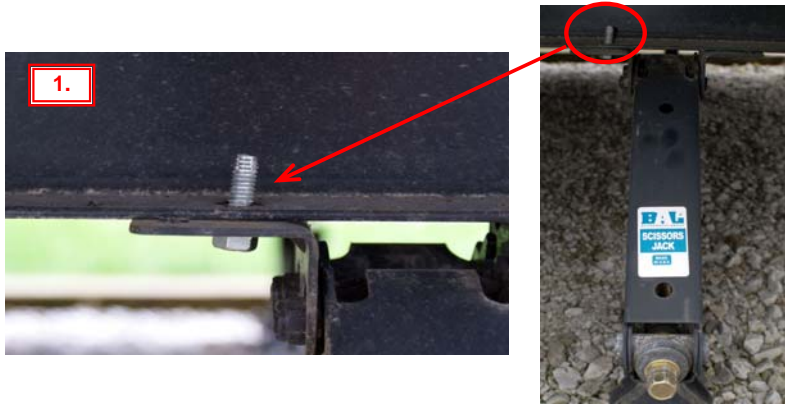

Electric Stabilizer Jack application

1. On the electric jack application, (2) additional bolts will need to be added. Drill (2) 9/32" holes in the frame rail bracket slot.

NOTE: Before drilling you will need to determine the best location for the holes. You will need to avoid any existing slots in the frame rail. Examine the frame rail to locate the slots and drill the hole so it will miss them. You will need a sharp drill bit to drill through the frame.

Install (2) bolts and washers in the newly drilled holes. Replace the existing bolts with those supplied in the kit. Re-use the original washers. (See Fig. 5)



Drill a hole and install additional (2) bolts and washers. Replace existing bolts (reuse the original washers)

