

Micro Bird Inc

**SAFETY
RECALL**

TITLE: Flat floor SB (torn wire insulation)

TO: Micro Bird distributors

PRODUCT: Girardin G5 school bus 2006 to 2010 Ford flat floor

Micro Bird G5 school bus 2010-2011 Ford flat floor

FROM: After Sales and Warranty department

Reference: Recall 11-045-EHU/NHTSA #11V-309

PLANNING

Description

This document contains procedures to modify the floor behind the driver on Ford buses G5 flat floor model.

Compliance

The warranty claim must be placed with Micro Bird within 45 days from the date of repair.

Manpower

Approximately .5 hours will be allowed to make modifications.

Note: It is recommended to read the entire procedure before performing repairs.

Note: It is assumed that all of the procedures required to embody this modification will be performed according to professionally accepted standards.

MODIFICATION INSTRUCTIONS

- 1- Push the driver's seat to the farthest position near the dash.
- 2- Remove the corner trim and the B Pillar trim.



- 3- Remove the aluminum trim and cut approximately one inch at the end.
- 4- Remove the same area on the corner of the floor using a wood chisel to allow clearance of the electrical harness. (The use of any saw is not recommended since there is a metal sheet under the plywood.)



- 5- Install a loom or any other protection against abrasion over the OEM harness. An electrical tape is not sufficient.
- 6- **Fix the harness in place using sealant (very important).**
- 7- Reinstall the aluminum trim.