

**Micro Bird Inc**

**SAFETY  
RECALL**

**TITLE:** Flat floor (torn wire insulation)

**TO:** Micro Bird distributors

**PRODUCT:** Girardin G5 bus 2006 to 2010 Ford flat floor

Micro Bird G5 bus 2010-2011 Ford flat floor

**FROM:** After Sales and Warranty department

**Reference:** Recall 11-044-EHU /NHTSA #11V-319

## PLANNING

### Description

This document contains procedures to modify the floor behind the driver on Ford buses G5 flat floor model.

### Compliance

The warranty claim must be placed with Micro Bird within 45 days from the date of repair.

### Manpower

Approximately .5 hours will be allowed to make modifications.

***Note: It is recommended to read the entire procedure before performing repairs.***


***Note: It is assumed that all of the procedures required to embody this modification will be performed according to professionally accepted standards.***

## MODIFICATION INSTRUCTIONS

- 1- Push the driver's seat to the farthest position near the dash.
- 2- Remove the corner trim and the B Pillar trim.



- 3- Remove the aluminum trim and cut approximately one inch at the end.
- 4- Remove the same area on the corner of the floor using a wood chisel to allow clearance of the electrical harness. (The use of any saw is not recommended since there is a metal sheet under the plywood.)

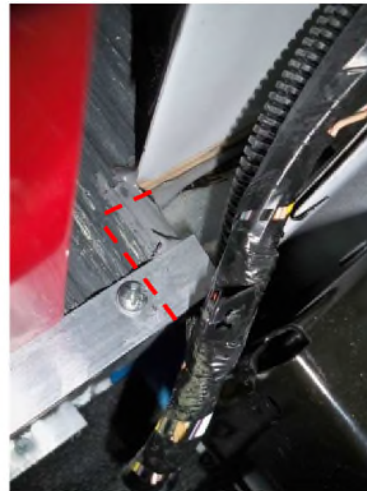

- 5- Install a loom or any other protection against abrasion over the OEM harness. An electrical tape is not sufficient.
- 6- **Fix the harness in place using sealant (very important).**
- 7- Reinstall the aluminum trim.