



# Parts Bulletin

SUBJECT <b>Recall 251: Inspect Fuel Lines for Contact with Underbody Coating - Model Year 2012 S60, XC60</b>				GROUP <b>80</b>		NO <b>251</b>	
				MARKET <b>United States, Canada</b>			PAGE <b>1 of 1</b>
COPY TO / CIRCULATIONS (PLEASE INITIAL)							
GENERAL MGR	PARTS MGR	SERVICE MGR	SALES MGR	DATE	YEAR	MONTH	DAY
					<b>2012</b>	<b>05</b>	<b>08</b>

Reference Bulletins: SMB 80-251  
TJ 26058

Volvo Cars of North America, LLC (Volvo) has decided to conduct a voluntary safety recall on certain model year 2012 S60 and XC60 vehicles.

An incorrect mixture of underbody coating, in combination with over-application, can result in rigid, icicle-like areas of underbody coating hanging from the undercarriage of the vehicle. If this condition is present in the location of the fuel lines, the underbody coating may penetrate the fuel lines resulting in fuel leakage.

The corrective action is to inspect all eligible vehicles, and if excessive under body coating is found in the fuel line area, it will be removed. If the fuel lines are damaged, they will be replaced.

Recall 251 affects 2,742 vehicles in the U.S. and 136 vehicles in Canada.

The following part numbers apply:

Part Number	Description	Qty
31303564	Rail	1
31336649	Plastic pipe	1
31303201	Feed line	1
31277380	Plastic pipe	1
31277381	Plastic pipe	1

Due to limited part supply, order on an as-needed basis. Most vehicles should only require an inspection.

**"Fixed Right — First Time"**

