

SAFETY RECALL NOTICE



Bombardier Recreational Products Inc.

565 de la Montagne Street
Valcourt, Québec, Canada J0E 2L0
T 450.532.2211 F 450.532.5133

www.brp.com

Date: April 17th, 2012

Re: Brake Pedal Connecting Rod Pins Replacement

Dear Can-Am™ Spyder™ Roadster Dealer / Distributor,

This notice is being sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act, the Canada Motor Vehicle Safety Act and other applicable laws. Bombardier Recreational Products Inc. and BRP US Inc. (“BRP”) have decided that a defect which relates to motor vehicle safety exists on certain roadsters models and are conducting a voluntary safety recall.

What is the potential problem?

A pin securing the brake pedal connecting rod could disengage and eventually fall off. This could cause a total loss of main brake function without prior warning. This condition may increase the risk of a crash possibly resulting in injury or death

Which models are involved?

Model	Model Year
Spyder RT Series	2010

What will BRP do?

BRP is sending a Safety Recall letter to all known registered owners of the involved Can-Am Spyder roadsters. This letter urges that the owners immediately contact their authorized BRP Can-Am Spyder roadster dealer to have the vehicle repaired. Also, BRP is posting this notice and attached Safety Campaign Bulletin on its BOSSWeb / Knowledge Center dealer websites (www.bossweb.brp.com) and on its public website (www.can-am.brp.com).

What should you do?

1. Do not sell or deliver any involved vehicle that you have in stock as federal law requires you to complete the recall service on these vehicles before delivery.
2. Contact all of your customers who have purchased an affected Can-Am Spyder roadster. You must inform them about the foregoing and must request them to make an appointment to get their vehicle repaired.
3. Follow all instructions provided in the attached Safety Campaign Bulletin.

Please note that the National Traffic and Motor Vehicle Safety Act provides that each vehicle which is subject to a recall campaign of this type must be adequately repaired within a reasonable time after the owner has tendered it for repair. Failure to repair within sixty (60) days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. The owner may be entitled to an identical or reasonable equivalent vehicle at no charge or to a refund of the purchase price less a reasonable allowance for depreciation.

Ski-Doo
Lynx
Sea-Doo
Evinrude
Johnson
Rotax
Can-Am

If you have questions about this notice, please call:

- **In USA and Canada: 1 888 638-5397,**
- **Dealers of other countries (outside Canada and USA) please contact your local distributor or regional office which can be found at www.brp.com or call: 1 819 566-3366 (8:00 to 18:00 Eastern time).**

Sincerely

After-Sales Service Department
Bombardier Recreational Products Inc.

**SAFETY**
CAMPAIGN**ROADSTER**
WARRANTY
Bulletin

⚠ WARNING: All involved customers must be notified, all involved units must be corrected as per instructions herein.

Campaign no.: 2010-0014

April 16th, 2012Subject: **Spyder™ RT Brake Pedal Connecting Rod
Pins Replacement**No. **2010-11**

YEAR	MODEL	MODEL NUMBER	SERIAL NUMBER
2010	Spyder RT Series	All	All

PROBLEM

A pin securing the brake pedal connecting rod could disengage and eventually fall off.

This could cause a total loss of main brake function without prior warning. This condition may increase the risk of a crash possibly resulting in injury or death.

SOLUTION

Replace the brake pedal connecting rod retaining pins.

REQUIRED PARTS


DESCRIPTION	P/N	QTY
Pin	250 400 062	2
Cotter pin	371 800 700	2

PROCEDURE


Brake Pedal Connecting Rod Retaining Pins Replacement

Work from underneath the RH side of the vehicle.

1

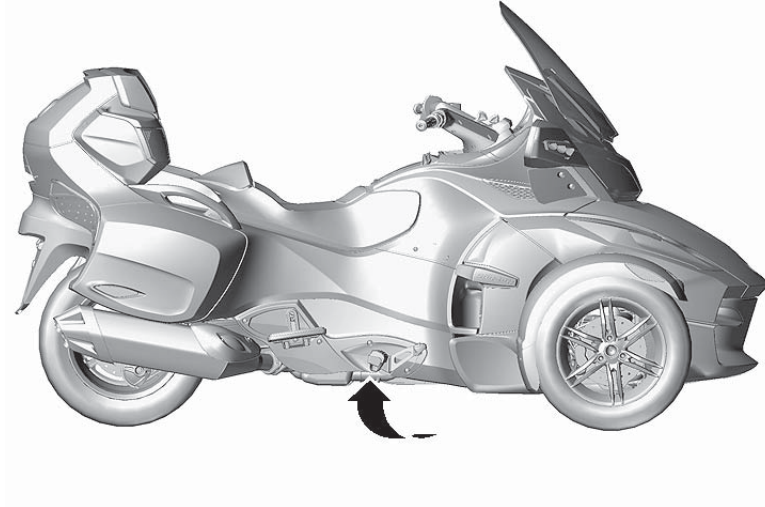


2

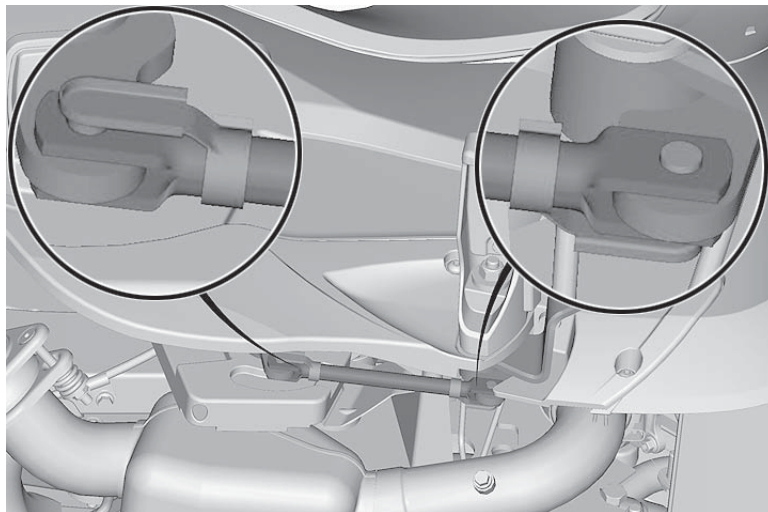


ORIGINAL RETAINING PINS TO BE REPLACED

Replace **both** brake pedal connecting rod retaining pins as follows.

3

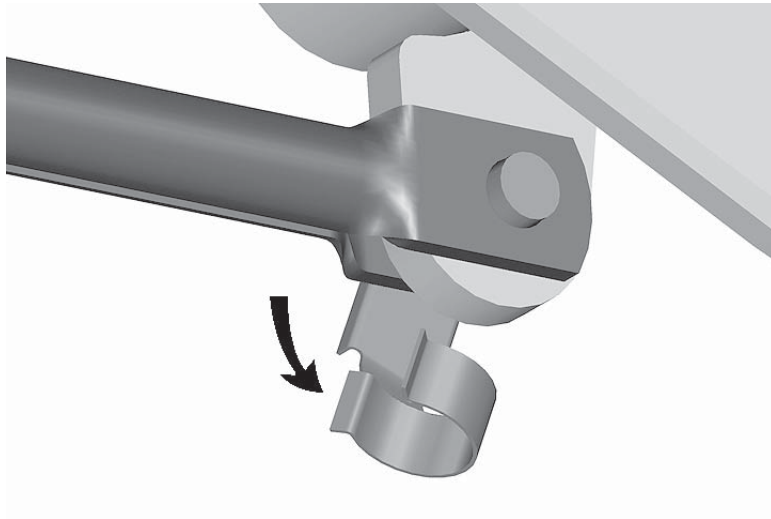


4

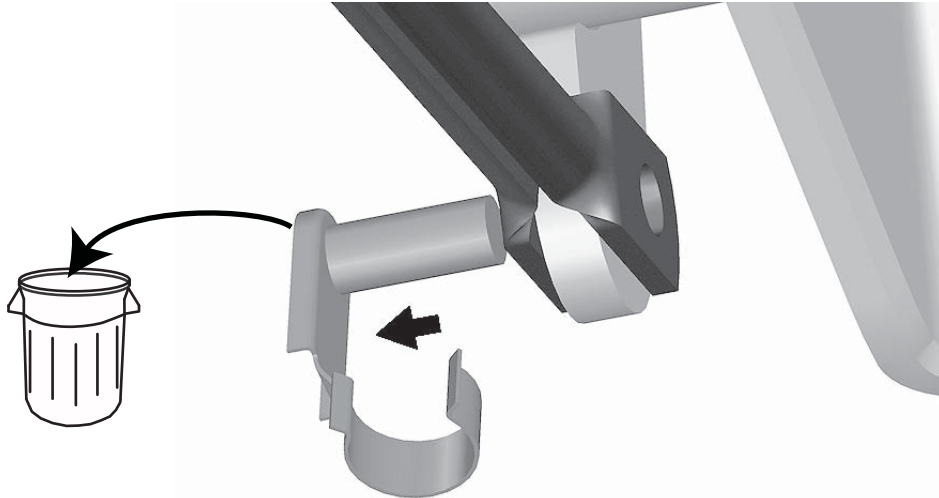


Apply a thin layer of XPS SYNTHETIC GREASE (P/N 293 550 010) on the new retaining pins surface.


5

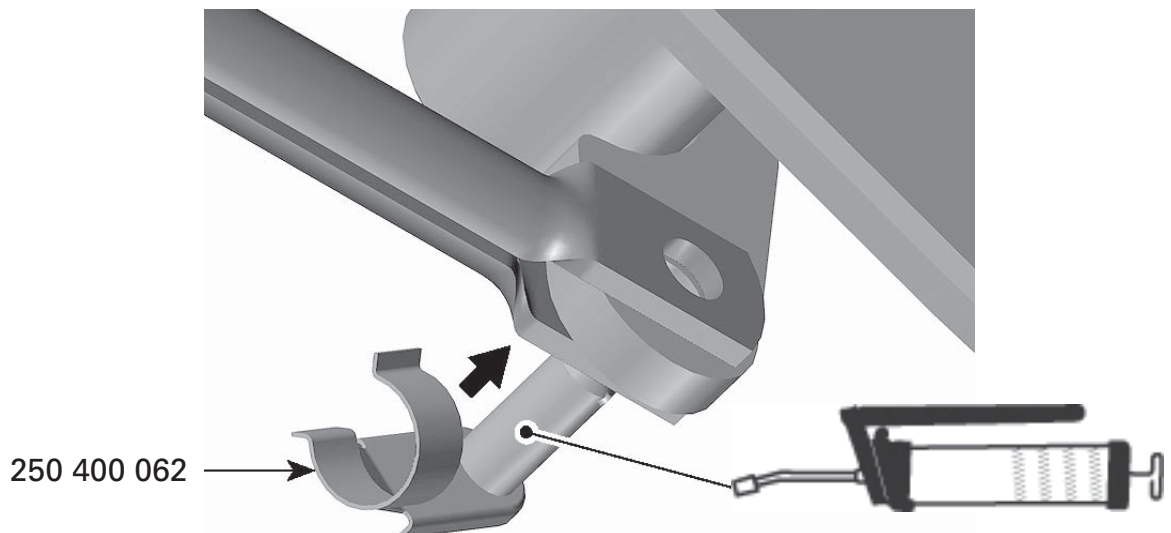

6

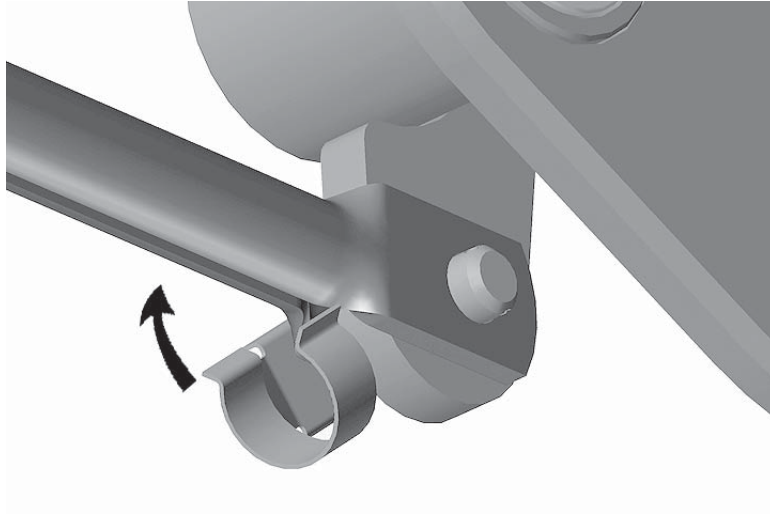


7

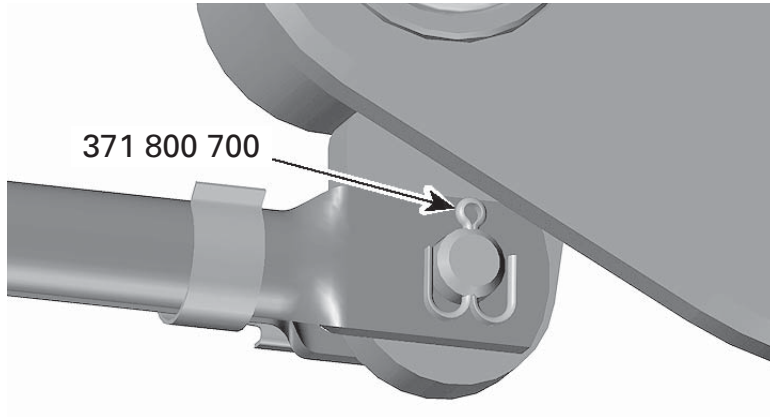

IMPORTANT: Replace **both** retaining pins.

8

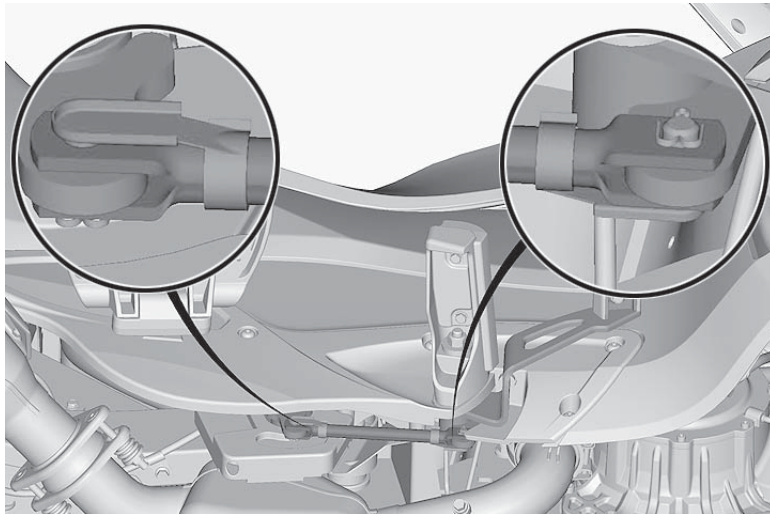

NEW RETAINING PINS PROPERLY INSTALLED

WARRANTY

Submit a warranty claim using the following information:

For claiming procedure, refer to the *DEALER/DISTRIBUTOR WARRANTY GUIDE*.

REPAIR	
Campaign Number	2010-0014
Claim Type	Campaign Claim
Action	Inspect and repair
Flat Rate Time	0.3

Click in the **Repair** check box.

The screenshot shows a form with a section titled '*Action'. Below this title are two radio button options: 'Inspect' and 'Repair'. The 'Repair' option is selected, and a black arrow points to its checkbox. Below the form is a button labeled 'Upload File' and the text 'mbg2012-010-004_ben'.