CHECK PROCEDURE FOR TURN SIGNAL CANCELLING

Affected Vehicles: Certain 2012 Lancer, Lancer Sportback, Lancer Evolution, Outlander, Outlander Sport and "i" vehicles. Refer to the VIN list provided separately.

Test	Procedure and Checklist:
Test	the vehicle's turn signal cancel operation and complete the following checklist:
VIN:	Prod. Date:
	- Step #1 – Start the engine and let idle (iMiEV put start switch into the Ready mode).
	- Step #2 – Center the steering wheel.
	- Step #3 – Operate the left side turn signal. Hold the turn signal lever in the on position while turning the steering wheel.
	- Step #4 – Turn the steering wheel approximately 180 degrees to the left while holding the turn signal lever in the on position.



Step #5 – Turn the steering wheel back to the straight-ahead
position. Did you feel or hear a clicking noise from the turn
signal cancel mechanism?
Yes, continue to step #7.
No, Replace the combo switch assembly (PNC: 82041).
Refer to ASA-CAPS for the correct part number.

Step #6 – Release the turn signal lever and return the steering wheel to the straight ahead position



Step #7 – Repeat steps 2 thru 6, turning to the RIGHT, and listen and feel for the clicking noise from the turn signal cancel mechanism. Do you hear and feel the clicking noise while turning the steering wheel back towards the center position?
Yes, continue to step 8.
No: Replace the combo switch assembly (PNC: 82041). Refer to ASA-CAPS for the correct part number.
Step #8 – Repeat steps 2 thru 7, this time <u>without holding the turn signal lever down</u> . Operate the turn signal, as normal, and make certain that the turn signal auto cancels while turning both to the left side and the right.
Yes, the inspection is complete.
No, Replace the combo switch assembly (PNC: 82041). Refer to ASA-CAPS for the correct part number.
Step #9 – Repeat the test procedure to confirm proper operation of the new combo switch.

WARRANTY INFORMATION

Submit a normal warranty claim for the one operation performed as listed below:

Model Name &	Labor	Lancer	Lancer	Lancer	Lancer		Outlander	
Labor Operation Number	Operation No.	Sedan	Evolution	Ralliart	Sportback	Outlander	Sport	i-MiEV
Inspect Combo Switch	54821197	0.2	0.2	0.2	0.2	0.2	0.2	0.2
Inspect Only - No replacement needed								
Inspect & Replace Combo Switch	54821198	0.7	0.9	0.8	0.7	0.6	0.7	0.7
Replace Column Combo Switch								
								·

Step #10 – When inspection and any required repairs are complete, fax this form to John Robertson (714) 934-7554