



Applies To: **2012 Accord 2-Door** – Check the iN VIN status for eligibility
2012 Accord 4-Door – Check the iN VIN status for eligibility
2012 Crosstour – Check the iN VIN status for eligibility

January 28, 2012

Safety Recall: Driver's (Left) Side Curtain Airbag May Not Deploy

(Supersedes 12-008, dated January 27, 2012, to revise the information marked by the black bars)

REVISION SUMMARY

WARRANTY CLAIM INFORMATION was added.

BACKGROUND

An incorrect propellant mixture was used in the driver's side curtain airbag. If the vehicle is involved in a crash, the driver's side curtain airbag may fail to deploy, leading to increased potential for injury or death.

CUSTOMER NOTIFICATION

Owners of affected vehicles have or will receive a notification of this campaign.

Do an **iN VIN status inquiry** to make sure the vehicle is shown as eligible.

In addition, check for a punch mark above the first character of the engine compartment VIN. A punch mark in that location means this campaign has already been completed.

Some vehicles affected by this campaign may be in your new or used vehicle inventory. These vehicles must be repaired before they are sold.

Should a dealership sell an unrepaired vehicle that subsequently causes an injury or damage because of the recalled item, the dealership will be solely responsible to the damaged party, and will be required to defend and indemnify American Honda for any resulting claims. To see if a vehicle in inventory is affected by this campaign, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Replace the driver's side curtain airbag.

PARTS INFORMATION

Left Side Curtain Airbag Module:

- Accord 2-door (LX, LX-S) – P/N 78875-TE0-A80
- Accord 2-door (EX, EX-L) – P/N 78875-TE0-A90
- Accord 4-door (LX, SE) – P/N 78875-TA5-A60
- Accord 4-door (EX, EX-L) – P/N 78875-TA5-A70
- Crosstour – P/N 78875-TP6-A80

Front Clip (Accord and Crosstour): P/N 91561-TA5-A01 (Two required)

Rear Clip (Accord): P/N 91561-TA5-A11 (Two required)

WARRANTY CLAIM INFORMATION

NOTE: The current REPAIR PROCEDURE and FRT are under review and may change.

OP#	Description	FRT
7521G1	Replace the driver's side curtain airbag - Accord 2-door	2.1
A	Replace the driver's side curtain airbag - add for Accord 4-door	0.4
7521G1	Replace the driver's side curtain airbag - Crosstour	2.9

Failed Part: P/N 78875-TE0-A90

Defect Code: 5HA00

Campaign Code: S1900

Skill Level: Repair Technician

REPAIR PROCEDURE

1. Replace the driver's (left) side curtain airbag:
 - Refer to the SRS section of the appropriate service manual, or
 - Online, under Search by Vehicle, enter keyword **CURTAIN** and select the applicable **Side Curtain Airbag Replacement** instructions from the list.
2. Center-punch a completion mark above the first character of the engine compartment VIN:

Center-punch here.



CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.